

Subsurface Exploration and Pavement Analysis Proposed New Streets Apollo Oaks Subdivision Bexar County, Texas

InTEC Project No. S251061-R1 August 05, 2025

Invest 5S, LLC 22202 Cielo Vista San Antonio, Texas 78255



Integrated Testing and Engineering Company of San Antonio, L.P. Geotechnical & Environmental Engineering • Construction Services • Geologic Assessment

August 05, 2025

Invest 5S, LLC

22202 Cielo Vista

San Antonio, Texas 78255

Attention:

Mr. Tyler Schlinke

Email:

tyler@invest5s.com

Re:

Subsurface Exploration and Pavement Analysis

Proposed New Streets

Apollo Oaks Subdivision

Bexar County, Texas

InTEC Project No. S251061-R1

Ladies & Gentlemen:

Integrated Testing and Engineering Company of San Antonio (InTEC) completed a subsurface exploration and pavement thickness evaluation report (InTEC Project No. S251061 dated March 21, 2025) at the above referenced project site. As requested, deeper borings were drilled once the path to the boring locations were cleared for drill rig access.

We appreciate and wish to thank you for the opportunity to be of service to you on this project. If we can be of additional assistance during the foundation explorations, and materials testing-quality control phase of construction, please call us.

Sincerely,

InTEC of San Antonio

Murali Subramaniam, Ph. D., P.E.

Vice President



08/06/2025



EXECUTIVE SUMMARY

The soil conditions at the location of the proposed new streets at Apollo Oaks Subdivision in Bexar County, Texas were obtained from drilling four borings to a depth of 12 feet each. In addition, four test pits were excavated at the same locations. Laboratory tests were performed on selected specimens to evaluate the engineering characteristics of various soil strata encountered in the borings.

The results of our exploration, laboratory testing and engineering evaluation indicate the underlying shallow clays at this site are **moderately plastic to highly plastic in character.** Potential vertical movements on the order of **1 to 1 % inches** were estimated.

The proposed pavements at this site may be supported by flexible pavement sections.

- Soils encountered in the borings indicate the soils at the site consist of brown clays to limited thickness underlain by tan to light tan weathered limestone to limestone with caliche, gravel, and clay seams.
- Cut and fill information is not available for our review at this time. Soil conditions in-between the borings may be different from what is shown in the Boring Logs. Any cut / fill may also change the final pavement subgrade.
- Clay or Limestone subgrades are anticipated.
- At the time of construction, if the final street subgrade consists of material other than encountered in our test pits, the recommendations may have to be revised.
- Pavement section recommendations for Local type streets are presented.
- Ground water was not encountered in the borings at the time of drilling.

Detailed descriptions of subsurface conditions, engineering analysis, and design recommendations are included in this report.



Summary Table A – Minimum Flexible Pavement Recommendations

Classification	Asphaltic Concrete		Aggregate		Subgrade,	Structural	
	Type D, inches	Type C, inches	Type B, inches	Base, inches	Geogrid	inches	Number
Local Type A	2.00	-	-	9.50	No	6" LS	2.69
(no bus traffic)	2.00	-	5.00	-	No	6" LS	3.06
Local Type A (with bus traffic)	3.00	-	-	14.00	No	6" LS	3.76
	3.00	-	-	11.50	Yes	6" LS	3.75
	3.00		6.00	-	No	6" LS	3.84
Local Type B	3.00	-	-	20.50	No	6" LS	4.67
	2.00	2.00	-	17.50	No	6" LS	4.69
	3.00	-	-	17.00	Yes	6" LS	4.69
	2.00	2.00	-	14.50	Yes	6" LS	4.70
	3.00	-	8.50	-	No	6" LS	4.69

Subgrade Notes (*):

- Cut and fill data are not available at this time.
- Any fill placed to raise the grade should be approved by the geotechnical engineer. Approved fill
 material should be free of deleterious material with a minimum CBR value of 5.0 and a maximum
 Plasticity Index value of 45. The gravel size should not exceed 3 inches in diameter. The material
 should be placed as per applicable city or county guidelines.
- Based on the soils encountered in the borings, we anticipate the final pavement subgrade Plasticity Index (PI) values to be less than or equal to 20 or greater than 20.
- <u>LS:</u> As per Bexar County requirements, subgrade stabilization is required if the final subgrade Plasticity Index values are greater than 20.
 - Subgrade stabilized with lime. An application rate of 30 lbs per sq yard for 6 inch depth of may be used. We recommend that the application rate be determined at the time of construction.
 - Soil sulfate content should be tested prior to lime application.
 - Field mixed lime samples should be tested for compressive strength. A minimum compressive strength value of 160 psi is required.
 - Subgrade may be stabilized with Cement in-lieu of lime. Cement application rate should be determined at the time of construction.
- As per Bexar County requirements, subgrade stabilization is not needed if the final subgrade Plasticity Index values are less than equal to 20.
- Final pavement subgrade should be verified by InTEC at the time of construction.



General Notes:

- Design California Bearing Ratio value of 2.5 was used. California Bearing Ratio for stratum II soils were also performed is higher than 5.0.
- Input parameters used in pavement section calculations are shown in Table No. 3 (Summary Table B). Please call us to provide pavement recommendations, if needed, for different input values.
- If repetitive truck or heavy truck traffic is anticipated, please contact us for revised pavement recommendations.
- Pavement section recommendations are based on a subgrade CBR value of 2.5. The pavement recommendations are not based on the shrink / swell characteristics of the underlying soils. The pavement can experience cracking and deformation due to shrinkage and swelling characteristics of the soils as described in the Vertical Movements section of this report. Use of geogrid will help reduce the shrink / swell related reflective cracking.
- If water is allowed to get underneath the asphalt / concrete or if moisture content of the base or subgrade changes significantly, then pavement distress will occur. Moisture penetration underneath the asphalt pavement surface should be reduced. One of the following methods should be used:
 - o Deeper curbs; such as curbs extending a minimum of 3 inches into subgrade.
 - Compacted clays backfilled against the curbs.
- In addition, water should not be allowed to get underneath the pavement section at the time of home construction.

Geogrid:

• One layer of geogrid, Tensar Triax TX130 or better, installed on top of compacted (compacted or stabilized) subgrade as per manufacturer's guidelines.

Subgrade Delineation:

• At the time of construction, the final pavement subgrade should be verified / delineated by the geotechnical engineer.



<u>Summary Table B – Input Parameters used in Asphalt Pavement Section Calculation</u>

	Local Type A (no bus traffic)	Local Type A (with bus traffic)	Local B			
ESAL	100,000	1,000,000	2,000,000			
Reliability Level	R-70	R-70	R-90			
Initial and Terminal Serviceability	4.2 and 2.0	4.2 and 2.0	4.2 and 2.0			
Standard Deviation	0.45	0.45	0.45			
Service Life	20 years	20 years	20 years			
	•	•				

If heavy truck traffic is anticipated, please contact InTEC with anticipated traffic data for revised recommendations.

<u>Summary Table C – Summary of Pavement Materials</u>

Pavement Section	Material	Stabilization or Treatment	Thickness
Subgrade	Tan Calcareous Clay, Marl to Limestone (Plasticity Index <= 20)	Moisture conditioned clays	-
	Clays (Plasticity Index > 20)	Stabilized clays	6 inch thick
Base	TxDOT Item 247 A1-2	-	As recommended in pavement options (maximum of 6 inches per lift)
Asphalt	Type B, C, D	-	As recommended in pavement options
Geogrid	Tensar Triax TX130 or better	One layer	As per manufacturer's recommendations

See report for more details



<u>Summary Table D – Applicable procedures and minimum density and moisture percentages</u>

All applicable City of San Antonio Standard Specifications for Construction, June 2008, should be followed. Some of the relevant procedures are shown below.

Pavement Material	Procedure *	Density and Moisture Control
Subgrade fill (maximum 6 inch thick lifts)	Item 107	As per construction specifications
Aggregate Base TxDOT Item 247 A1-2 (maximum 6 inch thick lift)	Item 200	As per construction specifications
Asphalt HMAC Type B, D	Item 205, 206	As per construction specifications
Geogrid	Manufacturer's Guidelines	-

^(*) City of San Antonio Standard Specifications for Construction, June 2008



TABLE OF CONTENTS

INTRODUCTION	8
General	8
Purpose and Scope of Services	8
Project Description	9
SUBSURFACE EXPLORATION	10
Scope	10
Drilling and Sampling	
Field Tests and Water Level Measurements	10
Field Logs	11
Presentation of the Data	11
LABORATORY TESTING PROGRAM	12
Purpose	12
Laboratory Tests	12
Presentation of the Data	12
GENERAL SUBSURFACE CONDITIONS	13
Soil Stratigraphy	13
Ground Water Observations	13
PAVEMENTS ON EXPANSIVE SOIL	14
General	14
Evaluation of the Shrink-Swell Potential of the Soils	14
The Mechanism of Swelling	14
Initial Moisture Condition and Moisture Variation	14
Man Made Conditions That Can Be Altered	
Summation	18
DESIGN ENGINEERING ANALYSIS	19
Pavement Design Considerations	19
Vertical Movements	19
PAVEMENT GUIDELINES	21
General	21
Pavement Design	21
"Alligator" Type Cracks	22
Longitudinal Cracks	22
Periodic Maintenance	23
Pavement Sections	23
Subgrade Preparation	26
Base Course	27
Asphaltic Concrete	27
Perimeter Drainage	27
CONSTRUCTION GUIDELINES	28
Construction Monitoring	28
Site Preparation	28
Proof Rolling	28
Compaction	28
Select Fill	29
General Fill	29



General Fill Compaction	29
Ground Water	30
Drainage	30
Temporary Drainage Measures	
Construction Slopes	
Time of Construction	
Control Testing and Field Observation	31
DRAINAGE AND MAINTENANCE	
LIMITATIONS	34



INTRODUCTION

General

This report presents the results of our subsurface exploration and pavement thickness evaluation for the proposed new streets at Apollo Oaks Subdivision in Bexar County, Texas. This project was authorized by Mr. Tyler Schlinke.

Purpose and Scope of Services

The purpose of our subsurface investigation was to evaluate the site's subsurface and ground water conditions and provide pavement thickness recommendations for the development phase of the project. Our scope of services includes the following:

- drilling and sampling of four borings to a depth of 12 feet each and excavation of four test pits to a depth of 2 feet each;
- evaluation of the in-place conditions of the subsurface soils through field penetration tests;
- 3) observing the ground water conditions during drilling / excavation operations;
- 4) performing laboratory tests such as Atterberg limits, California Bearing Ratio (C.B.R.), and Moisture content tests;
- review and evaluation of the field and laboratory test programs during their execution with modifications of these programs, when necessary, to adjust to subsurface conditions revealed by them;
- compilation, generalization and analyses of the field and laboratory data in relation to the project requirements;
- 7) estimate of potential vertical movements;
- 8) preparation of pavement guidelines;
- 9) preparation of a written geotechnical engineering report for use by the members of the design team in their preparation of construction, contract, and specifications documents.

The Scope of Services **did not include slope stability or any environmental assessment** for the presence or absence of wetlands or hazardous or toxic materials in the soil, surface water, groundwater, or air, on or below or around this site. Any statements in this report or on the Boring Logs regarding odors, colors or unusual or suspicious items or conditions are strictly for the information of the client.



Project Description

The proposed project involves the development of new streets at Apollo Oaks Subdivision in Bexar County, Texas. The proposed pavement areas are anticipated to include Local type streets. Clay or Limestone subgrades are anticipated. Cut and fill information is not available at this time.

A review of the aerial map indicates numerous trees / dense vegetation within the western half of the site, and a cleared area with an existing building in the eastern half. Review of the topographic map indicates the site generally slopes from the northwest to the southeast. Review of the geologic map indicates the site is located within Kbu, Buda Limestone, formation.

Limestone was encountered in the borings. The Bexar County Karst Map indicates the site is located within "Karst Zone 3" (areas that probably do not contain listed invertebrate karst species). Karst features are formed in limestone, dolomite, or gypsum by dissolution. A geophysical study of the site may indicate the presence and potential impact of Karst features, caves, or significant cavities on the building performance and construction delays. The thickness of the Stratum I clay is likely to vary across the site. Geophysical study is not within the scope of this investigation.



SUBSURFACE EXPLORATION

Scope

The field exploration to determine the engineering characteristics of the subsurface materials included a reconnaissance of the project site, drilling the borings, excavating the test pits, performing Standard Penetration Tests, and obtaining Split Barrel and bulk samples.

Four soil test borings were drilled at the approximate locations shown on the Boring Location Plan, Plate 1, included in the Illustration section of this report. These borings were drilled to a depth of 12 feet each below the presently existing ground surface. Boring locations were selected by the project geotechnical engineer and established in the field by the drilling crew using normal taping procedures.

Drilling and Sampling

The soil borings were performed with a drilling rig equipped with a rotary head. Conventional solid stem augers were used to advance the hole and samples of the subsurface materials were obtained **using a Split Barrel sampler.** The test pits were performed with a mini-excavator and bulk samples were obtained. The samples were identified according to boring number and depth, encased in polyethylene plastic wrapping to protect against moisture loss, and transported to our laboratory in special containers.

Field Tests and Water Level Measurements

<u>Penetration Tests</u> – During the sampling procedures, **Standard Penetration Tests were performed** in four borings in conjunction with the split-barrel sampling. The standard penetration value (N) is defined as the number of blows of a 140-pound hammer, falling thirty inches, required to advance the split-spoon sampler one foot into the soil. The sampler is lowered to the bottom of the drill hole and the number of blows recorded for each of the three successive increments of six inches penetration. The "N" value is obtained by adding the second and third incremental numbers. The results of the standard penetration test indicate the relative density and comparative consistency of the soils, and thereby provide a basis for estimating the relative strength and compressibility of the soil profile components.

<u>Water Level Measurements</u> – Ground water was not encountered in the borings at the time of drilling. In relatively pervious soils, such as sandy soils, the indicated elevations are considered reliable ground water levels. In relatively impervious soils, the accurate determination of the ground water elevation may not be



possible even after several days of observation. Seasonal variations, temperature and recent rainfall conditions may influence the levels of the ground water table and volumes of water will depend on the permeability of the soils.

Field Logs

A field log was prepared for each boring. Each log contained information concerning the sampling method, samples attempted and recovered, indications of the presence of various materials such as silt, clay, gravel or sand and observations of ground water. It also contained an interpretation of subsurface conditions between samples. Therefore, these logs included both factual and interpretive information.

Presentation of the Data

The final logs represent our interpretation of the contents of the field logs for the purpose delineated by our client. The final logs are included on Plates 2 thru 5 included in the Illustration section. A key to classification terms and symbols used on the logs is presented on Plate 6.



LABORATORY TESTING PROGRAM

Purpose

In addition to the field exploration, a supplemental laboratory testing program was conducted to determine additional **pertinent engineering characteristics** of the subsurface materials necessary in evaluating the soil parameters.

Laboratory Tests

All phases of the laboratory testing program were performed in general accordance with the indicated applicable ASTM Specifications as indicated in Table No. 1.

Table No. 1 – Laboratory Test Procedures

Laboratory Test	Applicable Test Standard
Liquid Limit, Plastic Limit and Plasticity Index of the Soils	ASTM D 4318
Moisture Content	ASTM D 2216
California Bearing Ratio	ASTM D 1883

In the laboratory, each sample was observed and classified by a geotechnical engineer. As a part of this classification procedure, the natural water contents of selected specimens were determined. Liquid and plastic limit tests were performed on representative specimens to determine the plasticity characteristics of the different soil strata encountered.

Presentation of the Data

In summary, the tests presented were conducted in the laboratory to evaluate the engineering characteristics of the subsurface materials. The results of all these tests are presented on appropriate Boring Logs. These laboratory test results were used to classify the soils encountered generally according to the Unified Soil Classification System (ASTM D 2487).



GENERAL SUBSURFACE CONDITIONS

Soil Stratigraphy

The soils underlying the site may be grouped into **two generalized strata** with similar physical and engineering properties. The lines designating the interface between soil strata on the logs represent approximate boundaries. Transition between materials may be gradual. The soil stratigraphy information at the boring locations are presented in **Boring Logs, Plates 2 thru 5.** The soil conditions in between borings may vary across the site. We should be called upon at the time of construction to verify the soil conditions between our borings.

The engineering characteristics of the underlying soils, based the results of the laboratory tests performed in selected samples, are summarized and presented in the following paragraph.

The underlying brown clays, tan clays, and light tan to light tan weathered limestone to limestone are moderately plastic to highly plastic with tested liquid limit values varying from 21 to 68 and plasticity index values ranging from 07 to 48. The results of Standard Penetration Tests performed within these clays varied from 20 to greater than 50 blows per foot

The above description is of a generalized nature to highlight the major soil stratification features and soil characteristics. The Boring Logs should be consulted for specific information at each boring location.

Soil stratigraphy may vary between boring locations. <u>If deviations from the noted subsurface conditions</u> are encountered during construction, they should be brought to the attention of InTEC. We may revise the recommendations after evaluating the significance of the changed conditions.

Ground Water Observations

Ground water was not encountered in the borings at the time of drilling. Short term field observations generally do not provide accurate ground water levels. The contractor should check the subsurface water conditions prior to any excavation activities. The low permeability of the soils would require several days or longer for ground water to enter and stabilize in the bore holes. Ground water levels will fluctuate with seasonal climatic variations and changes in the land use.

It is not unusual to encounter shallow groundwater during or after periods of rainfall. The surface water tends to percolate down through the surface until it encounters a relatively impervious layer.



PAVEMENTS ON EXPANSIVE SOIL

General

There are many plastic clays that swell considerably when water is added to them and then shrink with the loss of water. Pavements constructed on these clays (such as if thicker clays are encountered or if clayey trench backfills are used) are subjected to large uplifting forces caused by the swelling.

In the characterization of a pavement site, two major factors that contribute to potential shrink-swell problems must be considered. Problems can arise if a) the soil has expansive and shrinkage properties and b) the environmental conditions that cause moisture changes to occur in the soil.

Evaluation of the Shrink-Swell Potential of the Soils

Subsurface sampling, laboratory testing and data analyses are used in the evaluation of the shrink-swell potential of the soils under the pavements.

The Mechanism of Swelling

The mechanism of swelling in expansive clays is complex and is influenced by a number of factors. Basically, expansion is a result of changes in the soil-water system that disturbs the internal stress equilibrium. Clay particles in general have negative electrical charges on their surfaces and positively charged ends. The negative charges are balanced by actions in the soil water and give rise to an electrical interparticle force field. In addition, adsorptive forces exist between the clay crystals and water molecules, and Van Der Waals surface forces exist between particles. Thus, there exists an internal electro-chemical force system that must be in equilibrium with the externally applied stresses and capillary tension in the soil water. If the soil water chemistry is changed either by changing the amount of water or the chemical composition, the interparticle force field will change. If the change in internal forces is not balanced by a corresponding change in the state of stress, the particle spacing will change so as to adjust the interparticle forces until equilibrium is reached. This change in particle spacing manifests itself as a shrinkage or swelling.

Initial Moisture Condition and Moisture Variation

Volume change in an expansive soil mass is the result of increases or decreases in water content. The initial moisture content influences the swell and shrink potential relative to possible limits, or ranges, in moisture content. Moisture content alone is useless as an indicator or predictor of shrink-swell potential. The



relationship of moisture content to limiting moisture contents such as the plastic limit and liquid limit must be known.

If the moisture content is below or near plastic limit, the soils have high potential to swell. It has been reported that expansive soils with liquidity index* in the range of 0.20 to 0.40 will tend to experience little additional swell.

The availability of water to an expansive soil profile is influenced by many environmental and manmade factors. Generally, the upper few feet of the profile are subjected to the widest ranges of moisture variation, and are least restrained against movement by overburden. This upper stratum of the profile is referred to as the active zone. Moisture variation in the active zone of a natural soil profile is affected by climatic cycles at the surface, and fluctuating groundwater levels at the lower moisture boundary. The surficial boundary moisture conditions are changed significantly simply by placing a barrier such as a building floor slab or pavement between the soil and atmospheric environment. Other obvious and direct causes of moisture variation result from altered drainage conditions or man-made sources of water, such as irrigation or leaky plumbing. The latter factors are difficult to quantify and incorporate into the analysis, but should be controlled to the extent possible for each situation. For example, proper drainage and attention to landscaping are simple means of minimizing moisture fluctuations near structures, and should always be taken into consideration.

Man Made Conditions That Can Be Altered

There are a number of factors that can influence whether a soil might shrink or swell and the magnitude of this movement. For the most part, either the owner or the designer has some control over whether the factor will be avoided altogether or if not avoided, the degree to which the factor will be allowed to influence the shrink-swell process.

Antecedent Rainfall Ratio This is a measure of the local climate and is defined as the total monthly rainfall for the month of and the month prior to laying the pavement divided by twice the average monthly rate measured for the period. The intent of this ratio is to give a relative measure of ground moisture conditions at the time the pavement is placed. Thus, if a pavement is placed at the end of a wet period, the pavement should be expected to experience some loss of support around the perimeter as the wet soils begin to dry out and shrink. The opposite effect could be

^{*} LIQUIDITY INDEX = (NATURAL WATER CONTENT - PLASTIC LIMIT) / (LIQUID LIMIT - PLASTIC LIMIT)



anticipated if the pavement is placed at the end of an extended dry period; as the wet season occurs, uplift around the perimeter may occur as the soil at the edge of the slab pavement in moisture content.

<u>Age of Pavement</u> The length of time since the pavement was cast provides an indication of the type of swelling of the soil profile that can be expected to be found beneath the pavement.

<u>Drainage</u> This provides a measure of the slope of the ground surface with respect to available free surface water that may accumulate around the pavement. Most builders are aware of the importance of sloping the final grade of the soil away from the pavement so that rain water is not allowed to collect and pond against or adjacent to the pavement. If water were allowed to accumulate next to the pavement, it would provide an available source of free water to the expansive soil underlying the pavement. Similarly, surface water drainage patterns or swales must not be altered so that runoff is allowed to collect next to the pavement.

<u>Pre-Construction Vegetation</u> Large amount of vegetation existing on a site before construction may have desiccated the site to some degree, especially where large trees grew before clearing. Constructing over a desiccated soil can produce some dramatic instances of heave and associated structural distress and damage as it wets up.

<u>Post-Construction Vegetation</u> The type, amount, and location of vegetation that has been allowed to grow since construction can cause localized desiccation. Planting trees or large shrubs near a pavement can result in loss of foundation support as the tree or shrub removes water from the soil and dries it out. Conversely, the opposite effect can occur if flowerbeds or shrubs are planted next to the pavement and these beds are kept well-watered or flooded. This practice can result in swelling of the soil around the perimeter where the soil is kept wet.

<u>Site Grading, Lot Slopes, and Earthwork Effects</u> In addition to the environmental and man-made factors described above, the grading and earthwork operations performed during site development can significantly influence the potential for shrink-swell movement at any given lot.

<u>Cut and Fill Conditions</u> During site development, many residential lots are brought to design grade through cut and fill operations. Fill soils, if not properly compacted at the time of placement, may experience post-construction volume changes due to wetting, drying, or consolidation. When fill



soils overlay natural undisturbed expansive clays, the combination of differing material types and histories can create non-uniform movement potential across the building pad. Transition zones, where cut and fill areas meet within the foundation footprint, are particularly sensitive and may result in localized differential movement under changing moisture conditions.

Lot Slopes and Surface Water Drainage The slope of the lot also plays a role in the long-term performance of foundations on expansive soils. Sloped lots may result in preferential surface water runoff toward one side of the structure, increasing the risk of moisture accumulation and differential heave if drainage is not properly controlled. Additionally, on sloped sites underlain by expansive soils, lateral soil movement may occur over time due to creep and shrink-swell cycles. This movement is typically oriented downslope and may contribute to gradual lateral displacement of light foundation systems unless proper design measures are incorporated.

As with other moisture-related factors, careful attention to site grading, uniform pad preparation, and positive drainage away from structures are critical elements in mitigating the effects of expansive soils. Special consideration should be given to areas of deep fill, slope transitions, or where cut/fill differentials exist within the foundation footprint.

Utilities Underneath the Pavement The utilities such as sewer, water, electricity, gas, and communication lines are often installed underneath the streets. The sewer utility construction, for example, typically involves trenching to the desired depth, installing gravel a gravel bed underneath the sewer main, installing primary backfill (gravel), and placing back the secondary backfill (generally excavated soils). The secondary backfill material is compacted in lifts. In addition, sewer service lines run laterally from each house (for a typical subdivision, approximately every 50-ft). These trenches with gravel and onsite material backfill are conducive to carrying water. In addition, the sewer service lines can carry water from behind the curb. Occasionally, the sewer line may be encased in concrete which will cause ponding of any travelling water within the sewer trenches. Any water travelling within these trenches can cause expansive clays to swell. If the backfill is not adequately compacted or if excessive water is flowing in these trenches, the trench backfill can potentially settle.



Summation

It is beyond the scope of this investigation to do more than point out that the above factors have a definite influence on the amount and type of swell to which a pavement is subjected during its useful life. The design engineer must be aware of these factors as he develops his design and make adjustments as necessary according to the results of special measurements or from his engineering experience and judgment.



DESIGN ENGINEERING ANALYSIS

Pavement Design Considerations

Review of the borings and test data indicates that the following factors will affect the pavement design and construction at this site:

- The underlying shallow soils are moderately plastic to highly plastic. Structures supported at shallow depths will be subjected to potential vertical movements on the order of 1 to 1 3/4 inches at the existing grade elevation of the test pits.
- 2) If the finish grade elevation is higher than the existing grade level, compacted select fill should be used to raise the grade.
- 3) The select fill should be placed in lifts and compacted as recommended under *Select Fill* in the "Construction Guidelines" section in this report.
- 4) The strengths of the underlying soils are adequate to support the proposed new streets.
- 5) Based on the stratigraphy observed at this site the final street subgrade is anticipated to be in the Clay or Limestone subgrades. The final street subgrade should be verified by InTEC at the time of construction.
- 6) Ground water was not encountered in the borings at the time of drilling.

Vertical Movements

The potential vertical rise (PVR) for slab-on grade construction at the location of the structures had been estimated using Texas Department of Transportation Procedure TXDOT-124-E. This method utilizes the liquid limits, plasticity indices, and in-situ moisture contents for soils in the seasonally active zone, estimated to be about ten feet at the project site.

The estimated PVR value is based on the proposed floor system applying a sustained surcharge load of approximately 1.0 lb. per square inch on the subgrade materials. Potential vertical movement on the order of 1 to 1 % inches was estimated at the existing grade elevations at the test pit locations. These



PVR values will be realized if the subsoils are subjected to **moisture changes from average soil moisture** conditions to wet soil moisture conditions.

The PVR values are based on the current site grades. If cut and fill operations in excess of 6 inches are performed, the PVR values could change significantly. Higher PVR values than the above mentioned values will occur in areas where water is allowed to pond for extended periods.

If proper drainage is not maintained (allowing subgrade moisture content to change significantly) and / or if the pavement is underlain by utility trenches, resulting (a) potential vertical movements will be much greater than 2 to 3 times the anticipated vertical movements and (b) the subgrade strength may be reduced significantly reduced.

If the finish grade elevation is higher than the existing grade, compacted select fill should be used to raise the grade level. Any select fill should be placed and compacted as recommended under *Select Fill* in the "Construction Guidelines" section of this report. Each lift should be compacted and tested by InTEC to verify Compaction Compliance.

It should be noted that expansive clay does not shrink/swell without changes in moisture content, and thus good site design is very important to minimize movements. Coping with problems of shrink/swell due to expansive clays is a "fact of life" in the Texas region of south western U.S.A.



PAVEMENT GUIDELINES

General

Pavement area at this unit is expected to include Local type streets. The following recommendations are presented as a guideline for pavement design and construction. These recommendations are based on a) our previous experience with subgrade soils like those encountered at this site, b) pavement sections which have proved to be successful under similar design conditions, c) final pavement grades will provide adequate drainage for the pavement areas and that water will not be allowed to enter the pavement system by either edge penetration adjacent to landscape areas or penetration from the surface due to surface ponding, or inadequate maintenance of pavement joints, or surface cracks that may develop.

Pavement Design

Pavement designs provide an adequate thickness of structural sections over a particular subgrade (in order to reduce the wheel load to a distributed level so that the subgrade can support load). The support characteristics of the subgrade are based on strength characteristics of the subgrade soils and not on the shrinkage and swelling characteristics of the clays. Therefore, the pavement sections may be adequate from a structural stand point, may still experience cracking and deformation due to shrinkage and swelling characteristics of the soils. In addition, if the proposed new pavements are used to carry temporary construction traffic, then heavier sections may be needed. Please contact InTEC to discuss options.

It is very important to minimize moisture changes in the subgrade to lower the shrinkage and swell movements of the subgrade clays. The pavement and adjacent areas should be well drained. Proper maintenance should be performed by sealing the cracks as soon as they develop to prevent further water penetrations and damage. In our experience,

- (a) majority of the pavement distress observed over the years were caused by changes in moisture content of the underlying subgrade and / or excessive moisture in the base section,
- (b) pavements with a grade of one percent or more have performed better than the pavements with allowable minimum grade,



- (c) pavements with no underground utilities have performed better than pavements with underground utilities and the associated laterals,
- (d) pavements that are at a higher-grade elevation than the surrounding lots have performed better, and
- (e) any design effort that minimizes moisture penetration into the pavement layers have performed better.

"Alligator" Type Cracks

A layer of aggregate base is typically used underneath the concrete curbs around the pavement areas. This layer of aggregate base underneath the concrete curb is conducive to the infiltration of surface water into the pavement areas. Water infiltration into the subgrade and / or base layer can result in "alligator type" cracks especially when accompanied by construction traffic. Increased moisture content of the pavement sections will significantly impact its support characteristics. Moisture penetration into pavement layers can be reduced by (a) penetrating the concrete curbs at least three inches into the native clays soils, (b) installing French Drains on the outside of the curbs, or (c) installing a moisture barrier such as a trench filled with bentonite or flowable fill. Alligator type cracks are also caused by weak / soft pockets within the pavement layers. Thoroughly proof rolling the subgrade and base layers will help identify the soft softs and densify as needed.

Longitudinal Cracks

Asphalt pavements in highly expansive soil conditions, such as the soils encountered at this site, can develop longitudinal cracks along the pavement edges. The longitudinal cracking typically occurs about 1 to 4 feet inside of the pavement edges and they run parallel to the pavement edge. Longitudinal or reflective cracks may also be observed over utility trenches. The longitudinal cracks are generally caused by differential drying and shrinkage of the underlying expansive clays. The moisture content change of the underlying subgrade clays can be reduced by installing moisture barriers. Vertical moisture barriers along the edge of the pavement or horizontal moisture barriers such as paved sidewalks or geogrid will help control the development of the longitudinal cracks.



Periodic Maintenance

The pavements constructed on clay subgrades such as the one encountered at this site will be subjected to shrink / swell related movements. Hence, proper maintenance should be performed by sealing the cracks as soon as they develop to prevent further water penetrations and damage.

Pavement Sections

Local type residential streets may be designed with flexible pavements. The final finish street subgrade is expected to be in the Clay or Limestone subgrade areas. Minimum flexible pavement sections for the anticipated subgrades are presented in Table No. 2 in the following page. The project geotechnical engineer should delineate the streets for different subgrades at the time of construction. Input parameters used in the pavement section calculations are presented in Table No. 3.

- If pavement design for parameters other than those shown in Table No. 3 is needed or if repetitive / heavy truck traffic is anticipated, please contact us for additional pavement section recommendations.
- The recommended pavement sections are based on the subgrade soil support characteristics.
- The pavement sections are not based on shrink / swell characteristics of the subgrade soils.
- The subgrade soil support characteristics will be significantly affected by changes in moisture content.

The cut and fill information is not available at this time. The final street subgrade should be verified by InTEC at the time of construction.



Table No. 2 – Minimum Flexible Pavement

Classification	Asphaltic Concrete		Aggregate		Subgrade,	Structural	
	Type D, inches	Type C, inches	Type B, inches	Base, inches	Geogrid	inches	Number
Local Type A	2.00	-	-	9.50	No	6" LS	2.69
(no bus traffic)	2.00	-	5.00	-	No	6" LS	3.06
	3.00	-	-	14.00	No	6" LS	3.76
Local Type A (with bus traffic)	3.00	-	-	11.50	Yes	6" LS	3.75
	3.00		6.00	-	No	6" LS	3.84
Local Type B	3.00	-	-	20.50	No	6" LS	4.67
	2.00	2.00	-	17.50	No	6" LS	4.69
	3.00	-	-	17.00	Yes	6" LS	4.69
	2.00	2.00	-	14.50	Yes	6" LS	4.70
	3.00	-	8.50	-	No	6" LS	4.69

Subgrade Notes (*):

- Cut and fill data are not available at this time.
- Any fill placed to raise the grade should be approved by the geotechnical engineer. Approved fill
 material should be free of deleterious material with a minimum CBR value of 5.0 and a maximum
 Plasticity Index value of 45. The gravel size should not exceed 3 inches in diameter. The material
 should be placed as per applicable city or county guidelines.
- Based on the soils encountered in the borings, we anticipate the final pavement subgrade Plasticity Index (PI) values to be less than or equal to 20 or greater than 20.
- <u>LS:</u> As per Bexar County requirements, subgrade stabilization is required if the final subgrade Plasticity Index values are greater than 20.
 - Subgrade stabilized with lime. An application rate of 30 lbs per sq yard for 6 inch depth of may be used. We recommend that the application rate be determined at the time of construction.
 - Soil sulfate content should be tested prior to lime application.
 - Field mixed lime samples should be tested for compressive strength. A minimum compressive strength value of 160 psi is required.
 - Subgrade may be stabilized with Cement in-lieu of lime. Cement application rate should be determined at the time of construction.
- As per Bexar County requirements, subgrade stabilization is not needed if the final subgrade Plasticity Index values are less than equal to 20.
- Final pavement subgrade should be verified by InTEC at the time of construction.



General Notes:

- Design California Bearing Ratio value of 2.5 was used. California Bearing Ratio for stratum II soils were also performed is higher than 5.0.
- Input parameters used in pavement section calculations are shown in Table No. 3 (Summary Table B). Please call us to provide pavement recommendations, if needed, for different input values.
- If repetitive truck or heavy truck traffic is anticipated, please contact us for revised pavement recommendations.
- Pavement section recommendations are based on a subgrade CBR value of 2.5. The pavement recommendations are not based on the shrink / swell characteristics of the underlying soils. The pavement can experience cracking and deformation due to shrinkage and swelling characteristics of the soils as described in the Vertical Movements section of this report. Use of geogrid will help reduce the shrink / swell related reflective cracking.
- If water is allowed to get underneath the asphalt / concrete or if moisture content of the base or subgrade changes significantly, then pavement distress will occur. Moisture penetration underneath the asphalt pavement surface should be reduced. One of the following methods should be used:
 - o Deeper curbs; such as curbs extending a minimum of 3 inches into subgrade.
 - Compacted clays backfilled against the curbs.
- In addition, water should not be allowed to get underneath the pavement section at the time of home construction.

Geogrid:

• One layer of geogrid, Tensar Triax TX130 or better, installed on top of compacted (compacted or stabilized) subgrade as per manufacturer's guidelines.

Subgrade Delineation:

• At the time of construction, the final pavement subgrade should be verified / delineated by the geotechnical engineer.



<u>Table No. 3 – Input Parameters used in Asphalt Pavement Section Calculation</u>

	Local Type A (no bus traffic)	Local Type A (with bus traffic)	Local B
ESAL	100,000	1,000,000	2,000,000
Reliability Level	R-70	R-70	R-90
Initial and Terminal Serviceability	4.2 and 2.0	4.2 and 2.0	4.2 and 2.0
Standard Deviation	0.45	0.45	0.45
Service Life	20 years	20 years	20 years

If heavy truck traffic is anticipated, please contact InTEC with anticipated traffic data for revised recommendations.

Subgrade Preparation

It is important that any existing pavement and organic and compressible soils are removed and the exposed subgrade is properly prepared prior to pavement installation. The subgrade should be prepared as described in the applicable city or TxDOT Guidelines. Base course material should be placed immediately upon completion of the subgrade compaction operation to prevent drying of the soils due to exposure.

The finish grade elevation of the subgrade should be such that water drains downward freely towards a drainage area. At the drainage area, 3x5 rock may be provided at the subgrade level and the collected water at the drainage area should be taken out (such as into the existing concrete drainage channel). If any voids in the subgrade should be filled in with the same subgrade material and compacted in lifts.

The approved fill material should be placed in 8-inch lifts (6 inches compacted) and compacted as recommended in the Site Preparation section of the Construction Guidelines presented in this report. If the fill depth exceeds 4 feet, the potential subgrade settlement should be considered. Please contact InTEC with the cut and fill information to evaluate the effect of proposed cut and fill on the recommendations and to provide fill material and compaction recommendations.



Base Course

Based on the survey of available materials in the area, a base course of crushed limestone aggregate or gravel appears to be the most practical material for asphalt pavement project. The base course should conform to Texas State Department of Highways and Public Transportation Standard Specification, Item 247, Type A, Grade 1-2.

The aggregate base course material and installation should conform to all applicable guidelines in City of San Antonio Specifications for Construction, June 2008. At a minimum the base course should be brought to near optimum moisture conditions and compacted in lifts to at least 95 percent of maximum dry density as determined by test method TxDOT 113E.

Asphaltic Concrete

The asphaltic concrete surface course material and installation should conform to all applicable guidelines in in City of San Antonio Specifications for Construction, June 2008.

Perimeter Drainage

It is important that proper perimeter drainage be provided so that infiltration of surface water from compacted areas surrounding the pavement is minimized, or if this is not possible, curbs should extent through the base and into the subgrade. A crack sealant compatible to both asphalt and concrete should be installed at the concrete-asphalt interfaces.

Wherever there are drastic grade changes in the pavement area (such as from 3 to 4 percent grade to 1 to 2 percent grade) 3 x 5 inch gravel subgrade with a subsurface drain system (such as Akwadrain® on the sides of the pavement) and outlet should be considered. This aspect will provide for a better drainage system in this area. Please contact InTEC for drainage recommendations.



CONSTRUCTION GUIDELINES

Construction Monitoring

InTEC, as the Geotechnical Engineer of Record, should be actively involved in monitoring earthwork and foundation construction. Proper performance of foundation systems depends not only on design but also on quality construction practices. Contact InTEC prior to construction to incorporate foundation and earthwork monitoring into the project's quality control plan.

Site Preparation

Site preparation will consist of removal of the organic material, preparation of the subgrade, and Remove organic materials, vegetation, and loose soils to a depth of at least 6 inches in areas where floor slabs or pavements are planned. Subgrade should be approved by InTEC and proof rolled. Recompact to at least 95% of maximum dry density (ASTM D698) within -1% to +3% of optimum moisture content. Exposed subgrade should be kept moist and approved before fill placement.

Old underground utilities beneath proposed structures should be removed or sealed. Backfill should be compacted in 6-inch lifts to 95% of maximum dry density within the specified moisture range.

If cut/fill operations occur beneath the building pad, fill thickness should be uniform to reduce differential movement. Voids from tree or structure removal must be compacted per recommendations.

Proof Rolling

Use a 25-ton pneumatic roller with 10 passes and tire pressures per manufacturer specs to achieve 90 psi ground contact pressure. InTEC must observe proof rolling. Weak zones should be removed and replaced with select fill. Retest areas that do not meet density.

Maintain positive drainage throughout construction to avoid ponding or construction delays.

Compaction

Site grading plan is not available for review at this time. If any low areas or disturbed areas encountered during construction should be appropriately prepared and compacted. Any deleterious or wet materials should be removed and wasted. The fill placement in the low areas should not be in a "bowl shape". The



sides of the fill area should be "squared up" and the excavated bottom should be proof rolled as described in *Proof Rolling* section of this report. On site material, with no deleterious material, may be used to raise the grade. After proof rolling operation, the fill should be placed in 6-inch lifts and compacted to a minimum of **95 percent of the maximum dry density as determined by ASTM D 698 test method within optimum and three percent above optimum moisture content.** Each lift should be tested by InTEC for compaction compliance and approved before placement of the subsequent lifts. The exposed subgrade should not be allowed to dry out prior to placing structural fill. It is recommended that any given lot does not straddle filled areas and natural areas to help lower differential movement of the structures.

Select Fill

Use crushed limestone with LL < 40, PI = 5-20, and <30% passing No. 200 sieve. Max particle size: 3 inches. Place in 6-inch compacted lifts and compact as described in the Vertical Movements section. Each lift must be tested and approved by InTEC.

General Fill

General fill materials may consist of clean on-site material, select fill materials, or any clean imported fill material. The purpose of a general fill is to provide soils with good compaction characteristics that will provide uniform support for any non-habitable structures that are not movement sensitive. The general fill material should be free of any deleterious material, construction debris, organic material, and should not have gravels larger than 6 inches in maximum dimension. The top two feet of fill material used underneath pavement areas should not have gravels larger than 3 inches in maximum dimension.

It should be understood that the use of the general fill may result in greater than anticipated potential vertical movements and differential movements. If the greater potential vertical movements or differential soil movements cannot be tolerated, then select fill material should be used and should conform to the Select Fill recommendations.

General Fill Compaction

The general fill materials should be placed in lifts not to exceed 8 inches thick and compacted to a minimum of 95 percent of the maximum dry density as determined by test method ASTM D 698 at a moisture content within 3 percent of the optimum water content. Each lift should be compacted and tested by a



representative of a geotechnical laboratory to verify compaction compliance and approved before placement of the subsequent lifts.

The general fill compaction requirements can also be discussed and determined in consultation with the owner prior to construction.

Ground Water

In any areas where significant cuts (2-ft or more) are made to establish final grades for pavement, attention should be given to possible seasonal water seepage that could occur through natural cracks and fissures in the newly exposed stratigraphy. Subsurface drains may be required to intercept seasonal groundwater seepage. The need for these or other dewatering devices on should be carefully addressed during construction. Our office could be contacted to visually inspect final pads to evaluate the need for such drains.

The ground water seepage may happen several years after construction if the rainfall rate or drainage changes within the project site or outside the project site. If seepage run off occurs towards the pavement areas an engineer should be called on to evaluate its effect and provision of French Drains at this location.

Drainage

Ground water seepage was not encountered in the borings at the time of drilling. However, minor ground water seepage may be encountered within the pavement areas and grading excavations at the time of construction, especially after periods of heavy precipitation. Small quantities of seepage may be handled by conventional sump and pump methods of dewatering.

Temporary Drainage Measures

Temporary drainage provisions should be established, as necessary, to minimize water runoff into the construction areas. If standing water does accumulate, it should be removed by pumping as soon as possible.

Adequate protection against sloughing of soils should be provided for workers and inspectors entering the excavations. This protection should meet O.S.H.A. and other applicable building codes.



Construction Slopes

- Temporary Slopes: 1H:1V in Stratum I and II clays.
- Fill Slopes: 1H:1V, compacted in 3–5 ft lifts.
- Permanent Slopes: Max 3H:1V. Use 5H:1V where pedestrian access is expected.

Time of Construction

If the pavement is installed during or after an extended dry period, the subgrade may experience greater movement around the edges when the soil moisture content increases, such as due to rain or irrigation. Similarly, a pavement installed during or after a wet period may experience greater movement around the edges during the subsequent drying of the soils.

Control Testing and Field Observation

Subgrade preparation and base and asphalt placement should be monitored by the project geotechnical engineer or his representative of InTEC. As a guideline, at least one in-place density test should be performed for every 100 lineal feet (or as per respective city and county requirements, whichever requires more frequent testing) of street of compacted surface lift. However, a minimum of three density tests should be performed by InTEC on the subgrade or subsequent lifts of compaction. Any areas not meeting the required compaction should be re-compacted and retested until compliance is met.



DRAINAGE AND MAINTENANCE

Proper drainage and long-term moisture management are **critical** to the performance of the proposed structures and pavements, particularly due to the presence of **expansive soils** at the site. Seasonal or localized changes in moisture content can lead to **unpredictable slab and foundation movements**, especially if water is allowed to collect near building perimeters or utility corridors.

Roof Drainage & Plumbing

- All roof drainage must be directed at least 10 feet away from the foundation using gutters, downspouts, and splash blocks or extensions.
- If positive surface slope cannot be provided, closed pipe systems discharging to a storm sewer are preferred.
- Plumbing leaks, especially beneath the slab or within utility trenches, must be identified and repaired immediately to prevent localized swelling and loss of support.

♦ Lot Grading & Flatwork

- Final grading should slope away from the structure at a minimum of 5% for the first 10 feet.
- Pavements, sidewalks, and patios within this zone should follow the same slope guideline and be designed to accommodate post-construction movement, especially in fill areas or expansive clay zones.
- Joints between slabs and structures should be sealed and inspected regularly. Water should not be allowed to pond in planters, depressions, or along unsealed joints.

Landscaping & Vegetation

- Large trees and deep-rooted plants should not be planted within a horizontal distance equal to their mature height from the foundation.
- Planters adjacent to the structure should be self-contained and designed to prevent moisture infiltration to foundation soils.



 Irrigation systems and sprinkler mains should be located a minimum of 5 feet away from buildings, and designed to prevent overwatering near foundations.

Utility Trenches

- Trenches for utilities often include granular bedding, which can act as conduits for water to reach the building pad.
- All trenches must be properly compacted and should include cut-off collars or clay plugs where lines cross building footprints to prevent subsurface water migration.

♦ Long-Term Maintenance and Considerations

- The PVR (Potential Vertical Rise) values estimated in this report assume that all drainage systems are installed and maintained properly. Failure to do so may result in actual movements
 2–3 times greater than those predicted.
- During **extended dry periods**, observe the perimeter of the structure. If soil is pulling away from the foundation, **controlled watering** should be applied to avoid sudden moisture shifts when rain returns.
- Any future modifications to drainage, site grading, landscaping, or nearby construction should be carefully evaluated for impact on foundation performance.



LIMITATIONS

The analyses and recommendations submitted in this report are based upon the data obtained from **four borings drilled at the site**.

This report may not reflect the exact variations of the soil conditions across the site. Based on the noted topography within the site, cut and fill are anticipated. The pavement recommendations presented in the report should be reviewed and confirmed based on the proposed cut and fill and observation at the time of construction.

Subsurface conditions may vary between boring locations and may change over time. If conditions encountered during construction differ from those described, **InTEC must be notified promptly** to evaluate whether revisions are needed.

The data and interpretations presented are professional opinions, not exact representations of all subsurface conditions. These recommendations are **confirmation-dependent** and should be reviewed by InTEC during construction to validate assumed conditions.

This report is **not intended to inform means, methods, or construction logistics** such as equipment selection, cost estimation, or contractor scheduling. If the report is used for bidding or other unintended purposes, it is done **solely at the contractor's risk.**

Revisions may be required if:

- the proposed structure or grading is changed;
- drainage or site use is altered;
- significant cut and fill activities are performed; or
- excessive time has passed since the field exploration.


The geotechnical engineer affirms that the findings and advice herein are consistent with the standard of care for geotechnical engineers practicing in this region. However, **no other warranties, express or implied, are provided.**

This report has been prepared for the exclusive use of **Invest 5S**, **LLC** for pavement thickness evaluation for the **proposed new streets at Apollo Oaks Subdivision in Bexar County**, **Texas**.


Illustration Section

Description	Plate No.
Vicinity Map	Plate 1A
Aerial Map	Plate 1B
Topographic Map	Plate 1C
Geologic Map	Plate 1D
Soil Map	Plate 1E
Edwards Aquifer Map	Plate 1F
Bexar County Karst Map	Plate 1G
Approximate Boring Locations	Plate 1H
Boring Logs	Plates 2—5
Keys to Classifications and Symbols	Plate 6
Calculations	Plates 7 - 20
Information on Geotechnical Report	Appendix

Subsurface Exploration and Pavement Analysis Proposed New Streets Apollo Oaks Subdivision Bexar County, Texas InTEC Project Number: Date: S251061-R1 02/19/2025

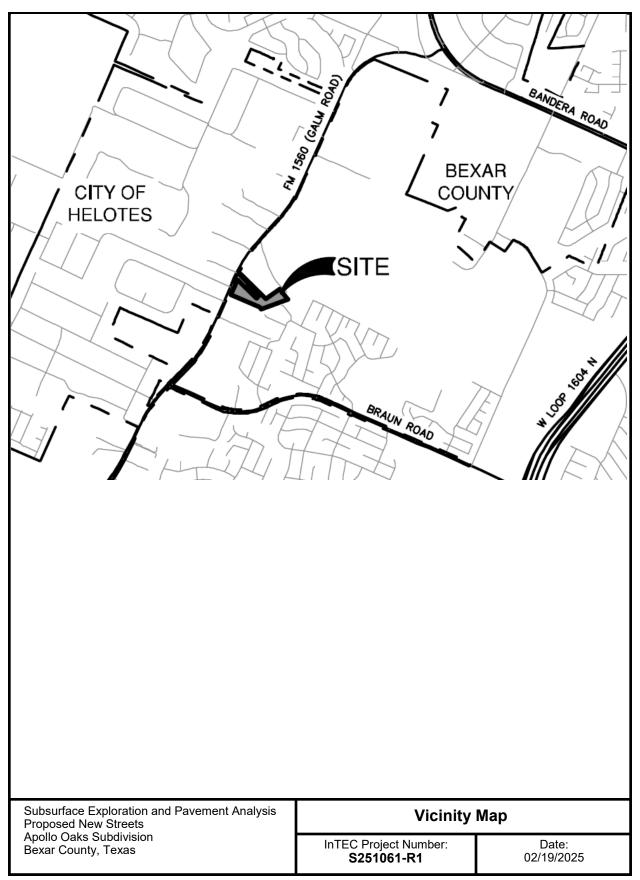



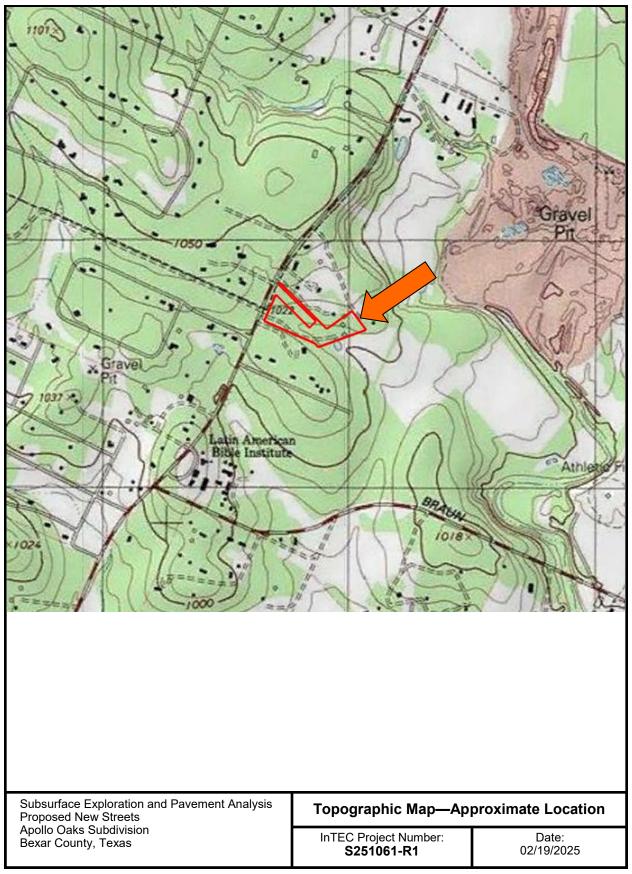




Kbu—Buda Limestone


Fine grained, bioclastic, commonly glauconitic, pyritiferous, hard, massive, poorly bedded to nodular, thinner bedded and argillaceous near upper contact, light gray to pale orange; weathers dark gray to brown; burrows filled with chalky marl, abundant pelecypods; thickness 60-100 feet, thickens westward


Subsurface Exploration and Pavement Analysis Proposed New Streets Apollo Oaks Subdivision Bexar County, Texas Geologic Map—Approximate Location


InTEC Project Number: **S251061-R1**

Date: 02/19/2025

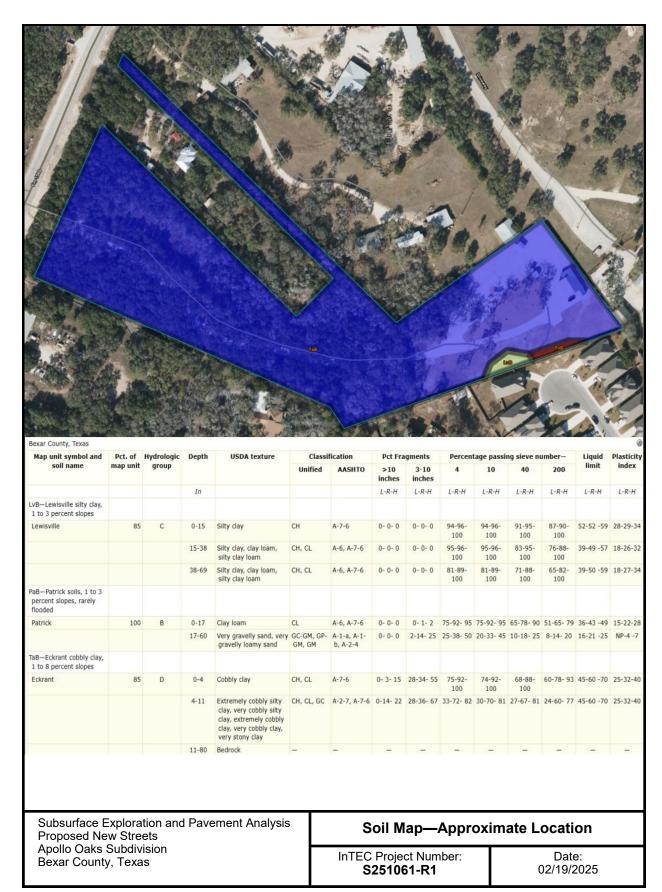

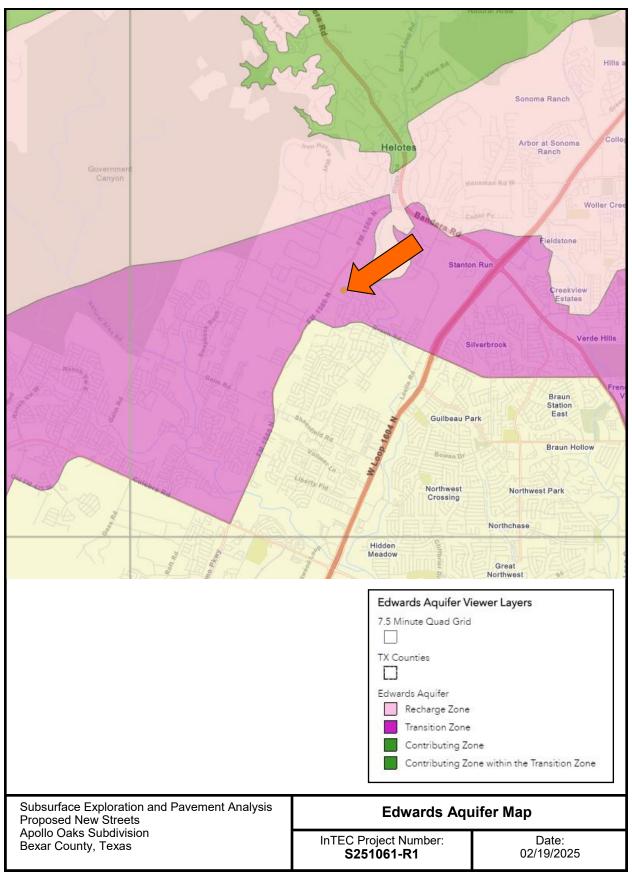

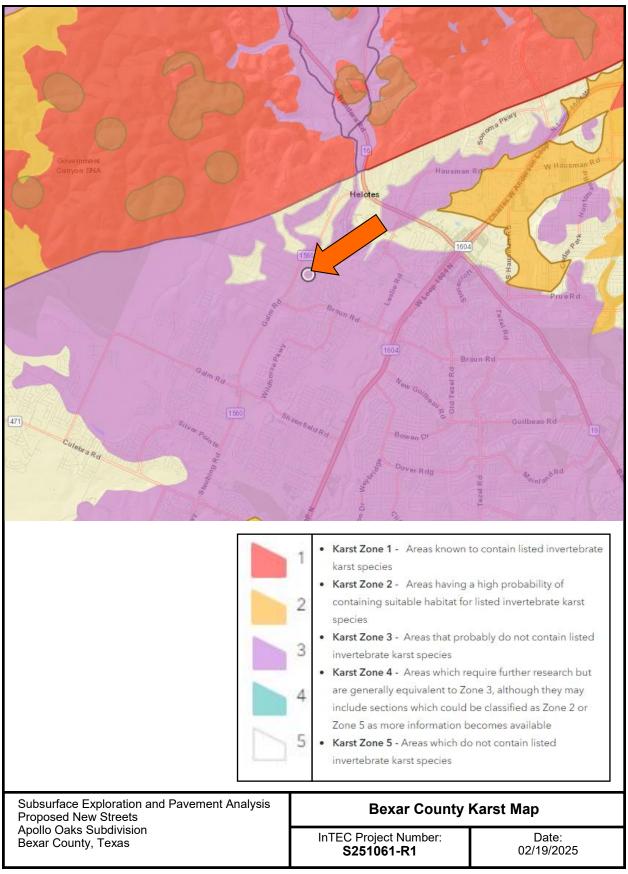

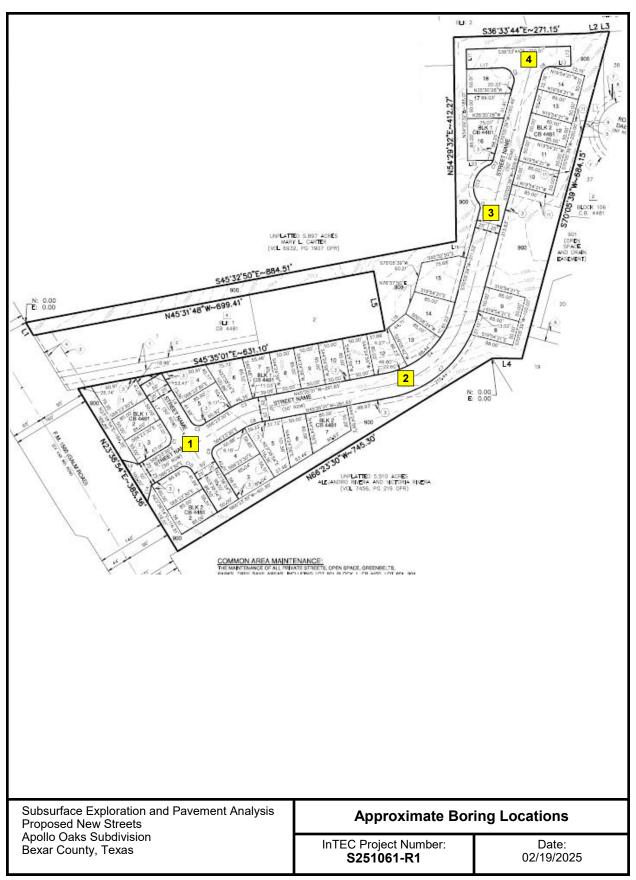

LOCATION: Bexar County, Texas

CLIENT: Invest 5S, LLC

PROJECT NO: S251061-R1

DATE: 07/30/2025



BORING NO. B-1

											BORING NO. B-1
o DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit ├── Liquid Limi Moisture Content % - ● 20 40 60 80
		SS	Brown Clay				61/10"		68	48	
		55	Tan to Light Tan Weathered Limestone to Limestone				01/10		00	40	 /
		AU	-with Caliche, Gravel, and Clay Seams								
											[
5		AU							29	16	Ĭ ∳·· ├ ─┤···│······│······│·····
10											
		AU									
				1							
											l
15											
20											
25											
_											
30											
-											
\dashv											
\dashv											
_											
35											
lotes	S :			Ground	d Wate	r Obse	rved: 1	No			Completion Depth (ft): 12

S.S by P.P - Shear Strength in TSF

by Hand Penetrometer

S.S. - Split Spoon Sample S.T. - Shelby Tube Sample

HA - Hand Auger AU - Auger Sample

LOCATION: Bexar County, Texas

CLIENT: Invest 5S, LLC

PROJECT NO: S251061-R1

DATE: 07/30/2025



											BORING NO. B-2
o DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit
		SS	Brown Clay Tan to Light Tan Weathered Limestone to				50/8"				
			Limestone -with Caliche, Gravel, and Clay Seams								
		AU	, ,						21	07	Ĭ ∳··├ ∥ ····· ····
5		AU									
10											
		AU									
	 			1							
15											
20											
25											
											[
20											[
30											
											[
35											
- 55											
Note	s:			Ground	d Wate	r Obse	rved: 1	No			Completion Depth (ft): 12

S.S by P.P - Shear Strength in TSF

by Hand Penetrometer

S.S. - Split Spoon Sample S.T. - Shelby Tube Sample

HA - Hand Auger AU - Auger Sample

LOCATION: Bexar County, Texas

CLIENT: Invest 5S, LLC

PROJECT NO: S251061-R1

DATE: 07/30/2025



BORING NO. B-3

											BORING NO. B-3
O DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit ├── Liquid Limi Moisture Content % - ● 20 40 60 80
Ů			Brown Clay Tan to Light Tan Weathered Limestone to								
		SS	Tan to Light Tan Weathered Limestone to Limestone				39				· · • • · · · · · · · · · · · · · · · ·
		AU	Limestone -with Caliche, Gravel, and Clay Seams								
		AU									
5		AU							28	16	I
_											
-											
\dashv											l .
10											
		AU									

15											
20											
25											
2.5											
											
30											
\dashv											
											
-											
											
35											
lotes				Ground							Completion Depth (ft): 12

S.S by P.P - Shear Strength in TSF

by Hand Penetrometer

S.S. - Split Spoon Sample S.T. - Shelby Tube Sample

HA - Hand Auger AU - Auger Sample

LOCATION: Bexar County, Texas

CLIENT: Invest 5S, LLC

PROJECT NO: S251061-R1

DATE: 07/30/2025



						1					BORING NO. B-4
o DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit ├── Liquid Limit Moisture Content % - ● 20 40 60 80
		SS	Brown Clay, Tan Clay, Caliche, and Gravel				20				
		33	Tan to Light Tan Weathered Limestone to Limestone				20				
		SS	-with Caliche, Gravel, and Clay Seams				50/4"				.
5		AU									
10		AU							24	12	
		AU							24	12	
											· · · · · · · · · · · · · · · · · · · · · ·
15											
20											
20											
25											
30											
35											
Notes	s:			Ground	d Wate	r Obse	rved:	l No			Completion Depth (ft): 12

S.S by P.P - Shear Strength in TSF by Hand Penetrometer

S.S. - Split Spoon Sample S.T. - Shelby Tube Sample

HA - Hand Auger AU - Auger Sample

KEY TO CLASSIFICATIONS AND SYMBOLS

Soil Fractions

Soil or Rock Types (Shown in symbols column) (Predominate Soil Types Shown Heavy)

Size Range Component Boulders Greater than 12" Cobbles 3" - 12" 3" - #4 (4.76mm) Gravel 3" - ¾" 34° - #4 Fine Sand

#4 - #200 (0.074mm) #4 - #10 (2.00mm) Coarse #10 - #40 (0.42mm) Medium Fine #40 - #200 (0.074mm) Silt and Clay Less than #200











Sandy Gravel

Shale





Limestone Sandy Clay

TERMS DESCRIBING SOIL CONSISTENCY

Description (Cohesive <u>Soils)</u>	Unconfined Compression <u>TSF</u>	Blows/Ft. Std. Penetration <u>Test</u>	Description (Cohesionless <u>Soils</u>	Blows/Ft. Std. Penetration <u>Tests</u>
Very Soft	0.25	<2	Very Loose	0 – 4
Soft	0.25 - 0.50	2 – 4	Loose	4 - 10
Firm	0.50 - 1.00	4 – 8	Medium Dense	10 - 30
Stiff	1.00 - 2.00	8-15	Dense	30 - 50
Very Stiff	2.00 - 4.00	15 – 30	Very Dense	50

SOIL STRUCTURE

Calcareous Containing deposits of calcium carbonate; generally nodular.

Slickenside Having inclined planes of weakness that are slick and glossy in appearance.

Laminated Composed of thin layers of varying color and texture.

Fissured Containing shrinkage cracks frequently filled with fine sand or silt. Usually more or less vertical.

Interbedded Composed of alternate layers of different soil types.

Jointed Consisting of hair cracks that fall apart as soon as the confining pressure is removed.

Consisting of alternate thin layers of sand, silt or clay formed by variations in sedimentations Varved

during the various seasons of the year, of often exhibiting contrasting colors when partially dried.

Each layer is generally less than 1/2" in thickness.

Stratified Composed of, or arranged in layers (usually 1 inch or more)

Well-graded Having a wide range of grain sizes and substantial amount of all intermediate particle sizes.

Poorly or Gap-graded Having a range of sizes with some intermediate sizes missing.

Predominantly of one grain size. Uniformly-graded

Subsurface Exploration and Pavement Analysis **Proposed New Streets** Apollo Oaks Subdivision InTEC Project Number: Date: Bexar County, Texas 02/19/2025 S251061-R1

Calculations

- Soil Conditions
 - Brown Clays underlain by Marl to Limestone
- Pavement Section Recommendations
 - Out and Fill information not available
 - California Bearing Ratio tests for clay and marl subgrades were performed
 - Pavement sections presented based on Clay Subgrade
 - Subgrade treatment based on final pavement subgrade
 - ⇒ If final pavement subgrade <u>Plasticity Index values are</u>
 <u>less than or equal to 20</u>, then "subgrade stabilization" not needed
 - ⇒ If final pavement subgrade Plasticity Index values are greater than 20, then "subgrade stabilization" is required.
 - Soil sulfate content should be tested prior to lime application
 - Field mixed subgrade samples should have a minimum Unconstrained Compressive Strength value of 160 psi.

Subsurface Exploration and Pavement Analysis Proposed New Streets		
Apollo Oaks	InTEC Project Number:	Date:
Bexar County, Texas	S251061-R1	08/05/2025



Design	Referer	ce
Project	Locatio	n e
Customer	Design	r Murali Subramaniam
Company	InTEC Date	March 21, 2025

Method of analysis

The calculation method used to create this Tensar software output is the design method for flexible pavements given in the AASHTO Guide for Design of Pavement Structures 1993. The enhancement of performance due to the inclusion of Tensar geogrids in the stabilised layer is derived empirically from full scale pavement tests and trafficking trials carried out by independent authorities.



	Thickness	Cooff.	SN
HMA layer 1	3 in	0.400	1.200
Aggregate base (NX750)	6 in	0.300	1.800
Structural number (SN)			3.000

	Thickness	Coeff.	SN
HMA layer 1	2 in	0.440	0.880
Aggregate base	9.5 in	0.140	1.330
Subbase	6 in	0.080	0.480
Structural number (SN)	7,000,00		2.690

Parameters

Project Information

Target ESALs	Subgrade resilient modulus	Reliability	Reliability Standard deviation		lity
				Initial	Terminal
100,000	3,750 psi	70%	0.45	4.2	2

Subsurface Exploration and Pavement Analysis Proposed New Streets Apollo Oaks Bexar County, Texas

Local A—without Bus Traffic

InTEC Project Number: S251061-R1



Design	Referen	
Project	Location	
Customer	Designe	Murali Subramaniam
Company In	TEC Date	March 21, 2025

Method of analysis

The calculation method used to create this Tensar software output is the design method for flexible pavements given in the AASHTO Guide for Design of Pavement Structures 1993. The enhancement of performance due to the inclusion of Tensar geogrids in the stabilised layer is derived empirically from full scale pavement tests and trafficking trials carried out by independent authorities.

Results

Stabilized 222,900 ESALs



Unstabilized 254,000 ESALs



be same range on both pavement sections for accurate comparison: 2-3 in | 3-6 in | 6-14 in Total HMA thickness should be within

	Thickness	Coeff.	SN
HMA layer 1	3 in	0.480	1.200
Aggregate base (NX750)	6 in	0.300	1.800
Structural number (SN)		01:00000	3.000

	Thickness	Coeff.	SN
HMA layer 1	2 in	0.440	0.880
HMA layer 2	5 in	0.340	1.700
Subbase	6 in	0.080	0.480
Structural number (SN)		3.060

Parameters

Project Information

Target ESALs	Subgrade resilient modulus	Reliability	Standard deviation	Serviceability	
	2010 100 100 100 100 100 100 100 100 100	S. C.	24 (part a report of party plants A, 244 (1 fg c)	Initial	Terminal
100,000	3,750 psi	70%	0.45	4.2	2

Subsurface Exploration and Pavement Analysis Proposed New Streets Apollo Oaks Bexar County, Texas

Local A—without Bus Traffic

InTEC Project Number: S251061-R1



Design		Reference		
Project		Location		
Customer		Designer	Murali Subramaniam	
Company	InTEC	Date	March 21, 2025	

Method of analysis

The calculation method used to create this Tensar software output is the design method for flexible pavements given in the AASHTO Guide for Design of Pavement Structures 1993. The enhancement of performance due to the inclusion of Tensar geogrids in the stabilised layer is derived empirically from full scale pavement tests and trafficking trials carried out by independent authorities.

Results





Unstabilized

	Thickness	Coeff.	SN
HMA layer 1	3 in	0.400	1.200
Aggregate base (NX750)	10.25 in	0.252	2.583
Structural number (SN)			3.783

	Thickness	Coeff.	SN
HMA layer 1	3 in	0.440	1.320
Aggregate base	14 in	0.140	1.960
Subbase	6 in	0.080	0.480
Structural number (SN)			3.760

Parameters

Project Information

Target ESALs	Subgrade resilient modulus	Reliability	Standard deviation	Serviceabi	lity
				Initial	Terminal
1,000,000	3,750 psi	70%	0.45	4.2	2

Subsurface Exploration and Pavement Analysis Proposed New Streets Apollo Oaks Bexar County, Texas

Local A—with Bus Traffic


InTEC Project Number: S251061-R1



Design	Reference	
Project	Location	
Customer	Designer Murali Subramaniam	
Company InTEC	Date March 21, 2025	

Method of analysis

The calculation method used to create this Tensar software output is the design method for flexible pavements given in the AASHTO Guide for Design of Pavement Structures 1993. The enhancement of performance due to the inclusion of Tensar geogrids in the stabilised layer is derived empirically from full scale pavement tests and trafficking trials carried out by independent authorities.

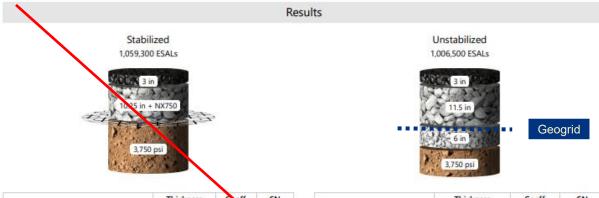

	Thickness	Coeff.	SN	
HMA layer 1	3 in	0.480	1.200	HM
Aggregate base (NX750)	10.25 in	0.252	2.583	Agg
Structural number (SN)			3.783	Sub

	Thickness	Coeff.	SN
HMA layer 1	3 in	0.440	1.320
Aggregate base	11.5 in	0.170	1.955
Subbase	6 in	0.080	0.480
Structural number (SN)	100 (CC 1000)	220074233	3.755

Parameters

Project Information

Target ESALs	Subgrade resilient modulus	Reliability	Standard deviation	Serviceability Initial Termina	
1,000,000	3,750 psi	70%	0.45	4.2	2

Geogrid option calculated with adjusted structural coefficient value of 0.17

Subsurface Exploration and Pavement Analysis Local A—with Bus Traffic Proposed New Streets Apollo Oaks InTEC Project Number: Date: Bexar County, Texas S251061-R1 08/05/2025



Design	Reference		
Project	Location		
Customer	Designer	Murali Subramaniam	
Company InTEC	Date	March 21, 2025	

Method of analysis

The calculation method used to create this Tensar software output is the design method for flexible pavements given in the AASHTO Guide for Design of Pavement Structures 1993. The enhancement of performance due to the inclusion of Tensar geogrids in the stabilised layer is derived empirically from full scale pavement tests and trafficking trials carried out by independent authorities.

Results



Unstabilized 1,174,300 ESALs



Total HMA thickness should be within the same range on both pavement sections for accurate comparison: 2-3 in | 3-6 in | 6-14 in

	Thickness	Coeff.	SN
HMA layer 1	3 in	0.400	1.200
Aggregate base (NX750)	10.25 in	0.252	2.583
Structural number (SN)		SERVICE	3.783

	Thickness	Coeff.	SN
HMA layer 1	3 in	0.440	1.320
HMA layer 2	6 in	0.340	2.040
Subbase	6 in	0.080	0.480
Structural number (SN)) in in		3.840

Parameters

Project Information

Target ESALs	get ESALs Subgrade resilient modulus R	Reliability	Standard deviation	Serviceabi	lity
		E SOUTH TOWN		Initial	Terminal
1,000,000	3,750 psi	70%	0.45	4.2	2

This report was prepared using Timuse+ (2.18.4)

6 2021-2025 Tersar International Corporation. All rights reserved. Tersar is a registered trademark

imitations of this Repor

fra undertake to only lake the Tensor's arthurs tool and its output stoky to evolute the application of Tensor pagging and strictly according to the Tensor's arthur sold lake the sold engoging and the tensor tool and its output control to the Tensor's arthur and the tensor tool and its output ("Four Associates"). The Tensor's software output is membry districtive and in not a detailed design. You will ensure that you and Your Associates"). The Tensor's software output is membry districtive and in not a detailed design. You will ensure that you and Your Associates"). The Tensor's software tool and its output correctly and safety (Copyright in the Tensor - International and/or have the recensary expertise and experiences to use the Tensor's activities of and its output correctly and safety (Copyright in the Tensor - International and International Is the safety of the Copyright in the Tensor - International Is application for the use of Tensor International accept to Vour Associates and the purpose of evolution for the use of Tensor International accept to whole for the use of Tensor International accept to the control of a contract.

Subsurface Exploration and Pavement Analysis Proposed New Streets Apollo Oaks Bexar County, Texas

Local A—with Bus Traffic

InTEC Project Number: **S251061-R1**




Design	Reference		
Project	Location		
Customer	Designer	Murali Subramaniam	
Company InTEC	Date	March 21, 2025	

Method of analysis

The calculation method used to create this Tensar software output is the design method for flexible pavements given in the AASHTO Guide for Design of Pavement Structures 1993. The enhancement of performance due to the inclusion of Tensar geogrids in the stabilised layer is derived empirically from full scale pavement tests and trafficking trials carried out by independent authorities.

Results

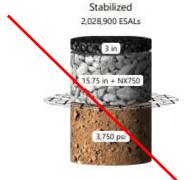

Unstabilized 2,148,300 ESALs



Total HMA thickness should be within the same range on both pavement sections for accurate comparison: 2-3 in | 3-6 in | 6-14 in

	Thickness	Coeff.	SN
HMA layer 1	3 in	0.400	1.200
Aggregate base (NX750)	15.75 in	0.218	3,433
Structural number (SN)			4.633

	Thickness	Coeff.	SN
HMA layer 1	3 in	0.440	1.320
HMA layer 3	4 in	0.140	0.560
Aggregate base	16.5 in	0.140	2.310
Subbase	6 in	0.080	0.480
Structural number (SN)			4.670

Parameters

Project Information

Target ESALs	Subgrade resilient modulus	Reliability	Standard deviation	Serviceabil	ty	
4				Initial	Terminal	
2,000,000	3,750 psi	90%	0.45	4.2	2	

This report was prepared using Tensar+ (2.18.4)

© 2021–2025 Temar Internetional Corporation. All rights reserved. Temar is a registered trademark.

mitations of this Repor

You undertake to only use the Tensors-curboses tool and it output solely to evaluate the application of Tensor aposptish in the scale in a contract the Commission of the Tensor Sole and the Commission of Tensor aposptish and the Sole and the Commission of Tensor aposptish and the Sole and the Commission of Tensor aposptish and the Sole and the Sole and Tensor and Tensor aposptish and the Sole and Tensor and Tensor aposptish and the Sole and Tensor and Tensor aposptish and the Sole and Tensor and Tenso

Subsurface Exploration and Pavement Analysis Proposed New Streets Apollo Oaks Bexar County, Texas

Local B


InTEC Project Number: **S251061-R1**




Design		Reference	
Project		Location	and program of the
Customer		Designer	Murali Subramaniam
Company	InTEC	Date	March 21, 2025

Method of analysis

The calculation method used to create this Tensar software output is the design method for flexible pavements given in the AASHTO Guide for Design of Pavement Structures 1993. The enhancement of performance due to the inclusion of Tensar geogrids in the stabilised layer is derived empirically from full scale pavement tests and trafficking trials carried out by independent authorities.

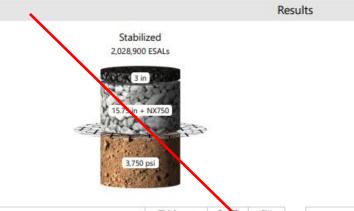

Unstabilized
2.216.400 ESALs

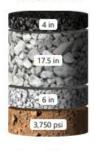

	Thickness	Coeff	SN
HMA layer 1	3 in	0.400	1.200
Aggregate base (NX750)	15.75 in	0.218	3.433
Structural number (SN)			4.633

	Thickness	Coeff.	SN
HMA layer 1	4 in	0.440	1.760
Aggregate base	17.5 in	0.140	2.450
Subbase	6 in	0.080	0.480
Structural number (SN)			4.690

Parameters

Project Information

Target ESALs	Subgrade resilient modulus	Reliability	Standard deviation	Serviceability	ity
		100		Initial	Terminal
2,000,000	3,750 psi	90%	0.45	4.2	2

This report was prepared using Temar+ (2.16.4) © 2021-2025 Temar International Corporation All rights reserved. Temar is a registered trademar

Limitations of this Repo

You undertake to only into the Senar's software total and its output solely to evaluate the application of Tenner specified, and interest personal and the solely according to the Immer of Use. The sustability of the software output and Tenner International's pecifies for any project in the sole responsibility of your and your employers, contriction or or other third quarties who access the Tenner's contained and its output of Your Autoristes have extracted by the Immer of Your Autoristes have conference to use the Tenner's software output of Your Autoristes have conference to use the Tenner's software output of Your Autoristes have conference to use the Tenner's software output of Your Autoristes have conference to use the Tenner's software output of Your Autoristes provided in the Software Autorist the project workshop that the project workshop is a contract the Your Autoristes provided in the Your Autorists provided in the Your

Subsurface Exploration and Pavement Analysis Proposed New Streets Apollo Oaks Bexar County, Texas

Local B


InTEC Project Number: **S251061-R1**



Design	Reference		
Project	Location		
Customer	Designer	Murali Subramaniam	
Company InTEC	Date	March 21, 2025	

Method of analysis

The calculation method used to create this Tensar software output is the design method for flexible pavements given in the AASHTO Guide for Design of Pavement Structures 1993. The enhancement of performance due to the inclusion of Tensar geogrids in the stabilised layer is derived empirically from full scale pavement tests and trafficking trials carried out by independent authorities.

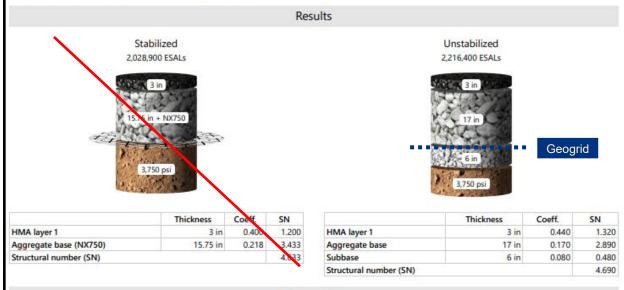

Parameters

Project Information

Target ESALs	Subgrade resilient modulus	Subgrade resilient modulus Reliability Standard deviation Serviceability		lity	
	STORY OF THE STORY	3.00.00.00.000.00	The state of the s	Initial	Terminal
2,000,000	3,750 psi	90%	0.45	4.2	2

This report was prepared using Tensor+ (2.18.4)

© 2021-2025 Tensar International Corporation, All rights reserved. Tensar is a registered tradema-

imitations of this Repor

You undertake to any loss the Terman's undersor book and its audiput study to workshow the application of Terman geografs, and strictly according to the Terman of Use. The catabodity of the softmans output and seed Terman strategies and the output of Your Associates. The Terman's software output is memory districtive and in not a detailed design. You will ensure that you and Your Associates. The Terman's software output is memory districtive and in not a detailed design. You will ensure that you and Your Associates have sundergoon all measures training through literate International analyze have the recessary experture and experience to use the Terman's information and the International analyze have the recessary experture and experience to use the Terman's information and the International Internationa

Geogrid option calculated with adjusted structural coefficient value of 0.17


Subsurface Exploration and Pavement Analysis Proposed New Streets	Local B		
Apollo Oaks	InTEC Project Number:	Date:	
Bexar County, Texas	S251061-R1	08/05/2025	



Design		Reference		
Project		Location	and the same of th	
Customer		Designer	Murali Subramaniam	
Company	InTEC	Date	March 21, 2025	

Method of analysis

The calculation method used to create this Tensar software output is the design method for flexible pavements given in the AASHTO Guide for Design of Pavement Structures 1993. The enhancement of performance due to the inclusion of Tensar geogrids in the stabilised layer is derived empirically from full scale pavement tests and trafficking trials carried out by independent authorities.

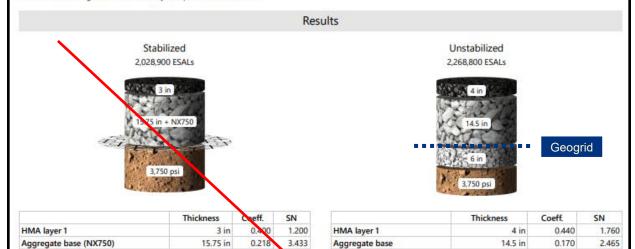

Pa	ra	m	ot	0	rc

Subbase

Structural number (SN)

633

Project Information

Structural number (SN)

Target ESALs	Subgrade resilient modulus	Subgrade resilient modulus Reliability Standard deviation	Serviceabi	lity	
				Initial	Terminal
2.000,000	3,750 psi	90%	0.45	4.2	2

This report was prepared using Tensary (2.18-6)

This report was prepared using Terrain (2.36.4) © 2021-2025 Terrain International Corporation, All rights reserved. Terrain is a registered trademerk.

Limitations of this Repor

The undertake to voly use the Tenser's software stool and its output safely to evaluate the application of Tenser geograds, and wrictly according to the Tenser of Use. The suitability of the software output and Tenser International's geograds for any project is the sole emporability of you, and your employees, contractors or other their parts who accesses the Tenser's software to careful in natural. (Your Associater). The Tenner's software suitable in remely distinctive and is not a detailed design. You will internate the software to the tenser of the software suitable in the software sold and in out a detailed design. You will be received to see the software software to sold and its output commonly and safely. Copyright in the Tenner's software software sold and its sold and its output commonly and safely. Copyright in the Tenner's software sold and its sold and its output commonly and safely. Copyright in the Tenner's software sold and its sold and its output commonly and safely. Copyright in the Tenner's software sold and its sold and its

Geogrid option calculated with adjusted structural coefficient value of 0.17

6 in

0.080

0.480

4.705

Subsurface Exploration and Pavement Analysis Proposed New Streets	Local B		
Apollo Oaks	InTEC Project Number:	Date:	
Bexar County, Texas	S251061-R1	08/05/2025	



Design	Reference
Project	Location
Customer	Designer Murali Subramaniam
Company InTEC	Date March 21, 2025


Method of analysis

The calculation method used to create this Tensar software output is the design method for flexible pavements given in the AASHTO Guide for Design of Pavement Structures 1993. The enhancement of performance due to the inclusion of Tensar geogrids in the stabilised layer is derived empirically from full scale pavement tests and trafficking trials carried out by independent authorities.

Results



Unstabilized 2,216,400 ESALs

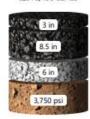

Total HMA thickness should be within the same range on both pavement sections for accurate comparison: 2-3 in | 3-6 in | 6-14 in

	Thickness	Coeff	SN
HMA layer 1	3 in	0.400	1.200
Aggregate base (NX750)	15.75 in	0.218	3 433
Structural number (SN)		20.00000	4.633

	Thickness	Coeff.	SN
HMA layer 1	3 in	0.440	1.320
HMA layer 2	8.5 in	0.340	2.890
Subbase	6 in	0.080	0.480
Structural number (SN)		4.690

Parameters

Project Information


Target ESALs	Subgrade resilient modulus	grade resilient modulus Reliability Standard deviation Serviceability		lity	
	W. C. J. T. S.			Initial	Terminal
2,000,000	3,750 psi	90%	0.45	4.2	2


Subsurface Exploration and Pavement Analysis Proposed New Streets Apollo Oaks Bexar County, Texas

Local B

InTEC Project Number: S251061-R1

InTEC of San Antonio ASTM D-1883 California Bearing Ratio Test Report Load Penetration Curve 100.0 90.0 80.0 70.0 Force on Plunger (psi) 60.0 50.0 40.0 30.0 20.0 10.0 0.0 0.000 0.100 0.200 0.300 0.400 0.500 Penetration (inches) **CBR Results** Results Α В D Average 0.1 in Pen. 3.0 0.2 in Pen. 2.6 Moisture (%) 21.20 Density (pcf) 98.60 Final Moisture (%) 29.40 88.20 Final Density (pcf) Project Number S251061 Sample Location Project Name Apollo Oaks Specimen A Vicinity of TP-1 Date 3/4/2025 Client Invesst 5S Specimen C Specimen D Job Ref. Liquid Limit: 62.0 Sample Num. 22.0 Plastic Limit: Dark Brown to Brown Clay, Gravel, Limestone Fragments Remarks Subsurface Exploration and Pavement Analysis **CBR Test Results (Clay Subgrade)** Proposed New Streets Apollo Oaks InTEC Project Number: Date: Bexar County, Texas 08/05/2025 S251061-R1

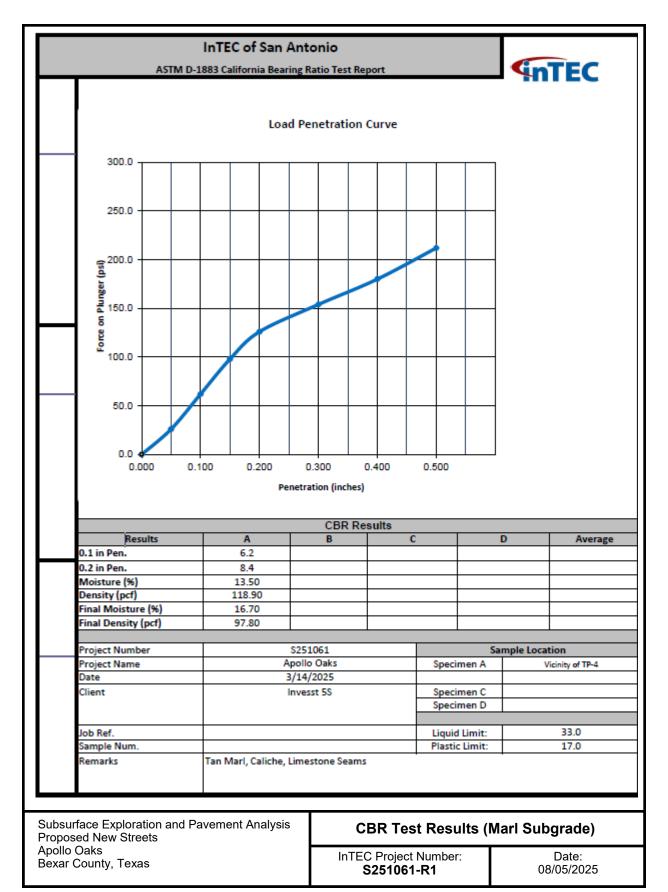

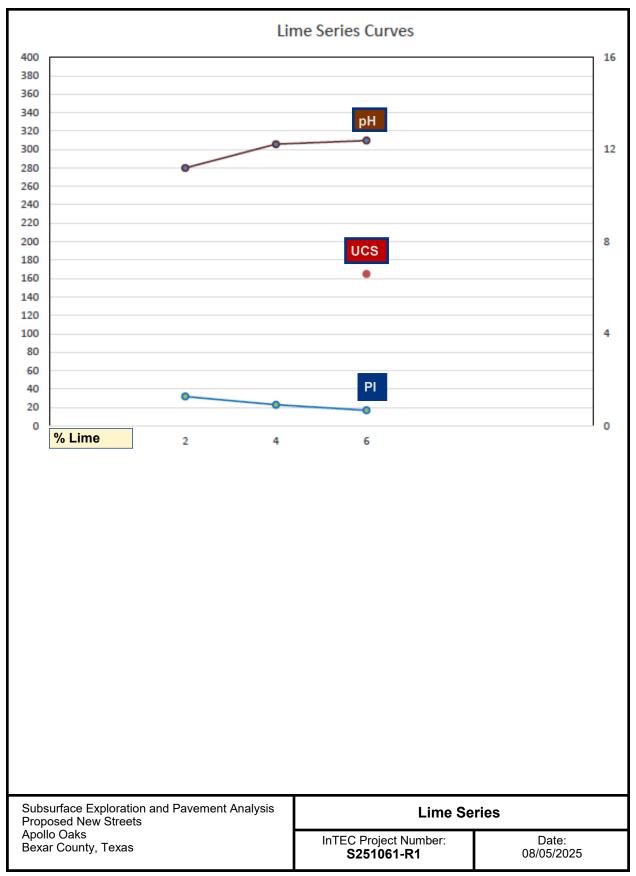

Appendix							
	T						
Subsurface Exploration and Pavement Analysis Proposed New Streets Apollo Oaks Bexar County, Texas	InTEC Project Number: S251061-R1	Date: 08/05/2025					

Important Information about This

Geotechnical-Engineering Report

Subsurface problems are a principal cause of construction delays, cost overruns, claims, and disputes.

While you cannot eliminate all such risks, you can manage them. The following information is provided to help.

The Geoprofessional Business Association (GBA) has prepared this advisory to help you - assumedly a client representative - interpret and apply this geotechnical-engineering report as effectively as possible. In that way, you can benefit from a lowered exposure to problems associated with subsurface conditions at project sites and development of them that, for decades, have been a principal cause of construction delays, cost overruns, claims, and disputes. If you have questions or want more information about any of the issues discussed herein, contact your GBA-member geotechnical engineer. Active engagement in GBA exposes geotechnical engineers to a wide array of risk-confrontation techniques that can be of genuine benefit for everyone involved with a construction project.

Understand the Geotechnical-Engineering Services Provided for this Report

Geotechnical-engineering services typically include the planning, collection, interpretation, and analysis of exploratory data from widely spaced borings and/or test pits. Field data are combined with results from laboratory tests of soil and rock samples obtained from field exploration (if applicable), observations made during site reconnaissance, and historical information to form one or more models of the expected subsurface conditions beneath the site. Local geology and alterations of the site surface and subsurface by previous and proposed construction are also important considerations. Geotechnical engineers apply their engineering training, experience, and judgment to adapt the requirements of the prospective project to the subsurface model(s). Estimates are made of the subsurface conditions that will likely be exposed during construction as well as the expected performance of foundations and other structures being planned and/or affected by construction activities.

The culmination of these geotechnical-engineering services is typically a geotechnical-engineering report providing the data obtained, a discussion of the subsurface model(s), the engineering and geologic engineering assessments and analyses made, and the recommendations developed to satisfy the given requirements of the project. These reports may be titled investigations, explorations, studies, assessments, or evaluations. Regardless of the title used, the geotechnical-engineering report is an engineering interpretation of the subsurface conditions within the context of the project and does not represent a close examination, systematic inquiry, or thorough investigation of all site and subsurface conditions.

Geotechnical-Engineering Services are Performed for Specific Purposes, Persons, and Projects, and At Specific Times

Geotechnical engineers structure their services to meet the specific needs, goals, and risk management preferences of their clients. A geotechnical-engineering study conducted for a given civil engineer will <u>not</u> likely meet the needs of a civil-works constructor or even a different civil engineer. Because each geotechnical-engineering study is unique, each geotechnical-engineering report is unique, prepared *solely* for the client.

Likewise, geotechnical-engineering services are performed for a specific project and purpose. For example, it is unlikely that a geotechnical-engineering study for a refrigerated warehouse will be the same as one prepared for a parking garage; and a few borings drilled during a preliminary study to evaluate site feasibility will not be adequate to develop geotechnical design recommendations for the project.

Do <u>not</u> rely on this report if your geotechnical engineer prepared it:

- for a different client;
- for a different project or purpose;
- for a different site (that may or may not include all or a portion of the original site); or
- before important events occurred at the site or adjacent to it;
 e.g., man-made events like construction or environmental remediation, or natural events like floods, droughts, earthquakes, or groundwater fluctuations.

Note, too, the reliability of a geotechnical-engineering report can be affected by the passage of time, because of factors like changed subsurface conditions; new or modified codes, standards, or regulations; or new techniques or tools. *If you are the least bit uncertain* about the continued reliability of this report, contact your geotechnical engineer before applying the recommendations in it. A minor amount of additional testing or analysis after the passage of time – if any is required at all – could prevent major problems.

Read this Report in Full

Costly problems have occurred because those relying on a geotechnical-engineering report did not read the report in its entirety. Do <u>not</u> rely on an executive summary. Do <u>not</u> read selective elements only. *Read and refer to the report in full.*

You Need to Inform Your Geotechnical Engineer About Change

Your geotechnical engineer considered unique, project-specific factors when developing the scope of study behind this report and developing the confirmation-dependent recommendations the report conveys. Typical changes that could erode the reliability of this report include those that affect:

- · the site's size or shape;
- the elevation, configuration, location, orientation, function or weight of the proposed structure and the desired performance criteria;
- · the composition of the design team; or
- · project ownership.

As a general rule, *always* inform your geotechnical engineer of project or site changes – even minor ones – and request an assessment of their impact. *The geotechnical engineer who prepared this report cannot accept*

responsibility or liability for problems that arise because the geotechnical engineer was not informed about developments the engineer otherwise would have considered.

Most of the "Findings" Related in This Report Are Professional Opinions

Before construction begins, geotechnical engineers explore a site's subsurface using various sampling and testing procedures. *Geotechnical engineers can observe actual subsurface conditions only at those specific locations where sampling and testing is performed.* The data derived from that sampling and testing were reviewed by your geotechnical engineer, who then applied professional judgement to form opinions about subsurface conditions throughout the site. Actual sitewide-subsurface conditions may differ – maybe significantly – from those indicated in this report. Confront that risk by retaining your geotechnical engineer to serve on the design team through project completion to obtain informed guidance quickly, whenever needed.

This Report's Recommendations Are Confirmation-Dependent

The recommendations included in this report – including any options or alternatives – are confirmation-dependent. In other words, they are <u>not</u> final, because the geotechnical engineer who developed them relied heavily on judgement and opinion to do so. Your geotechnical engineer can finalize the recommendations *only after observing actual subsurface conditions* exposed during construction. If through observation your geotechnical engineer confirms that the conditions assumed to exist actually do exist, the recommendations can be relied upon, assuming no other changes have occurred. *The geotechnical engineer who prepared this report cannot assume responsibility or liability for confirmation-dependent recommendations if you fail to retain that engineer to perform construction observation.*

This Report Could Be Misinterpreted

Other design professionals' misinterpretation of geotechnicalengineering reports has resulted in costly problems. Confront that risk by having your geotechnical engineer serve as a continuing member of the design team, to:

- · confer with other design-team members;
- help develop specifications;
- review pertinent elements of other design professionals' plans and specifications; and
- be available whenever geotechnical-engineering guidance is needed.

You should also confront the risk of constructors misinterpreting this report. Do so by retaining your geotechnical engineer to participate in prebid and preconstruction conferences and to perform construction-phase observations.

Give Constructors a Complete Report and Guidance

Some owners and design professionals mistakenly believe they can shift unanticipated-subsurface-conditions liability to constructors by limiting the information they provide for bid preparation. To help prevent the costly, contentious problems this practice has caused, include the complete geotechnical-engineering report, along with any attachments or appendices, with your contract documents, *but be certain to note*

conspicuously that you've included the material for information purposes only. To avoid misunderstanding, you may also want to note that "informational purposes" means constructors have no right to rely on the interpretations, opinions, conclusions, or recommendations in the report. Be certain that constructors know they may learn about specific project requirements, including options selected from the report, only from the design drawings and specifications. Remind constructors that they may perform their own studies if they want to, and be sure to allow enough time to permit them to do so. Only then might you be in a position to give constructors the information available to you, while requiring them to at least share some of the financial responsibilities stemming from unanticipated conditions. Conducting prebid and preconstruction conferences can also be valuable in this respect.

Read Responsibility Provisions Closely

Some client representatives, design professionals, and constructors do not realize that geotechnical engineering is far less exact than other engineering disciplines. This happens in part because soil and rock on project sites are typically heterogeneous and not manufactured materials with well-defined engineering properties like steel and concrete. That lack of understanding has nurtured unrealistic expectations that have resulted in disappointments, delays, cost overruns, claims, and disputes. To confront that risk, geotechnical engineers commonly include explanatory provisions in their reports. Sometimes labeled "limitations," many of these provisions indicate where geotechnical engineers' responsibilities begin and end, to help others recognize their own responsibilities and risks. *Read these provisions closely*. Ask questions. Your geotechnical engineer should respond fully and frankly.

Geoenvironmental Concerns Are Not Covered

The personnel, equipment, and techniques used to perform an environmental study – e.g., a "phase-one" or "phase-two" environmental site assessment – differ significantly from those used to perform a geotechnical-engineering study. For that reason, a geotechnical-engineering report does not usually provide environmental findings, conclusions, or recommendations; e.g., about the likelihood of encountering underground storage tanks or regulated contaminants. *Unanticipated subsurface environmental problems have led to project failures*. If you have not obtained your own environmental information about the project site, ask your geotechnical consultant for a recommendation on how to find environmental risk-management guidance.

Obtain Professional Assistance to Deal with Moisture Infiltration and Mold

While your geotechnical engineer may have addressed groundwater, water infiltration, or similar issues in this report, the engineer's services were not designed, conducted, or intended to prevent migration of moisture – including water vapor – from the soil through building slabs and walls and into the building interior, where it can cause mold growth and material-performance deficiencies. Accordingly, proper implementation of the geotechnical engineer's recommendations will not of itself be sufficient to prevent moisture infiltration. Confront the risk of moisture infiltration by including building-envelope or mold specialists on the design team. Geotechnical engineers are not building-envelope or mold specialists.



Telephone: 301/565-2733

e-mail: info@geoprofessional.org www.geoprofessional.org

Copyright 2019 by Geoprofessional Business Association (GBA). Duplication, reproduction, or copying of this document, in whole or in part, by any means whatsoever, is strictly prohibited, except with GBA's specific written permission. Excerpting, quoting, or otherwise extracting wording from this document is permitted only with the express written permission of GBA, and only for purposes of scholarly research or book review. Only members of GBA may use this document or its wording as a complement to or as an element of a report of any kind. Any other firm, individual, or other entity that so uses this document without being a GBA member could be committing negligent or intentional (fraudulent) misrepresentation.