



InTEC of San Antonio
12028 Radium
San Antonio, TX 78216
Phone: 210-525-9033

Moisture Density Relationship

Client:

Pulte Homes of Texas, LP
1718 Dry Creek Way Suite 120
San Antonio, TX 78259

Project:

S212189
Corley Farms Unit 2
29.737543477901177, -98.71426779610178
Boerne, TX

SAMPLE DATA

Sample Number: 22198

Sample Date: 04/03/2023

Technician: Pereida, Gerald

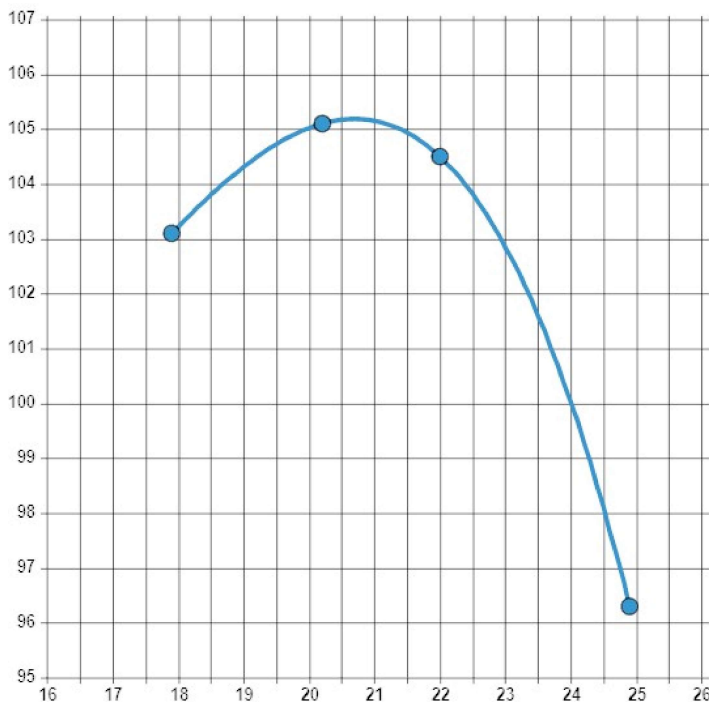
Material Use: Street-Lime Subgrade

Sample Location: Acorn Circle, STA 4+00

Material Description: Tan to Brown Clay with Gravel

LAB DATA

Test Method: ASTM D1557 - Method C

Proctor Curve:

Maximum Dry Density (pcf): 105.2

Optimum Moisture (%): 20.7

Soil Classification: CH-GV Clay with gravel - Lime Stabilized

Test Completed Date: 04/07/2023

Test Completed By: Agare, Ovie