



InTEC of San Antonio
12028 Radium
San Antonio, TX 78216
Phone: 210-525-9033

Moisture Density Relationship

Client:

Pulte Homes of Texas, LP
1718 Dry Creek Way Suite 120
San Antonio, TX 78259

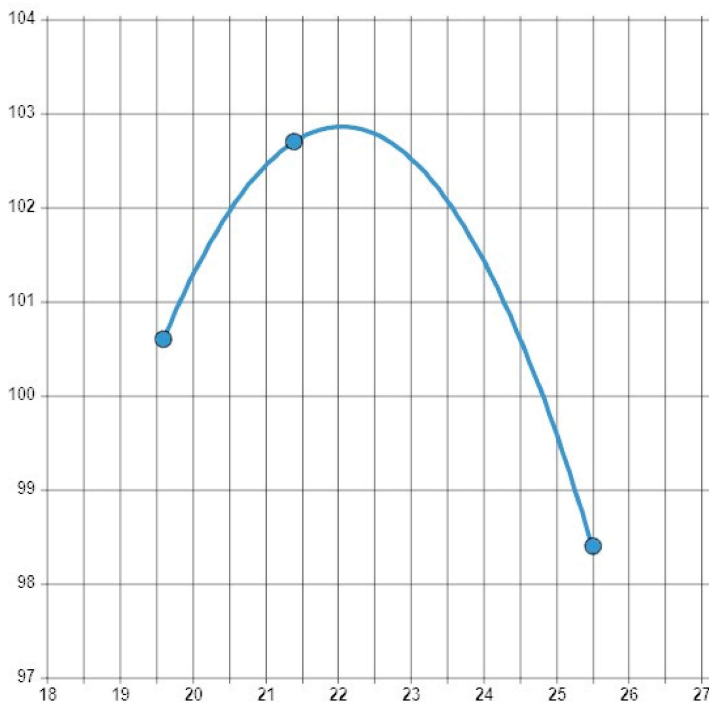
Project:

S212189
Corley Farms Unit 2
29.737543477901177, -98.71426779610178
Boerne, TX

SAMPLE DATA

Sample Number: 22216**Sample Date:** 04/04/2023**Technician:** Pereida, Gerald**Material Use:** Street-Lime Subgrade**Sample Location:** White Barn Cove, STA 7+00**Material Description:** Tan to Brown Clay with Gravel

LAB DATA

Test Method: ASTM D1557 - Method C**Proctor Curve:****Maximum Dry Density (pcf):** 102.9**Optimum Moisture (%):** 22.1**Soil Classification:** CH-GV Clay with gravel - Lime Stabilized**Test Completed Date:** 04/07/2023**Test Completed By:** Efediya, Eugene