



**Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas**

**InTEC Project No. S191159-P-R1
May 20, 2021**

**D. R. Horton, Inc.
5419 North Loop 1604 East
San Antonio, Texas 78247**



Integrated Testing and Engineering Company of San Antonio, L.P.

Geotechnical & Environmental Engineering • Construction Services • Geologic Assessment

May 20, 2021

E.A. Palaniappan, Ph.D., P.E.
Murali Subramaniam, Ph.D., P.E.
Kausi Subramaniam, B.S.

D. R. Horton, Inc.

5419 North Loop 1604 East
San Antonio, Texas 78247

Attention: **Ms. Leslie Ostrander, P.E.**

Email: lkostrander@drhorton.com

Re: Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

InTEC Project No. S191159-P-R1

Ladies & Gentlemen:

Integrated Testing and Engineering Company of San Antonio (InTEC) has completed a **subsurface exploration and pavement thickness evaluation report** (InTEC Project No. S191159-P dated November 07, 2019) at the above referenced project site. As requested, revised pavement recommendations are presented in this report. All other recommendations remain the same as in the original report.

We appreciate and wish to thank you for the opportunity to be of service to you on this project. If we can be of additional assistance during the foundations explorations, and materials testing-quality control phase of construction, please call us.

Sincerely,

InTEC of San Antonio, L.P.



05/21/2021

Murali Subramaniam, Ph. D., P.E.

EXECUTIVE SUMMARY

The soil conditions at the location of the **proposed new streets at the 1,131.8 Acre Riverstone Tract in San Antonio, Texas** were obtained from **drilling 68 borings to depths of 8 to 15 feet**. Laboratory tests were performed on selected specimens to evaluate the engineering characteristics of various soil strata encountered in the borings.

The results of our exploration, laboratory testing and engineering evaluation indicate the underlying clays at this site are **moderately plastic to highly plastic in character**. Potential vertical movements on the order of **1 ½ to 4 ½ inches** were estimated.

The proposed pavements at this site may be supported by flexible pavement sections. Cut and fill information is not available for our review at this time. Brown clay or tan clay or tan gravelly clay or tan marl to limestone subgrades are anticipated. At the time of construction, if the final street subgrade consists of material other than encountered in our borings, the recommendations may have to be revised. Pavement section recommendations for Local, Collector, and Arterial type streets are presented.

Ground water was not encountered in the borings at the time of drilling.

Detailed descriptions of subsurface conditions, engineering analysis, and design recommendations are included in this report.

Summary of Recommended Options
Minimum Flexible Pavement Recommendations – CBR = 4.0**

Classification	Asphaltic Concrete, Inches			Aggregate Base, Inches	Geogrid	Subgrade, Inches	Structural Number
	Type D	Type C	Type B				
Local Type A (no bus traffic)	2.00	-	-	10.00	No	*	2.28
	2.00	-	-	8.00	Yes	*	2.24
Local Type A (with bus traffic)	3.00	-	-	13.50	No	*	3.21
	3.00	-	-	11.50	Yes	*	3.27
Local Type B	3.00	-	-	19.00	No	*	3.98
	3.00	-	-	16.00	Yes	*	4.04
	3.00	-	8.00	-	No	*	4.04
Collector	3.00	-	-	21.50	No	*	4.33
	3.00	-	-	18.00	Yes	*	4.38
	3.00	-	9.00	-	No	*	4.38
Arterial	1.50	2.50	-	21.50	No	*	4.77
	1.50	2.50	-	18.00	Yes	*	4.82
	1.50	2.50	9.00	-	No	*	4.82

Subgrade Notes (*):

- Cut and fill data are not available at this time.
- Based on the review of geologic and soils map, we anticipate the final pavement subgrade Plasticity Index value to be less than or equal to 20.
- If the subgrade Plasticity Index values are less than or equal to 20, as per City of San Antonio or Bexar County requirements, subgrade stabilization / treatment is not needed.
- However, if the final street subgrade Plasticity Index values are greater than 20, then one of the following options may be followed:
 - Remove the clays soils (with Plasticity Index values greater than 20) and replace with fill material with Plasticity Index values less than or equal to 20.
 - Treat the subgrade:
 - The subgrade should be treated to a depth of 6 inches using 6 ½ percent lime content.
 - The subgrade soils should be tested for soil sulfate content prior to stabilization / treatment. If the soil sulfate content is over 3000 ppm, an alternate procedure will be required.
 - The subgrade may also be treated using cement.
 - Application rates should be determined at the time of construction.

- Lime application rate of 27 lbs per sq yard for 6-inch depth of treatment may be used for planning and budgeting purposes. The lime / cement application rates should be determined at the time of construction.

General Notes (**):

- Input parameters are shown in Table No. 6. Please call us to provide pavement recommendations, if needed, for different input values. If repetitive truck or heavy truck traffic is anticipated, please contact us for revised pavement recommendations.
- Pavement section recommendations are based on a subgrade CBR value of 4.0. The pavement recommendations are not based on the shrink / swell characteristics of the underlying soils. The pavement can experience cracking and deformation due to shrinkage and swelling characteristics of the soils as described in the Vertical Movements section of this report. Use of geogrid help reduce shrink / swell related pavement distress.
- If water is allowed to get underneath the asphalt or if moisture content of the base or subgrade changes significantly, then pavement distress will occur. External vertical moisture barrier, such as a deeper curb extending a minimum of 6 inches into subgrade, will reduce water getting underneath the asphalt.

Geogrid:

- One layer of geogrid, Tensar Triax TX5, installed on top of compacted (stabilized / treated) subgrade as per manufacturer's guidelines

Fill Material:

- If fill is used to raise the grade, fill material underneath the pavement should be approved fill material, free of deleterious material and with a minimum CBR value of 4.0 and a maximum plasticity index value of 20. The material should be placed as per applicable city or county guidelines.

Subgrade Verification:

- The final pavement subgrade should be verified by InTEC at the time of construction.

Input Parameters used in Asphalt Pavement Section Calculation

	Local Type A (no bus traffic)	Local Type A (with bus traffic)	Local B	Collector	Arterial
ESAL	100,000	1,000,000	2,000,000	2,000,000	3,000,000
Reliability Level	R-70	R-70	R-90	R-90	R-95
Initial and Terminal Serviceability	4.2 and 2.0	4.2 and 2.0	4.2 and 2.0	4.2 and 2.5	4.2 and 2.5
Standard Deviation	0.45	0.45	0.45	0.45	0.45
Service Life	20 years	20 years	20 years	20 years	20 years
If heavy truck traffic is anticipated, please contact InTEC with anticipated traffic data for revised recommendations.					

Summary of Pavement Materials

Pavement Section	Material	Stabilization or Treatment	Thickness
Subgrade	Clays (Plasticity Index values less than or equal to 20)	Treatment Sulfate content should be tested prior to stabilization / treatment	As recommended in pavement options (6 inches)
	Tan Calcareous Clay or Marl (Plasticity Index values less than or equal to 20)	Compacted subgrade	-
Base	TxDOT Item 247 A1-2	-	As recommended in pavement options (maximum of 6 inches per lift)
Asphalt	Type B, C, D	-	As recommended in pavement options
Geogrid	Tensar Triax TX5	One layer	As per manufacturer's recommendations

See report for more details

Applicable procedures and minimum density and moisture percentages

All applicable City of San Antonio Standard Specifications for Construction, June 2008, should be followed. Some of the relevant procedures are shown below.

Pavement Material	Procedure *	Density and Moisture Control
Subgrade fill (maximum 6 inch thick lifts)	Item 107	As per construction specifications
Treated Subgrade (6 inch thick lift)	Item 108- lime	As per construction specifications
Aggregate Base TxDOT Item 247 A1-2 (maximum 6 inch thick lift)	Item 200	As per construction specifications
Asphalt HMAC Type B, C, D	Item 205, 206	As per construction specifications
Geogrid	Manufacturer's Guidelines	-

(*) City of San Antonio Standard Specifications for Construction, June 2008

TABLE OF CONTENTS

INTRODUCTION	8
General	8
Purpose and Scope of Services	8
Project Description	9
SUBSURFACE EXPLORATION.....	10
Scope.....	10
Drilling and Sampling	10
Field Tests and Water Level Measurements	10
Field Logs	11
Presentation of the Data.....	11
LABORATORY TESTING PROGRAM.....	12
Purpose	12
Laboratory Tests	12
Presentation of the Data.....	12
GENERAL SUBSURFACE CONDITIONS.....	14
Soil Stratigraphy.....	14
Ground Water Observations.....	14
PAVEMENTS ON EXPANSIVE SOIL.....	16
General	16
Evaluation of the Shrink-Swell Potential of the Soils.....	16
The Mechanism of Swelling.....	16
Initial Moisture Condition and Moisture Variation.....	16
Man Made Conditions That Can Be Altered	17
Summation.....	19
DESIGN ENGINEERING ANALYSIS	20
Pavement Design Considerations	20
Vertical Movements.....	20
Method to Lower Vertical Movements	21
PAVEMENT GUIDELINES	22
General	22
Pavement Design.....	22
“Alligator” type Cracks.....	23
Longitudinal Cracks.....	23
Periodic Maintenance.....	24
Pavement Sections	24
Subgrade Preparation	27
Base Course	28
Asphaltic Concrete	28
Perimeter Drainage.....	28
CONSTRUCTION GUIDELINES.....	29
Construction Monitoring	29
Site Preparation	29
Compaction.....	29
Proof Rolling	30
Select Fill	30
General Fill.....	31
General Fill Compaction.....	31
Ground Water	31

Drainage	32
Temporary Drainage Measures	32
Temporary Construction Slopes	32
Permanent Slopes.....	33
Time of Construction	33
Control Testing and Field Observation	33
DRAINAGE AND MAINTENANCE	34
Dry Periods	35
LIMITATIONS	36

INTRODUCTION

General

This report presents the results of our **subsurface exploration and pavement thickness evaluation** for the **proposed new streets at the 1,131.8 Acre Riverstone Tract in San Antonio, Texas**. This project was authorized by **Ms. Leslie Ostrander, P.E.**

Purpose and Scope of Services

The purpose of our subsurface investigation was to evaluate the site's subsurface and ground water conditions and provide pavement thickness recommendations for the planning and development phases of the project. Our scope of services includes the following:

- 1) drilling and sampling of 68 borings – to depths of 8 to 15 feet;
- 2) evaluation of the in-place conditions of the subsurface soils through field penetration tests;
- 3) observing the ground water conditions during drilling operations;
- 4) performing laboratory tests such as Atterberg limits, California Bearing Ratio (C.B.R.), Lime Series, and Moisture content tests;
- 5) review and evaluation of the field and laboratory test programs during their execution with modifications of these programs, when necessary, to adjust to subsurface conditions revealed by them;
- 6) compilation, generalization and analyses of the field and laboratory data in relation to the project requirements;
- 7) estimate of potential vertical movements;
- 8) preparation of pavement guidelines;
- 9) preparation of a written geotechnical engineering report for use by the members of the design team in their preparation of construction, contract, and specifications documents.

The Scope of Services **did not include slope stability or any environmental assessment** for the presence or absence of wetlands or hazardous or toxic materials in the soil, surface water, groundwater, or air, on or below or around this site. Any statements in this report or on the boring logs regarding odors, colors or unusual or suspicious items or conditions are strictly for the information of the client.

Project Description

The proposed project involves the development of the new streets at the 1,131.8 Acre Riverstone Tract in San Antonio, Texas. The proposed pavement areas are anticipated to include Local, Collector, and Arterial type streets. Cut and fill information are not available for our use at this time. Brown clay, tan clay, tan gravelly clay or tan marl to limestone subgrades are anticipated.

Limestone was encountered in some of the borings. Karst features are formed in limestone, dolomite, or gypsum by dissolution. A geophysical study of the site may indicate the presence and potential impact of Karst features, caves, or significant cavities on the building performance and construction delays. The thickness of the clay layers may vary across the site. Geophysical study is not within the scope of this investigation. Aerial, topographic, and geologic maps are presented in the Illustration section of this report.

SUBSURFACE EXPLORATION

Scope

The field exploration to determine the engineering characteristics of the subsurface materials included a reconnaissance of the project site, drilling the borings, performing Standard Penetration Tests, and obtaining Split Barrel samples.

Sixty-eight soil test borings were drilled at the approximate locations shown on the Boring Location Plan, Plate 1, included in the Illustration section of this report. These borings were **drilled to depths of 8 to 15 feet below the presently existing ground surface**. Boring locations were selected by the project geotechnical engineer and established in the field by the drilling crew using normal taping procedures.

Drilling and Sampling

Four soil borings were performed with a drilling rig equipped with a rotary head. Conventional solid stem augers were used to advance the holes and samples of the subsurface materials were obtained **using a Split Barrel sampler**. The samples were identified according to boring number and depth, encased in polyethylene plastic wrapping to protect against moisture loss, and transported to our laboratory in special containers.

In summary, the following samples as presented in Table No. 1 were collected as a part of our field exploration procedure:

Table No. 1

Type of Sample	Number Collected
Split Barrel Samples	233
Auger Samples	87

Field Tests and Water Level Measurements

Penetration Tests – During the sampling procedures, **standard penetration tests were performed** in the borings in conjunction with the split-barrel sampling. The standard penetration value (N) is defined as the number of blows of a 140-pound hammer, falling thirty inches, required

to advance the split-spoon sampler one foot into the soil. The sampler is lowered to the bottom of the drill hole and the number of blows recorded for each of the three successive increments of six inches penetration. The "N" value is obtained by adding the second and third incremental numbers. The results of the standard penetration test indicate the relative density and comparative consistency of the soils, and thereby provide a basis for estimating the relative strength and compressibility of the soil profile components.

Water Level Measurements – Ground water was not encountered in the borings at the time of drilling. In relatively pervious soils, such as sandy soils, the indicated elevations are considered reliable ground water levels. In relatively impervious soils, the accurate determination of the ground water elevation may not be possible even after several days of observation. Seasonal variations, temperature and recent rainfall conditions may influence the levels of the ground water table and volumes of water will depend on the permeability of the soils.

Field Logs

A field log was prepared for each boring. Each log-contained information concerning the boring method, samples attempted and recovered, indications of the presence of various materials such as silt, clay, gravel or sand and observations of ground water. It also contained an interpretation of subsurface conditions between samples. **Therefore, these logs included both factual and interpretive information.**

Presentation of the Data

The final logs represent our interpretation of **the contents of the field logs for the purpose delineated by our client.** The final logs are included on **Plates 2 thru 69** included in the Illustration section. A key to classification terms and symbols used on the logs is presented on **Plate 70.**

LABORATORY TESTING PROGRAM

Purpose

In addition to the field exploration, a supplemental laboratory testing program was conducted to determine additional **pertinent engineering characteristics** of the subsurface materials necessary in evaluating the soil parameters.

Laboratory Tests

All phases of the laboratory testing program were performed **in general accordance with the indicated applicable** ASTM Specifications as indicated in Table No. 2.

Table No. 2

Laboratory Test	Applicable Test Standard
Liquid Limit, Plastic Limit and Plasticity Index of the Soils	ASTM D 4318
Moisture Content	ASTM D 2216
California Bearing Ratio	ASTM D 1883
pH	ASTM D 6276
Unconfined Compressive Strength	ASTM D 5102

In the laboratory, each sample **was observed and classified by a geotechnical engineer**. As a part of this classification procedure, the natural water contents of selected specimens were determined. Liquid and plastic limit tests were performed on representative specimens to determine the plasticity characteristics of the different soil strata encountered.

Presentation of the Data

In summary, the tests presented in Table No. 3 in the following page were conducted in the laboratory to evaluate the engineering characteristics of the subsurface materials:

Table No. 3

Type of Test	Number Conducted
Natural Moisture Content	320
Atterberg Limits	59
California Bearing Ratio	1
Lime Series	1

The results of all these tests are presented on appropriate boring logs. These laboratory test results were used to classify the soils encountered generally according to the Unified Soil Classification System (ASTM D 2487).

GENERAL SUBSURFACE CONDITIONS

Soil Stratigraphy

The soils underlying the site may be grouped into **two generalized strata** with similar physical and engineering properties. The lines designating the interface between soil strata on the logs represent approximate boundaries. Transition between materials may be gradual. The soil stratigraphy information at the boring locations are presented in **Boring Logs, Plates 2 thru 69**. The soil conditions in between borings may vary across the site. We should be called upon at the time of construction to verify the soil conditions between our borings.

The engineering characteristics of the underlying soils, based the results of the laboratory tests performed in selected samples, are summarized and presented in the following paragraph.

Brown clays, dark brown clays, tan clays, tan clays to tan gravelly clays, tan gravelly clays tan calcareous clays to light tan marl, tan marl to limestone and light tan to white limestone underlie the project site. These clays are moderately plastic to highly plastic with tested liquid limits ranging from 21 to 99 and plasticity index values varying from 06 to 75. The results of standard penetration tests performed within these clays varied from 15 to greater than 50 blows per foot.

The above description is of a generalized nature to highlight the major soil stratification features and soil characteristics. The test boring logs should be consulted for specific information at each boring location.

Soil Stratigraphy may vary between boring locations. If deviations from the noted subsurface conditions are encountered during construction, they should be brought to the attention of InTEC. We may revise the recommendations after evaluating the significance of the changed conditions.

Ground Water Observations

Ground water was not encountered in the borings at the time of drilling. Short term field observations generally do not provide accurate ground water levels. The contractor should check the subsurface water conditions prior to any excavation activities. The low permeability of the soils would require several days or longer for ground water to enter and stabilize in the bore holes. Ground water levels will fluctuate with seasonal climatic variations and changes in the land use.

It is not unusual to encounter shallow groundwater during or after periods of rainfall. The surface water tends to percolate down through the surface until it encounters a relatively impervious layer.

PAVEMENTS ON EXPANSIVE SOIL

General

There are many plastic clays that swell considerably when water is added to them and then shrink with the loss of water. Pavements constructed on these clays are subjected to large uplifting forces caused by the swelling.

In the characterization of a pavement site, two major factors that contribute to potential shrink-swell problems must be considered. Problems can arise if a) the soil has expansive and shrinkage properties and b) the environmental conditions that cause moisture changes to occur in the soil.

Evaluation of the Shrink-Swell Potential of the Soils

Subsurface sampling, laboratory testing and data analyses are used in the evaluation of the shrink-swell potential of the soils under the pavements.

The Mechanism of Swelling

The mechanism of swelling in expansive clays is complex and is influenced by a number of factors. Basically, expansion is a result of changes in the soil-water system that disturbs the internal stress equilibrium. Clay particles in general have negative electrical charges on their surfaces and positively charged ends. The negative charges are balanced by actions in the soil water and give rise to an electrical interparticle force field. In addition, adsorptive forces exist between the clay crystals and water molecules, and Van Der Waals surface forces exist between particles. Thus, there exists an internal electro-chemical force system that must be in equilibrium with the externally applied stresses and capillary tension in the soil water. If the soil water chemistry is changed either by changing the amount of water or the chemical composition, the interparticle force field will change. If the change in internal forces is not balanced by a corresponding change in the state of stress, the particle spacing will change so as to adjust the interparticle forces until equilibrium is reached. This change in particle spacing manifests itself as a shrinkage or swelling.

Initial Moisture Condition and Moisture Variation

Volume change in an expansive soil mass is the result of increases or decreases in water content. The initial moisture content influences the swell and shrink potential relative to possible limits, or ranges, in moisture content. Moisture content alone is useless as an indicator or predictor of

shrink-swell potential. The relationship of moisture content to limiting moisture contents such as the plastic limit and liquid limit must be known.

If the moisture content is below or near plastic limit, the soils have high potential to swell. It has been reported that expansive soils with liquidity index* in the range of 0.20 to 0.40 will tend to experience little additional swell.

The availability of water to an expansive soil profile is influenced by many environmental and manmade factors. Generally, the upper few feet of the profile are subjected to the widest ranges of moisture variation, and are least restrained against movement by overburden. This upper stratum of the profile is referred to as the active zone. Moisture variation in the active zone of a natural soil profile is affected by climatic cycles at the surface, and fluctuating groundwater levels at the lower moisture boundary. The surficial boundary moisture conditions are changed significantly simply by placing a barrier such as a building floor slab or pavement between the soil and atmospheric environment. Other obvious and direct causes of moisture variation result from altered drainage conditions or man-made sources of water, such as irrigation or leaky plumbing. The latter factors are difficult to quantify and incorporate into the analysis, but should be controlled to the extent possible for each situation. For example, proper drainage and attention to landscaping are simple means of minimizing moisture fluctuations near structures, and should always be taken into consideration.

Man Made Conditions That Can Be Altered

There are a number of factors that can influence whether a soil might shrink or swell and the magnitude of this movement. For the most part, either the owner or the designer has some control over whether the factor will be avoided altogether or if not avoided, the degree to which the factor will be allowed to influence the shrink-swell process.

Antecedent Rainfall Ratio This is a measure of the local climate and is defined as the total monthly rainfall for the month of and the month prior to laying the pavement divided by twice the average monthly rate measured for the period. The intent of this ratio is to give a relative measure of ground moisture conditions at the time the pavement is placed. Thus, if a pavement is placed at the end of a wet period, the pavement should be expected to experience some loss of support around the perimeter as the wet soils begin to dry out and

* LIQUIDITY INDEX = (NATURAL WATER CONTENT - PLASTIC LIMIT) / (LIQUID LIMIT - PLASTIC LIMIT)

shrink. The opposite effect could be anticipated if the pavement is placed at the end of an extended dry period; as the wet season occurs, uplift around the perimeter may occur as the soil at the edge of the slab pavement in moisture content.

Age of Pavement The length of time since the pavement was cast provides an indication of the type of swelling of the soil profile that can be expected to be found beneath the pavement.

Drainage This provides a measure of the slope of the ground surface with respect to available free surface water that may accumulate around the pavement. Most builders are aware of the importance of sloping the final grade of the soil away from the pavement so that rain water is not allowed to collect and pond against or adjacent to the pavement. If water were allowed to accumulate next to the pavement, it would provide an available source of free water to the expansive soil underlying the pavement. Similarly, surface water drainage patterns or swales must not be altered so that runoff is allowed to collect next to the pavement.

Pre-Construction Vegetation Large amount of vegetation existing on a site before construction may have desiccated the site to some degree, especially where large trees grew before clearing. Constructing over a desiccated soil can produce some dramatic instances of heave and associated structural distress and damage as it wets up.

Post-Construction Vegetation The type, amount, and location of vegetation that has been allowed to grow since construction can cause localized desiccation. Planting trees or large shrubs near a pavement can result in loss of foundation support as the tree or shrub removes water from the soil and dries it out. Conversely, the opposite effect can occur if flowerbeds or shrubs are planted next to the pavement and these beds are kept well-watered or flooded. This practice can result in swelling of the soil around the perimeter where the soil is kept wet.

Utilities Underneath the Pavement The utilities such as sewer, water, electricity, gas, and communication lines are often installed underneath the streets. The sewer utility construction, for example, typically involves trenching to the desired depth, installing gravel a gravel bed underneath the sewer main, installing primary backfill (gravel), and placing back the secondary backfill (generally excavated soils). The secondary backfill material is compacted in lifts. In addition, sewer service lines run laterally from each house (for a

typical subdivision, approximately every 50-ft). These trenches with gravel and onsite material backfill are conducive to carrying water. In addition, the sewer service lines can carry water from behind the curb. Occasionally, the sewer line may be encased in concrete which will cause ponding of any travelling water within the sewer trenches. Any water travelling within these trenches can cause expansive clays to swell. If the backfill is not adequately compacted or if excessive water is flowing in these trenches, the trench backfill can potentially settle.

Summation

It is beyond the scope of this investigation to do more than point out that the above factors have a definite influence on the amount and type of swell to which a pavement is subjected during its useful life. The design engineer must be aware of these factors as he develops his design and make adjustments as necessary according to the results of special measurements or from his engineering experience and judgment.

DESIGN ENGINEERING ANALYSIS

Pavement Design Considerations

Review of the borings and test data indicates that the following factors will affect the pavement design and construction at this site:

- 1) The site is underlain by clays of moderate to high plasticity and marl to limestone strata. Structures supported on or within these soils will be subjected to potential vertical movements on the order of **1 ½ to 4 ½ inches**.
- 2) The strengths of the underlying soils are adequate to support the proposed new streets.
- 3) Based on the stratigraphy observed at this site, the final street subgrade is anticipated to be in the brown clay or tan clay or tan gravelly clay and tan marl to limestone strata. The final street subgrade should be verified by InTEC at the time of construction.
- 4) Ground water was not encountered in the borings at the time of drilling.

Vertical Movements

The **potential vertical rise (PVR) for slab-on grade construction at the location of the structures had been estimated using Texas Department of Transportation Procedure TXDOT-124-E**. This method utilizes the liquid limits, plasticity indices, and in-situ moisture contents for soils in the seasonally active zone, estimated to be about twelve to fifteen feet at the project site.

The estimated PVR value provided is based on the proposed floor system applying a sustained surcharge load of approximately 1.0 lb. per square inch on the subgrade materials. **Potential vertical movement on the order of 1 ½ to 4 ½ inches was estimated at the existing grade elevation**. TxDOT method of estimating potential vertical movement of expansive clays is based on empirical correlations utilizing measured plasticity index values and assumed seasonal fluctuations in moisture content. Higher or lower PVR values may be estimated using other methods. However, the TxDOT method is the most widely used in the project area

The PVR values are based on the current site grades. If cut and fill operations in excess of 6 inches are performed, the PVR values could change significantly. Higher PVR values than the above-mentioned values will occur in areas where water is allowed to pond for extended periods.

If proper drainage is not maintained (allowing subgrade moisture content to change significantly) and / or if the pavement is underlain by utility trenches and the utilities leak (a) potential vertical movements will be much greater than 2 to 3 times the anticipated vertical movements will be realized and (b) the subgrade strength may be significantly lowered.

If the finish grade elevation is higher than the existing grade, compacted select fill should be used to raise the grade level. Any select fill should be placed and compacted as recommended under “Select Fill” in the “Construction Guidelines” section of this report. Each lift should be compacted and tested by InTEC to verify Compaction Compliance.

Method to Lower Vertical Movements

The underlying clays may be removed to a depth of **4 to 7 feet** and replaced by compacted crushed limestone select fill. The depth options and the respective anticipated movements after selection of one of the depth options are presented in Table No. 4.

Table No. 4

Depth of Existing Clay Removal and Replacement, Feet	Potential Vertical Movements, Inches
0	4 ½
4	2 ½
7	1

It should be noted that expansive clay does not shrink/swell without changes in moisture content, and thus good site design is very important to minimize movements. Coping with problems of shrink/swell due to expansive clays is a “fact of life” in the Texas region of south western U.S.A.

PAVEMENT GUIDELINES

General

Pavement area at this unit is expected to include Local, Collector, and Arterial type streets. The following recommendations are presented as a guideline for pavement design and construction. These recommendations are based on a) our previous experience with subgrade soils like those encountered at this site, b) pavement sections which have proved to be successful under similar design conditions, c) final pavement grades will provide adequate drainage for the pavement areas and that water will not be allowed to enter the pavement system by either edge penetration adjacent to landscape areas or penetration from the surface due to surface ponding, or inadequate maintenance of pavement joints, or surface cracks that may develop.

Pavement Design

Pavement designs provide an adequate thickness of structural sections over a particular subgrade (in order to reduce the wheel load to a distributed level so that the subgrade can support load). The support characteristics of the subgrade are based on strength characteristics of the subgrade soils and not on the shrinkage and swelling characteristics of the clays. Therefore, the pavement sections may be adequate from a structural stand point, may still experience cracking and deformation due to shrinkage and swelling characteristics of the soils. In addition, if the proposed new pavements are used to carry temporary construction traffic, then heavier sections may be needed. Please contact InTEC to discuss options.

It is very important to minimize moisture changes in the subgrade to lower the shrinkage and swell movements of the subgrade clays. The pavement and adjacent areas should be well drained. Proper maintenance should be performed by sealing the cracks as soon as they develop to prevent further water penetrations and damage. In our experience,

- (a) majority of the pavement distress observed over the years were caused by changes in moisture content of the underlying subgrade and / or excessive moisture in the base section,
- (b) pavements with a grade of one percent or more have performed better than the pavements with allowable minimum grade,

- (c) pavements with no underground utilities have performed better than pavements with underground utilities and the associated laterals,
- (d) pavements that are at a higher-grade elevation than the surrounding lots have performed better, and
- (e) any design effort that minimizes moisture penetration into the pavement layers have performed better.

“Alligator” type Cracks

A layer of aggregate base is typically used underneath the concrete curbs around the pavement areas. This layer of aggregate base underneath the concrete curb is conducive to the infiltration of surface water into the pavement areas. Water infiltration into the subgrade and / or base layer can result in “alligator type” cracks especially when accompanied by construction traffic. Increased moisture content of the pavement sections will significantly impact its support characteristics. Moisture penetration into pavement layers can be reduced by (a) penetrating the concrete curbs at least three inches into the native clays soils, (b) installing French Drains on the outside of the curbs, or (c) installing a moisture barrier such as a trench filled with bentonite or flowable fill. Alligator type cracks are also caused by weak / soft pockets within the pavement layers. Thoroughly proof rolling the subgrade and base layers will help identify the soft spots and densify as needed.

Longitudinal Cracks

Asphalt pavements in highly expansive soil conditions, such as the soils encountered at this site, can develop longitudinal cracks along the pavement edges. The longitudinal cracking typically occurs about 1 to 4 feet inside of the pavement edges and they run parallel to the pavement edge. Longitudinal or reflective cracks may also be observed over utility trenches. The longitudinal cracks are generally caused by differential drying and shrinkage of the underlying expansive clays. The moisture content change of the underlying subgrade clays can be reduced by installing moisture barriers. Vertical moisture barriers along the edge of the pavement or horizontal moisture barriers such as paved sidewalks or geogrid will help control the development of the longitudinal cracks.

Periodic Maintenance

The pavements constructed on clay subgrades such as the one encountered at this site will be subjected to shrink / swell related movements. Hence, proper maintenance should be performed by sealing the cracks as soon as they develop to prevent further water penetrations and damage.

Pavement Sections

Local and Collector type residential streets may be designed with flexible pavements. The final finish street subgrade is expected to be in brown clay or tan clays or tan gravelly clay or tan marl to limestone areas. Minimum flexible pavement sections for the anticipated subgrades are presented in Table No. 5 in the following page. The project geotechnical engineer should delineate the streets for different subgrades at the time of construction. Input parameters used in the pavement section calculations are presented in Table No. 6.

- If pavement design for parameters other than those shown in Table No.6 is needed or if repetitive / heavy truck traffic is anticipated, please contact us for additional pavement section recommendations.
- The recommended pavement sections are based on the subgrade soil support characteristics.
- The pavement sections are not based on shrink / swell characteristics of the subgrade soils.
- The subgrade soil support characteristics will be significantly affected by changes in moisture content.

The cut and fill information is not available at this time. The final street subgrade should be verified by InTEC at the time of construction.

Table No. 5 – Minimum Flexible Pavement Recommendations – CBR = 4.0 **

Classification	Asphaltic Concrete, Inches			Aggregate Base, Inches	Geogrid	Subgrade, Inches	Structural Number
	Type D	Type C	Type B				
Local Type A (no bus traffic)	2.00	-	-	10.00	No	*	2.28
	2.00	-	-	8.00	Yes	*	2.24
Local Type A (with bus traffic)	3.00	-	-	13.50	No	*	3.21
	3.00	-	-	11.50	Yes	*	3.27
Local Type B	3.00	-	-	19.00	No	*	3.98
	3.00	-	-	16.00	Yes	*	4.04
	3.00	-	8.00	-	No	*	4.04
Collector	3.00	-	-	21.50	No	*	4.33
	3.00	-	-	18.00	Yes	*	4.38
	3.00	-	9.00	-	No	*	4.38
Arterial	1.50	2.50	-	21.50	No	*	4.77
	1.50	2.50	-	18.00	Yes	*	4.82
	1.50	2.50	9.00	-	No	*	4.82

Subgrade Notes (*):

- Cut and fill data are not available at this time.
- Based on the review of geologic and soils map, we anticipate the final pavement subgrade Plasticity Index value to be less than or equal to 20.
- If the subgrade Plasticity Index values are less than or equal to 20, as per City of San Antonio or Bexar County requirements, subgrade stabilization / treatment is not needed.
- However, if the final street subgrade Plasticity Index values are greater than 20, then one of the following options may be followed:
 - Remove the clays soils (with Plasticity Index values greater than 20) and replace with fill material with Plasticity Index values less than or equal to 20.
 - Treat the subgrade:
 - The subgrade should be treated to a depth of 6 inches using 6 ½ percent lime content.
 - The subgrade soils should be tested for soil sulfate content prior to stabilization / treatment. If the soil sulfate content is over 3000 ppm, an alternate procedure will be required.
 - The subgrade may also be treated using cement.
 - Application rates should be determined at the time of construction.

- Lime application rate of 27 lbs per sq yard for 6-inch depth of treatment may be used for planning and budgeting purposes. The lime / cement application rates should be determined at the time of construction.

General Notes (**):

- Input parameters are shown in Table No. 6. Please call us to provide pavement recommendations, if needed, for different input values. If repetitive truck or heavy truck traffic is anticipated, please contact us for revised pavement recommendations.
- Pavement section recommendations are based on a subgrade CBR value of 4.0. The pavement recommendations are not based on the shrink / swell characteristics of the underlying soils. The pavement can experience cracking and deformation due to shrinkage and swelling characteristics of the soils as described in the Vertical Movements section of this report. Use of geogrid help reduce shrink / swell related pavement distress.
- If water is allowed to get underneath the asphalt or if moisture content of the base or subgrade changes significantly, then pavement distress will occur. External vertical moisture barrier, such as a deeper curb extending a minimum of 6 inches into subgrade, will reduce water getting underneath the asphalt.

Geogrid:

- One layer of geogrid, Tensar Triax TX5, installed on top of compacted (stabilized / treated) subgrade as per manufacturer's guidelines

Fill Material:

- If fill is used to raise the grade, fill material underneath the pavement should be approved fill material, free of deleterious material and with a minimum CBR value of 4.0 and a maximum plasticity index value of 20. The material should be placed as per applicable city or county guidelines.

Subgrade Verification:

- The final pavement subgrade should be verified by InTEC at the time of construction.

Table No. 6 – Input Parameters used in Asphalt Pavement Section Calculation

	Local Type A (no bus traffic)	Local Type A (with bus traffic)	Local B	Collector	Arterial
ESAL	100,000	1,000,000	2,000,000	2,000,000	3,000,000
Reliability Level	R-70	R-70	R-90	R-90	R-95
Initial and Terminal Serviceability	4.2 and 2.0	4.2 and 2.0	4.2 and 2.0	4.2 and 2.5	4.2 and 2.5
Standard Deviation	0.45	0.45	0.45	0.45	0.45
Service Life	20 years	20 years	20 years	20 years	20 years
If heavy truck traffic is anticipated, please contact InTEC with anticipated traffic data for revised recommendations.					

Subgrade Preparation

It is important that any existing pavement and organic and compressible soils are removed and the exposed subgrade is properly prepared prior to pavement installation. The subgrade should be prepared as described in the applicable city / county Guidelines. Base course material should be placed immediately upon completion of the subgrade compaction operation to prevent drying of the soils due to exposure.

The finish grade elevation of the subgrade should be such that water drains downward freely towards a drainage area. At the drainage area, 3x5 rock may be provided at the subgrade level and the collected water at the drainage area should be taken out (such as into the existing concrete drainage channel). If any voids in the subgrade should be filled in with the same subgrade material and compacted in lifts.

The approved fill material should be placed in 8-inch lifts (6 inches compacted) and compacted as recommended in the Site Preparation section of the Construction Guidelines presented in this report. If the fill depth exceeds 4 feet, the potential subgrade settlement should be considered. Please contact InTEC with the cut and fill information to evaluate the effect of proposed cut and fill on the recommendations and to provide fill material and compaction recommendations.

Base Course

Based on the survey of available materials in the area, a base course of crushed limestone aggregate or gravel appears to be the most practical material for asphalt pavement project. The base course should conform to Texas State Department of Highways and Public Transportation Standard Specification, Item 247, Type A, Grade 1-2. The aggregate base course should be installed as per applicable city / county Guidelines.

At a minimum the base course should be brought to near optimum moisture conditions and compacted in lifts to at least 95 percent of maximum dry density as determined by test method TxDOT 113E.

Asphaltic Concrete

The asphaltic concrete surface course should conform to City of San Antonio Standard Construction Guidelines, 2008. The asphaltic concrete should be installed as per applicable city / county Guidelines.

Perimeter Drainage

It is important that proper perimeter drainage be provided so that infiltration of surface water from compacted areas surrounding the pavement is minimized, or if this is not possible, curbs should extend through the base and into the subgrade. A crack sealant compatible to both asphalt and concrete should be installed at the concrete-asphalt interfaces.

Wherever there are drastic grade changes in the pavement area (such as from 3 to 4 percent grade to 1 to 2 percent grade) 3 x 5 inch gravel subgrade with a subsurface drain system (such as Akwadrain® on the sides of the pavement) and outlet should be considered. This aspect will provide for a better drainage system in this area. Please contact InTEC for drainage recommendations.

CONSTRUCTION GUIDELINES

Construction Monitoring

As Geotechnical Engineer of Record for this project, InTEC should be involved in monitoring the pavement construction and earth work activities. Performance of any pavement system is not only dependent on the pavement design, but is strongly influenced by the quality of construction. Please contact our office prior of construction so that a plan for pavement construction and earthwork monitoring can be incorporated in the overall project quality control program. The testing requirements shall comply with the minimum testing requirements as per applicable city and county guidelines.

Site Preparation

Site preparation will consist of **preparation of the subgrade, and placement of select structural fill**. The project geotechnical **engineer InTEC should approve the subgrade preparation, the fill materials, and the method of fill placement and compaction**.

In any areas where soil-supported concrete structure or pavement are to be used, vegetation and all loose or excessively organic material should be stripped to a minimum depth of six inches and removed from the site. Subsequent to stripping operations, the pavement subgrade should be proof rolled prior to fill placement and recompacted to as per City of San Antonio Standard Construction Guidelines, 2008. The exposed subgrade should not be allowed to dry out prior to placing structural fill. Each lift should be tested by InTEC geotechnical engineer or his representative prior to placement of the subsequent lift.

Voids caused by site preparation, such as removal of trees or disturbed areas, should be compacted as described below:

Compaction

Site grading plan is not available for review at this time. If any low areas or disturbed areas encountered during construction should be appropriately prepared and compacted. Any deleterious or wet materials should be removed and wasted. The fill placement in the low areas should not be in a “bowl shape”. The sides of the fill area should be “squared up” and the excavated bottom should be proof rolled as described in *Proof Rolling* section of this report. On site material, with no deleterious material, may be used to raise the grade. After proof rolling operation,

the fill should be placed in 6-inch lifts and compacted to a minimum of **95 percent of the maximum dry density as determined by ASTM D 698 test method within optimum and three percent above optimum moisture content**. Each lift should be tested by InTEC for compaction compliance and approved before placement of the subsequent lifts. The exposed subgrade should not be allowed to dry out prior to placing structural fill. It is recommended that any given lot does not straddle filled areas and natural areas to help reduce differential movement of the structures.

The excavation boundaries should be set such that building or pavement areas do not straddle fill and natural areas. The anticipated potential vertical movement may be significantly affected after the cut and fill operations are performed in this area.

Proof Rolling

Proof rolling should be accomplished in order to locate and densify any weak compressible zones under the structure and pavement areas and prior to placement of the select fill or base. A minimum of 10 passes of a 25-ton pneumatic roller should be used for planning purposes. The operating load and tire pressure should conform to the manufactures specification to produce a minimum ground contact pressure of 90 pound per square inch. Proof rolling should be performed under the observation of the InTEC Geotechnical Engineer or his representative. The soils that yield or settle under proof rolling operations should be removed, dried and compacted or replaced with compacted select fill to grade. Density tests should be conducted as specified under *Control Testing and Filed Observation* after satisfactory proof rolling operation.

Proper site drainage should be maintained during construction so that ponding of surface run-off does not occur and cause construction delays and/or inhibit site access.

Select Fill

Any select fill used under the building should have a liquid limit less than 40 and a plasticity index in between 5 and 20 and be crushed limestone. The fill should contain no particles greater than 3 inches in diameter. **The percent passing U.S. Standard Sieve No. 4 should be in between 40 and 80 percent and Sieve No. 40 passing should be in between 10 and 50 percent. The percent passing Sieve No. 200 should be less than 20 percent.**

Crushed limestone with sufficient fines to bind the aggregate together is a suitable select structural fill material. The fill materials should be placed in loose lifts not to exceed 8 inches thick (6-inches

compacted) and compacted to 95 percent of the maximum dry density as determined by ASTM D 1557 procedure at a moisture content within 2 percent of the optimum water content.

General Fill

General fill materials may consist of clean on-site material, select fill materials, or any clean imported fill material. The purpose of a general fill is to provide soils with good compaction characteristics that will provide uniform support for any non-habitable structures that are not movement sensitive. The general fill may also be used underneath the pavement areas. The pavement recommendations should be re-evaluated based on the fill material characteristics. The general fill material should be free of any deleterious material, construction debris, organic material, and should not have gravels larger than 6 inches in maximum dimension. The top two feet of fill material used underneath pavement areas should not have gravels larger than 3 inches in maximum dimension.

It should be understood that the use of the general fill may result in greater than anticipated potential vertical movements and differential movements. If the greater potential vertical movements or differential soil movements cannot be tolerated, then select fill material should be used and should conform to the Select Fill recommendations.

General Fill Compaction

The general fill materials should be placed in lifts not to exceed 8 inches thick and compacted to a minimum of 95 percent of the maximum dry density as determined by test method ASTM D 698 at a moisture content within 3 percent of the optimum water content. Each lift should be compacted and tested by a representative of a geotechnical laboratory to verify compaction compliance and approved before placement of the subsequent lifts.

The general fill compaction requirements can also be discussed and determined in consultation with the owner prior to construction.

Ground Water

In any areas where significant cuts (2-ft or more) are made to establish final grades for pavement, attention should be given to possible seasonal water seepage that could occur through natural cracks and fissures in the newly exposed stratigraphy. Subsurface drains may be required to intercept seasonal groundwater seepage. The need for these or other dewatering devices on

should be carefully addressed during construction. Our office could be contacted to visually inspect final pads to evaluate the need for such drains.

The ground water seepage may happen several years after construction if the rainfall rate or drainage changes within the project site or outside the project site. If seepage run off occurs towards the pavement areas an engineer should be called on to evaluate its effect and provision of French Drains at this location.

Drainage

Ground water seepage was not encountered in the borings at the time of drilling. However, minor ground water seepage may be encountered within the pavement areas and grading excavations at the time of construction, especially after periods of heavy precipitation. **Small quantities of seepage may be handled by conventional sump and pump methods of dewatering.**

Temporary Drainage Measures

Temporary drainage provisions should be established, as necessary, to minimize water runoff into the construction areas. If standing water does accumulate, it should be removed by pumping as soon as possible.

Adequate protection against sloughing of soils should be provided for workers and inspectors entering the excavations. This protection should meet O.S.H.A. and other applicable building codes.

Temporary Construction Slopes

Temporary slopes on the order of 1H to 1V may be provided for excavations through Strata I clays.

Fill slopes on the order of 1H to 1V may be used provided a) the fill materials are compacted as recommended and b) the slopes are temporary.

Fill slopes should be compacted. Compacting operations shall be continued until the slopes are stable but not too dense for planting on the slopes. Compaction of the slopes may be done in increments of 3 to 5-ft in fill height or the fill is brought to its total height for shallow fills.

Permanent Slopes

Maximum permanent slope of 1V to 3H is recommended in Stratum I clays. In areas where people walk on sloped areas, a slope of 1V to 5H is recommended.

Time of Construction

If the pavement is installed during or after an extended dry period, the subgrade may experience greater movement around the edges when the soil moisture content increases, such as due to rain or irrigation. Similarly, a pavement installed during or after a wet period may experience greater movement around the edges during the subsequent drying of the soils.

Control Testing and Field Observation

Subgrade preparation and base and asphalt placement should be monitored by the project geotechnical engineer or his representative of InTEC. As a guideline, at least one in-place density test should be **performed for every 100 lineal feet (or as per respective city and county requirements, whichever requires more frequent testing) of street of compacted surface lift.** However, a minimum of three density tests should be performed by InTEC on the subgrade or subsequent lifts of compaction. Any areas not meeting the required compaction should be re-compacted and retested until compliance is met.

DRAINAGE AND MAINTENANCE

Final drainage is very important for the performance of the proposed pavement. Landscaping, plumbing, and downspout drainage is also very important. It is vital that drainage be transported away from the pavement so that no water ponds around the pavement (such as behind the curbs) which can result in soil volume change under the pavement. Any leaks or drainage issues should be repaired as soon as possible in order to minimize the magnitude of moisture change under the pavement. Large trees and shrubs should not be planted in the immediate vicinity of the pavement, since root systems can cause a substantial reduction in soil volume in the vicinity of the trees during dry periods. Silt fences placed adjacent to the curb can potentially allow water to get into the pavement area.

Trench backfill for utilities should be properly placed and compacted as outlined in this report and in accordance with all applicable requirements such local City / County / SAWS Standards. Since granular bedding backfill is used for most utility lines, the backfilled trench should be prevented from becoming a conduit and allowing an access for surface or subsurface water to travel toward the new pavement. Concrete cut-off collars or clay plugs should be provided where utility lines cross curbs to prevent water traveling in the trench backfill and entering beneath the pavement. If concrete encasing is used around the sewer pipes, an alternate path for water to continue to drain should be installed.

In areas with sidewalks or other structures adjacent to the new pavement, a positive seal must be provided and maintained between the structures and the pavement or sidewalk to minimize seepage of water into the underlying supporting soils. **Post-construction movement of pavement and flat-work is not uncommon.** Maximum grades practical should be used for paving and flatwork to prevent areas where water can pond. In addition, allowances in final grades should take into consideration post construction movement of flatwork particularly if such movement would be critical. **Normal maintenance should include inspection of all joints in paving and sidewalks, etc. as well as re-sealing where necessary.**

Several factors relate to civil and architectural design and/or maintenance which can significantly affect future movements of the pavement systems:

1. Where positive surface drainage cannot be achieved by sloping away of the ground surface adjacent to the pavement, a drainage system should carry runoff water away from the completed pavement.

2. Planters located adjacent to the pavement should preferably be **self-contained**. Sprinkler mains should be located a minimum of five feet from the pavement.
3. Planter box structures placed adjacent to pavement should be provided with a means to assure concentrations of water are not available to the subsoils stratigraphy.
4. Large trees and shrubs should not be allowed closer to the pavement than a horizontal distance equal to roughly their mature height due to their significant moisture demand upon maturing.
5. Moisture conditions should be maintained “**constant**” **around the edge of the pavements**. Ponding of water in planters, in unpaved areas, and around joints in paving and sidewalks can cause movements beyond those predicted in this report and significantly reduce the subgrade support.

Adequate drainage should be provided to reduce seasonal variations in moisture content of soils around the pavement. The PVR values estimated and stated under Vertical Movements are based on provision and maintenance of positive drainage to divert water away from the pavement areas. If the drainage is not maintained, the wetted front may move below the assumed twelve feet depth, and resulting **PVR will be much greater than 2 to 3 times the stated values under Vertical Movements.** Utility line leaks may contribute water and cause similar movements to occur. In addition, if the soil is allowed to dry, the associated shrinkage can cause pavement cracks. Similarly, significant changes in moisture content of the underlying pavement layers, will impact the support characteristics of the subgrade.

Dry Periods

Close observations should be made around pavements during extreme dry periods to ensure that adequate watering is being provided to keep soil from separating or pulling back from the curb and to minimize the shrinkage related cracks.

LIMITATIONS

The analyses and recommendations submitted in this report are based upon the data obtained from **68 borings drilled at the site**. This report may not reflect the exact variations of the soil conditions across the site. Based on the noted topography within the site, cut and fill are anticipated. The pavement recommendations presented in the report should be reviewed and confirmed based on the proposed cut and fill and observation at the time of construction.

If deviations from the noted subsurface conditions are encountered during construction, they should be brought to the attention of the geotechnical engineer. The information contained in this report and on the boring logs is not intended to provide the contractor with all the information needed for proper selection of equipment, means and methods, or for cost and schedule estimation purposes. The use of information contained in the report for bidding purposes should be done at the contractor's option and risk.

Final plans for the proposed streets should be reviewed by the project geotechnical engineer so that he may determine if changes in the recommendations are required.

The project geotechnical engineer declares that the findings, recommendations or professional advice contained herein have been made and this report prepared in accordance with generally accepted professional engineering practice in the fields of geotechnical engineering and engineering geology. The recommendations presented in this report should be reevaluated by InTEC if cut and fill operations are performed, any changes are made to drainage conditions. No other warranties are implied or expressed.

This report has been prepared for the exclusive use of **D. R. Horton, Inc.** for pavement thickness evaluation for the **proposed new streets at 1,131.8 Acre Riverstone Tract in San Antonio, Texas.**


Illustration Section

Description	Plate No.
Vicinity Map	Plate 1A
Aerial Map	Plate 1B
Topographic Map	Plate 1C
Geologic Map	Plate 1D
Soil Map	Plate 1E
Approximate Boring Locations	Plate 1F
Boring Logs	Plates 2—69
Keys to Classifications and Symbols	Plate 70
Calculations	Plates 71—86
Information on Geotechnical Report	Appendix

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

InTEC Project Number:
S191159-P

Date:
08/19/2019

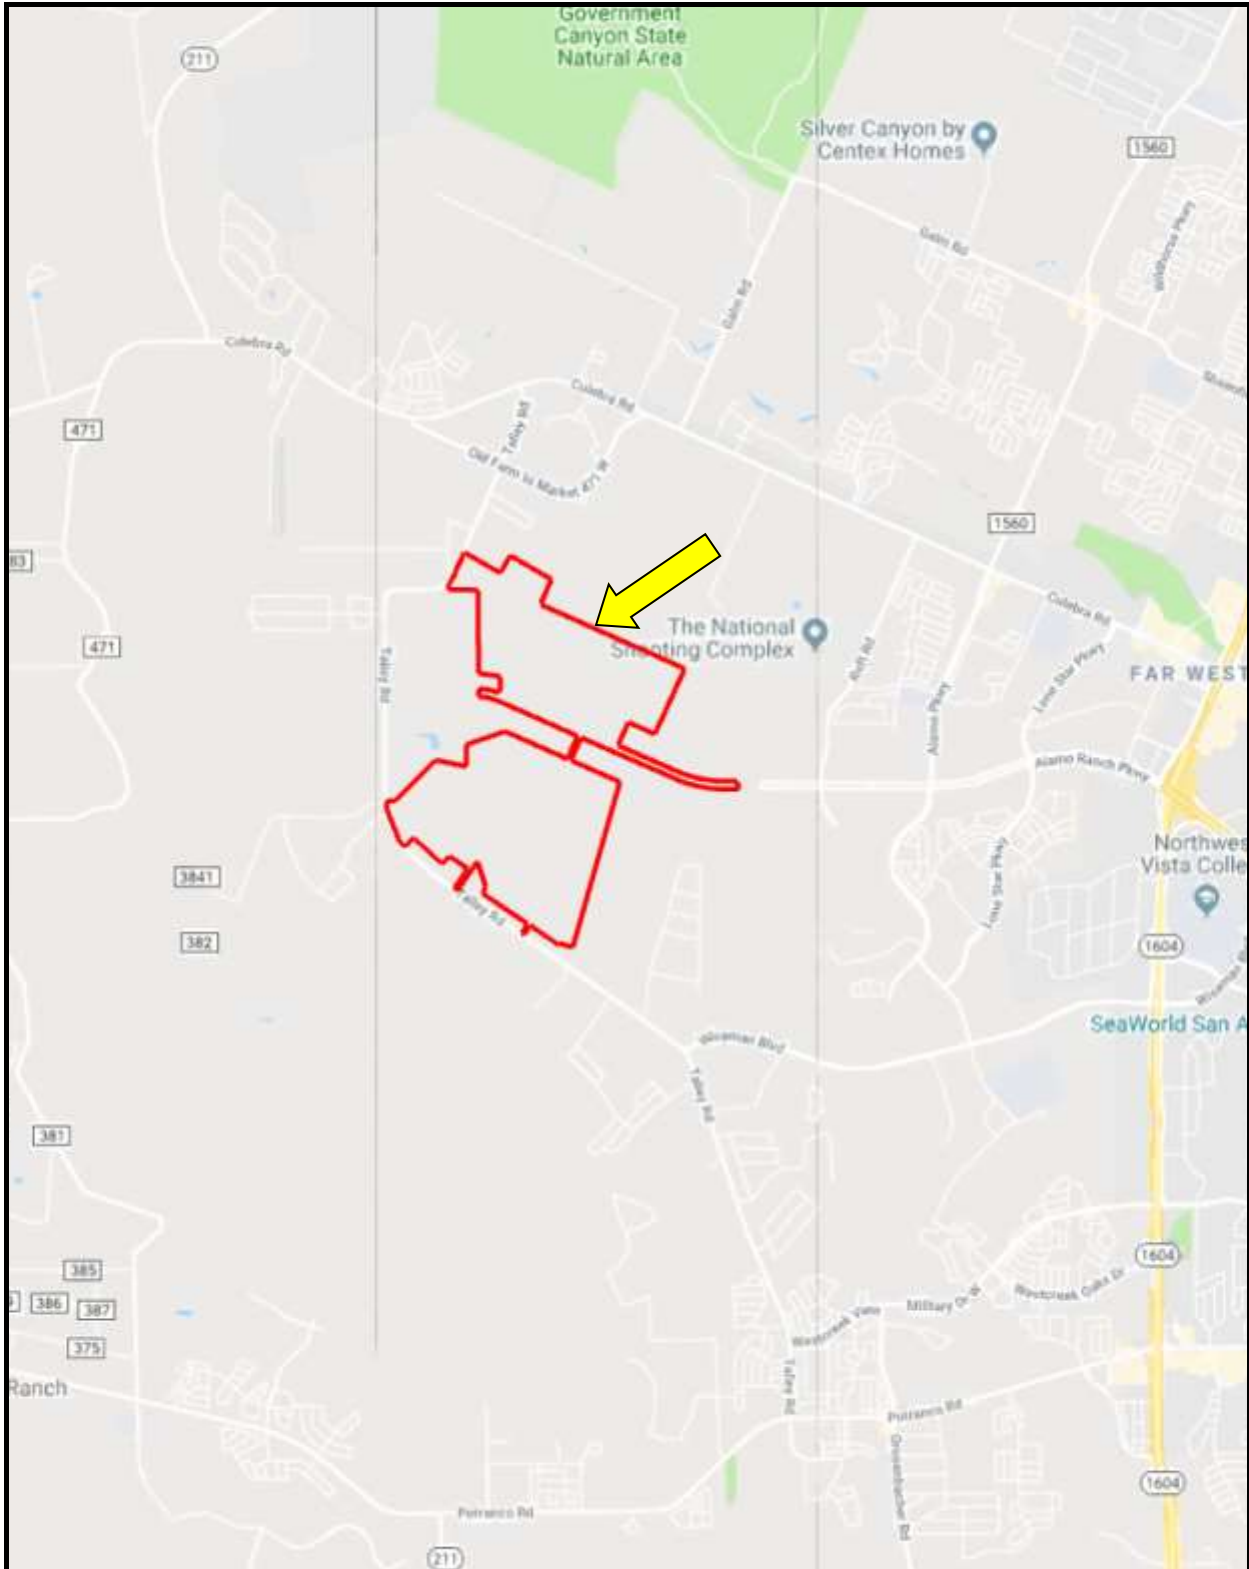

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Vicinity Map

InTEC Project Number:
S191159-P

Date:
08/19/2019




Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Aerial Map—Approximate Location

InTEC Project Number:
S191159-P

Date:
08/19/2019

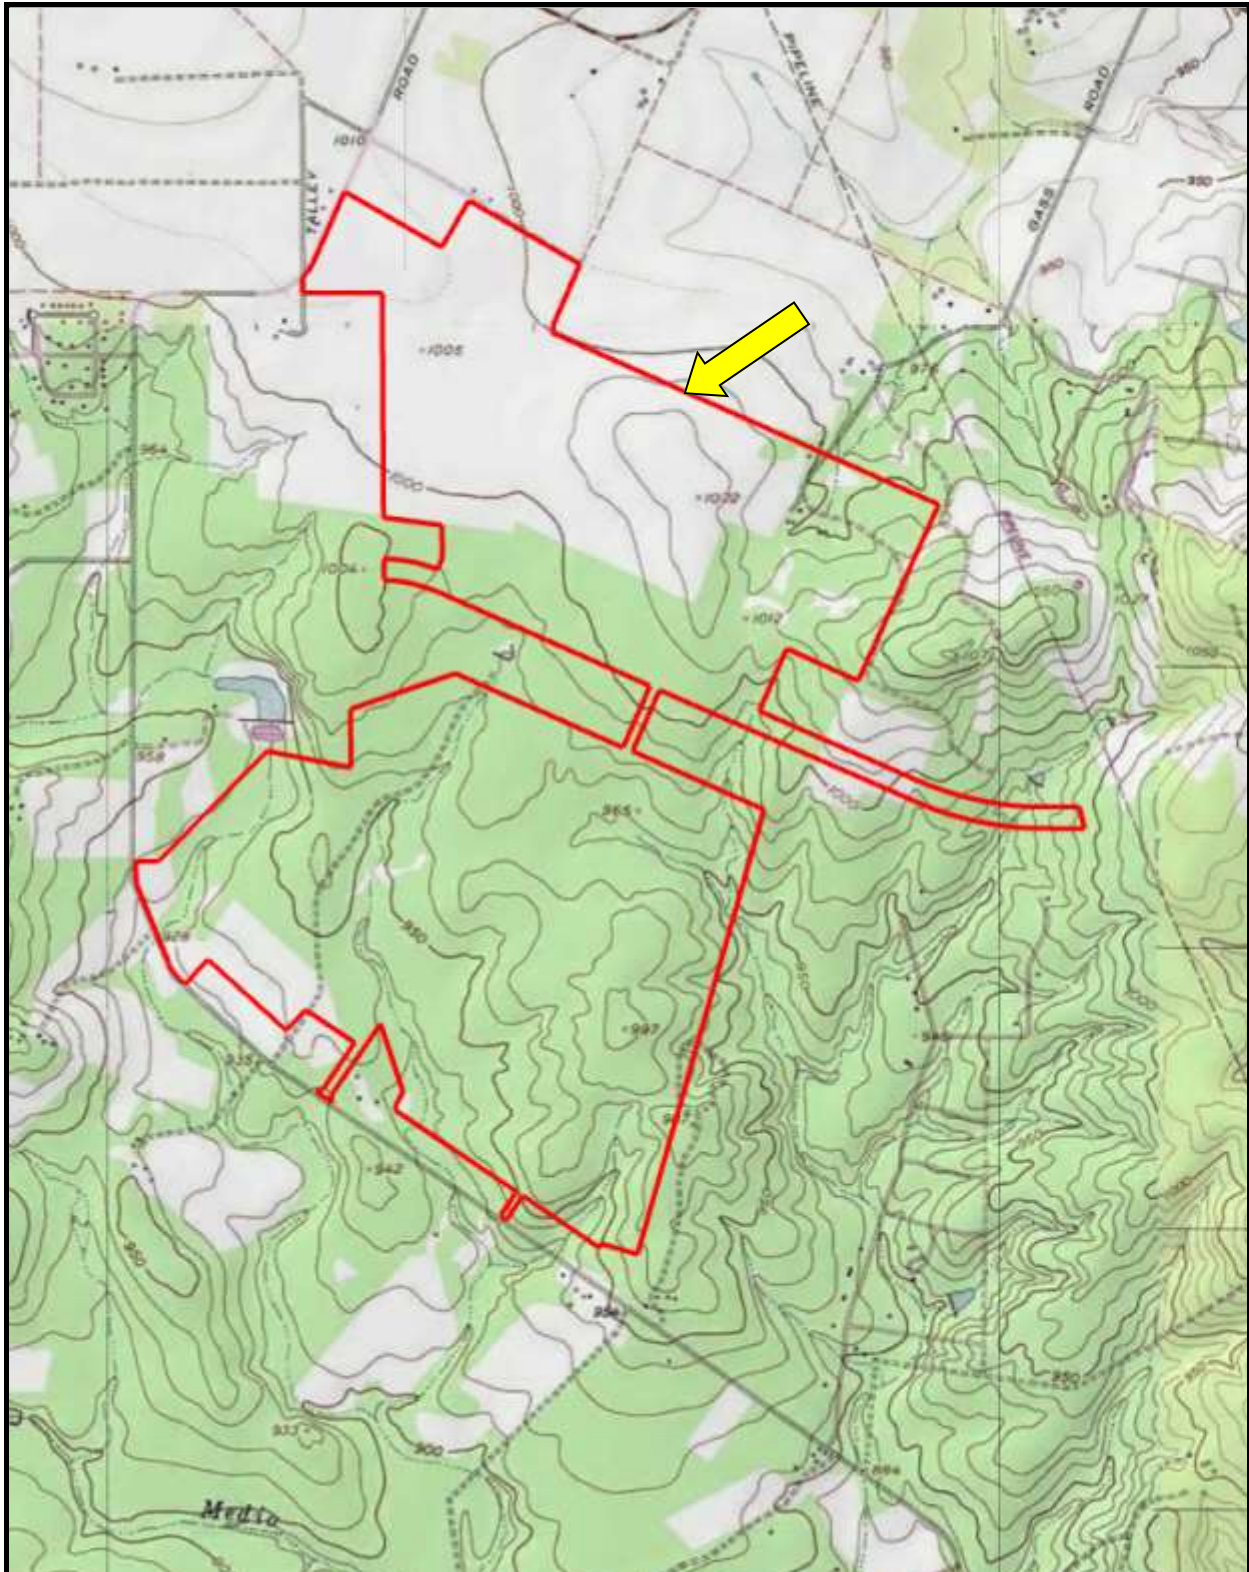


Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Topographic Map—Approximate Location

InTEC Project Number:
S191159-P

Date:
08/19/2019

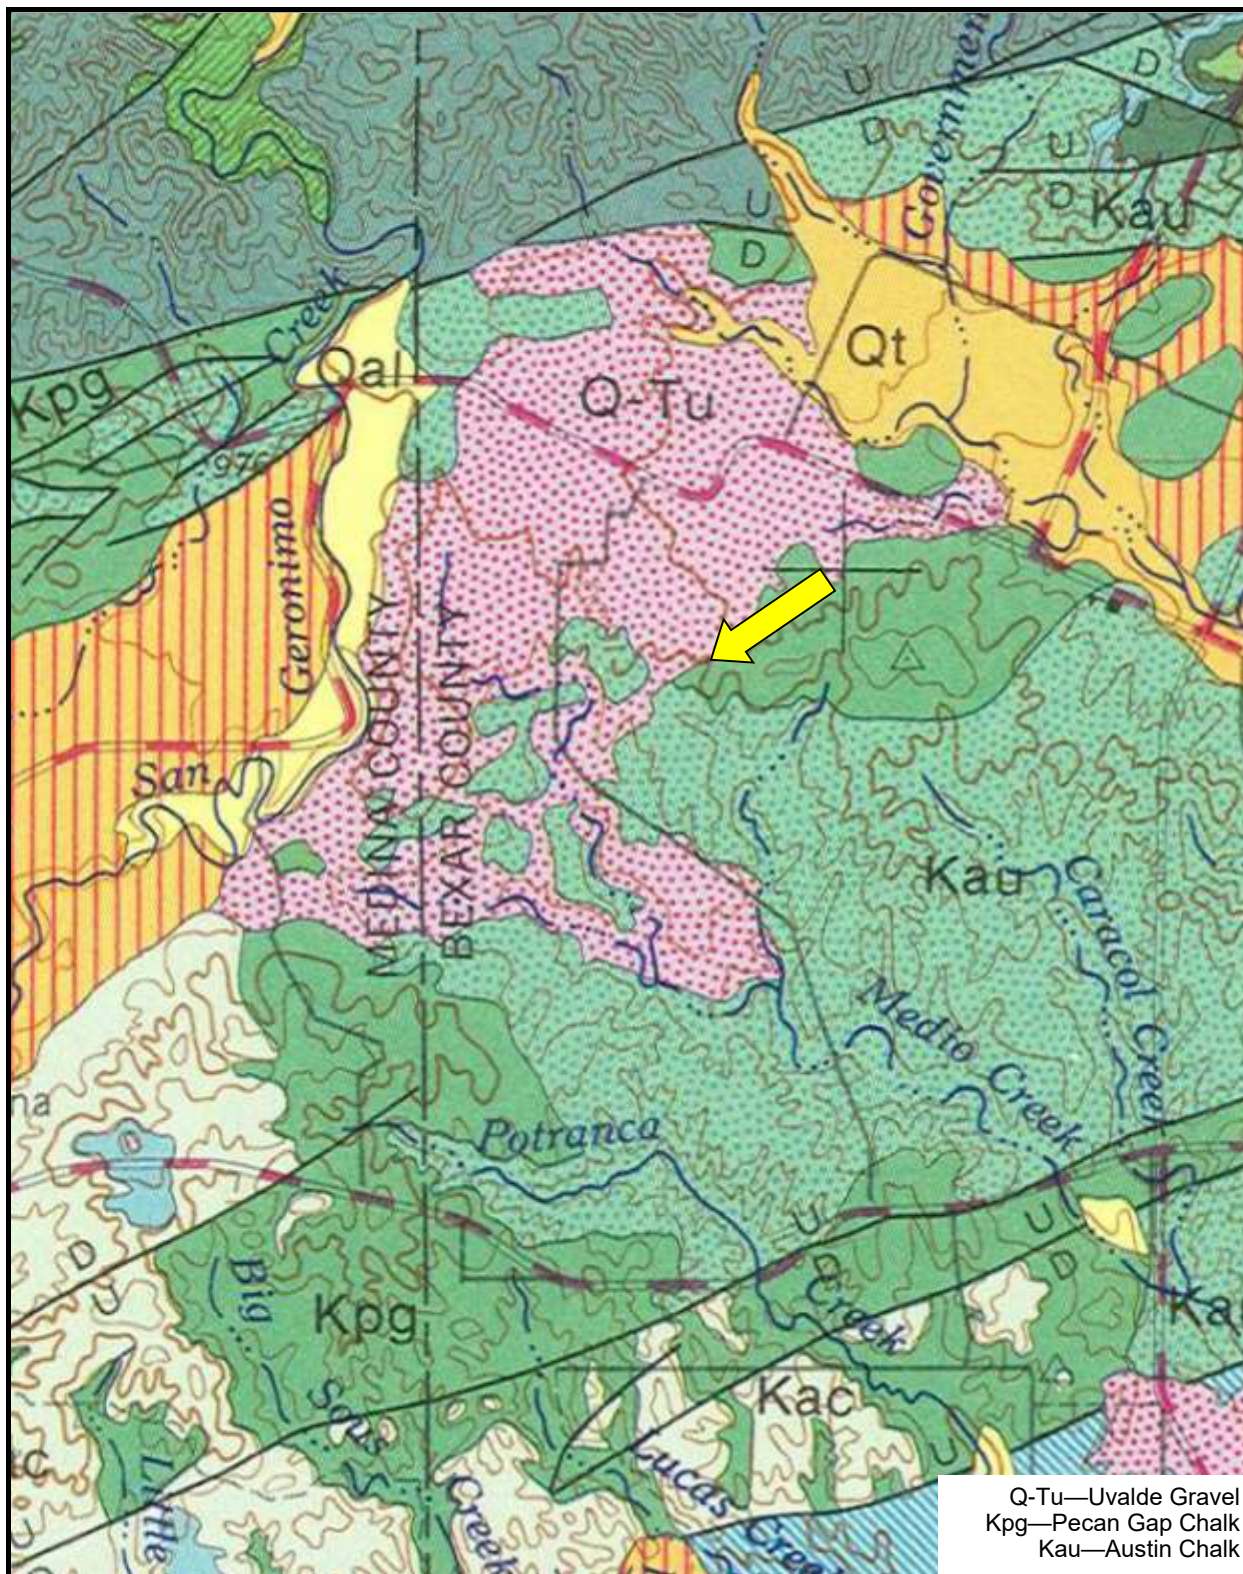


Q-Tu—Uvalde Gravel
Kpg—Pecan Gap Chalk
Kau—Austin Chalk

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas


Geologic Map—Approximate Location

InTEC Project Number:
S191159-P

Date:
08/19/2019

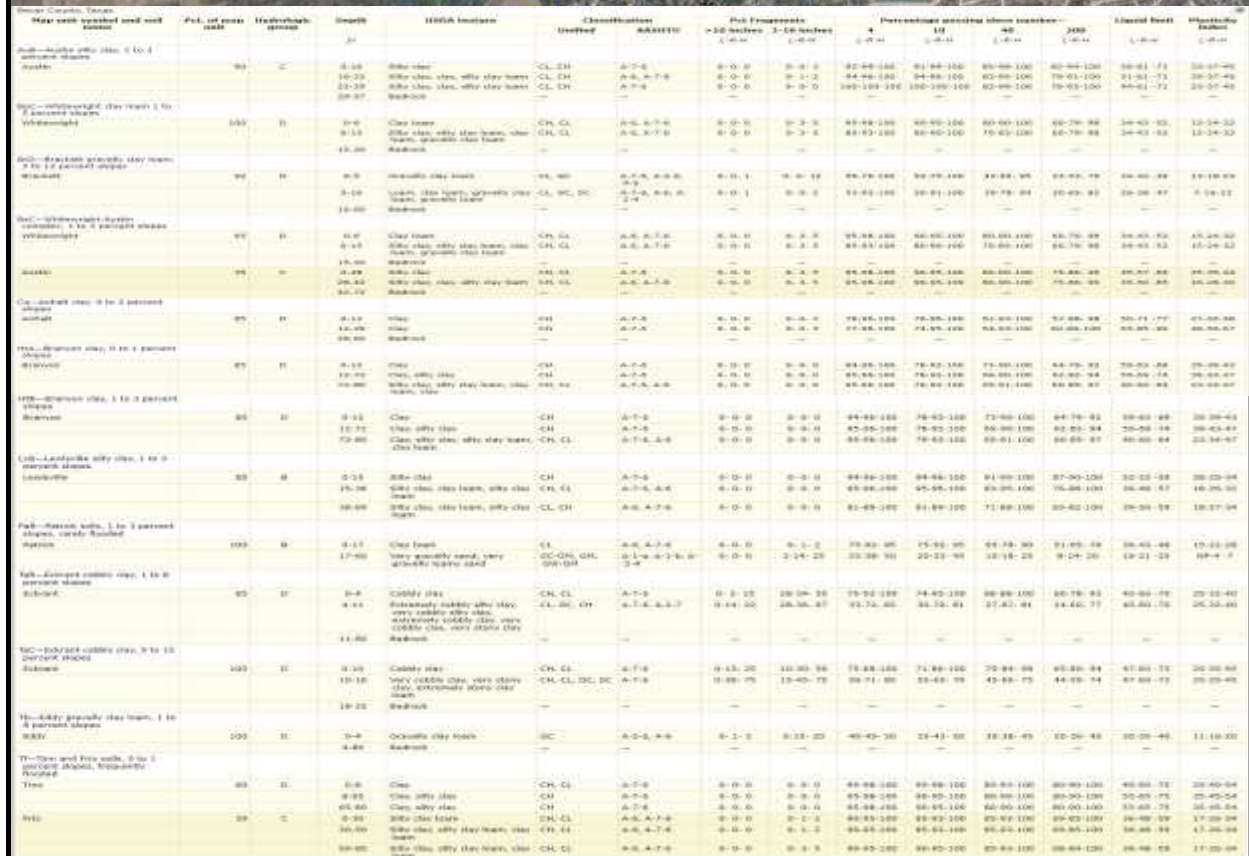

Date:
08/19/2019

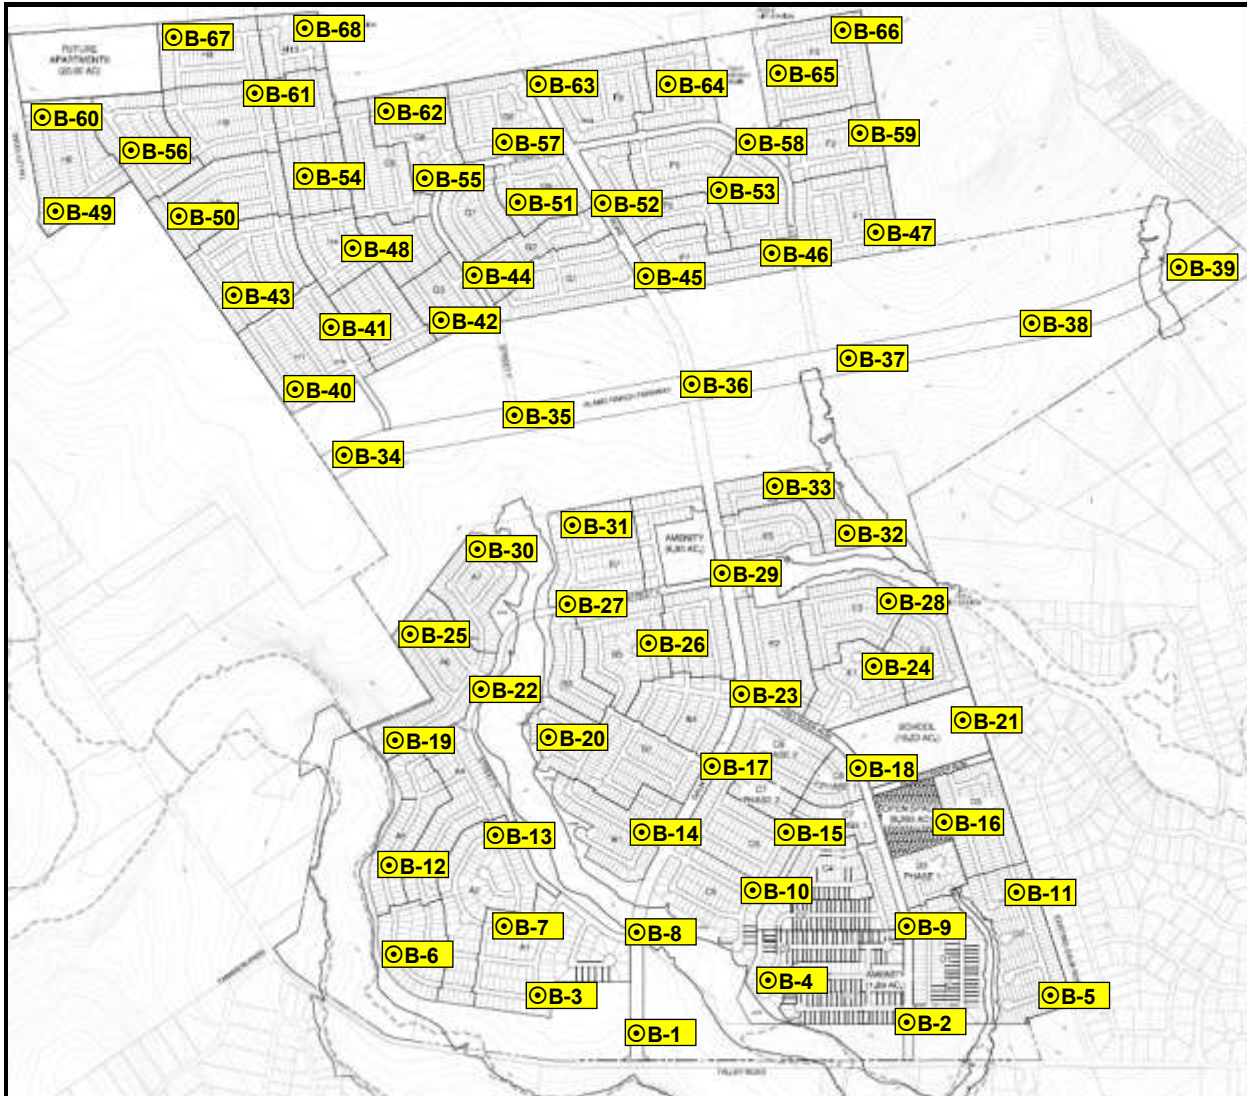

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Approximate Boring Locations

InTEC Project Number:
S191159-P

Date:
08/19/2019

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-1

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0														
		SS	Very Stiff Dark Brown Clay				16		74	49	•			
		SS	Hard Light Tan Marl to Limestone -with Caliche and Tan Calcareous Clay Seams -Slightly Bentonitic				65				•			
5		SS					50/6"		41	21	•			
10		AU									•			
15		SS					50/5"				•			
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 2

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-2

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Gravel				27							
		SS	Hard Light Tan Marl to Limestone -with Caliche and Tan Calcareous Clay Seams				76		23	08				
5		AU												
		SS					50/5"							
10														
		SS					50/4"							
15														
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 3

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-3

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Brown Clay -with Gravel				26				
		AU							92	70	
5		SS	Hard Tan Gravelly Clay -with Limestone Seams and Layers				50/8"				
		AU									
10											
		SS					50/6"				
15											
20											
25											
30											
35											

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 4

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-4

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Dark Brown Clay				19							
		AU	Hard Light Tan Marl to Limestone -with Caliche and Tan Calcareous Clay Seams -Slightly Bentonitic						24	09				
5		SS					50/4"							
10		AU												
15		SS					50/3"							
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 5

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-5

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> Moisture Content % - •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Gravel				21							
		SS	Hard Tan Calcareous Clay to Light Tan Marl -with Caliche and Limestone Seams -Slightly Bentonitic				29							
5		SS					58		26	11				
10		SS					50/5"							
			Auger Refusal											
15														
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 11**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample




Plate: 6

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-04-2019



BORING NO. B-6

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit — Liquid Limit Moisture Content % - • 20 40 60 80	
0												
		SS	Very Stiff Brown Clay -with Gravel				23		82	63		
		SS	Hard Light Tan Gravelly Clay				50/8"					
5		AU										
		AU	Hard Light Tan Marl to Limestone -with Caliche									
10												
		SS					50/5"					
15												
20												
25												
30												
35												

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 7

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-04-2019



BORING NO. B-7

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Gravel				26		76	53				
		AU	Hard Light Tan Gravelly Clay											
5		SS					50/6"							
		AU	Hard Light Tan Marl to Limestone -with Caliche											
10														
		SS					50/5"							
15														
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 8

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-04-2019



BORING NO. B-8

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Brown Clay -with Gravel				24				
		AU	Hard Light Tan Gravelly Clay						68	51	
5		SS					50/6"				
10		SS	Hard Light Tan Marl to Limestone -with Caliche				50/5"				
15		SS					50/4"				
20											
25											
30											
35											

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 9

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-04-2019



BORING NO. B-9

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Moisture Content % -	Liquid Limit Moisture Content % -
0			Very Stiff Brown Clay				18				20	40
		SS	Hard Light Tan Calcareous Clay to Light Tan Marl -with Tan Clay Seam and Caliche				26		24	10		
5		SS					42					
10		SS					50/6"					
15			Auger Refusal									
20												
25												
30												
35												

Notes: Ground Water Observed: No Completion Depth (ft): 12

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 10

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-04-2019



BORING NO. B-10

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Brown Clay -with Gravel				29				
		AU	Hard Light Tan Gravelly Clay						68	52	
5		SS					65				
10		SS	Hard Light Tan Marl to Limestone -with Caliche				50/5"				
15		SS					50/4"				
20											
25											
30											
35											

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 11

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-04-2019



BORING NO. B-11

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Gravel				19				•			
		SS	Hard Light Tan Calcareous Clay to Light Tan Marl -with Caliche and Limestone Seams				33				•			
5		AU									•			
		SS					45				•			
10														
		SS	-Moist from 13 to 15-ft				31		21	06	•			
15														
20														
25														
30														
35														

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 12

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-12

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Gravel				29							
		SS	Hard Light Tan Marl to Limestone -with Caliche				50/6"							
5		AU												
		SS					50/3"							
10														
		SS					50/3"							
15														
		SS												
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample


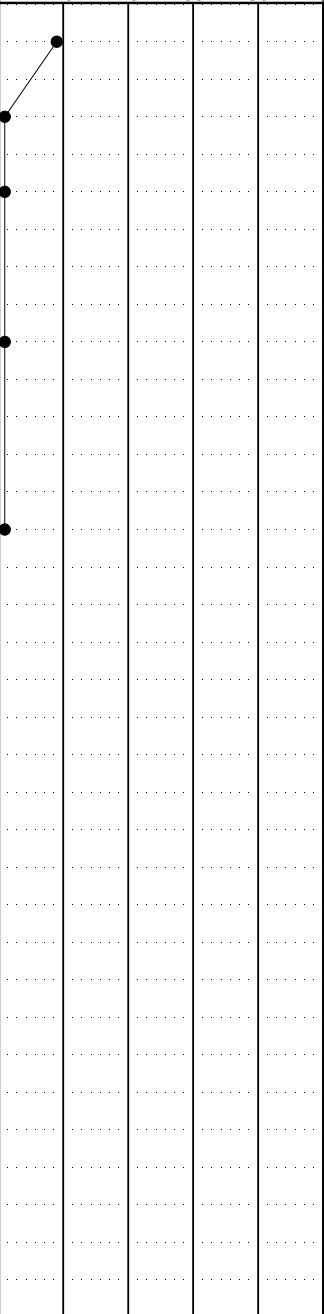



Plate: 13

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-04-2019



BORING NO. B-13

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<div>Plastic Limit Liquid Limit</div> <div>Moisture Content % - •</div> <div>20 40 60 80</div>				
0															
		SS	Very Stiff Brown Clay -with Gravel				22								
		SS	Hard Light Tan Marl to Limestone -with Caliche				50/5"								
5		AU													
		SS					50/4"								
10															
		SS					50/3"								
15															
20															
25															
30															
35															

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 14

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-04-2019



BORING NO. B-14

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay				23							
		AU	Hard Light Tan Marl to Limestone -with Caliche and Tan Calcareous Clay Seams						60	44				
5		SS					50/6"							
10		AU												
15		SS					50/5"							
20														
25														
30														
35														

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 15

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-15

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit — Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Brown Clay -with Gravel				26				•
		SS	Hard Light Tan to White Limestone -with Caliche				50/4"				•
5		AU									•
		AU									•
10											
		SS					50/3"				•
15											
20											
25											
30											
35											

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 16

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-04-2019



BORING NO. B-16

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Gravel				24							
		SS	Hard Light Tan Marl to Limestone -with Caliche and Tan Calcareous Clay Seams				50/5"		22	08				
5		AU												
		SS					50/4"							
10														
			Auger Refusal											
15														
20														
25														
30														
35														

Notes: Ground Water Observed: No Completion Depth (ft): 12

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 17

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-17

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Brown Clay -with Gravel				18				
		AU	Hard Light Tan Marl to Limestone -with Caliche						68	52	
5		SS					50/7"				
10		AU									
15		SS					50/3"				
20											
25											
30											
35											

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 18

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-18

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Gravel				21							
		SS	Hard Light Tan Marl to Limestone -with Caliche				50/6"							
5		AU							24	10				
		SS					50/3"							
10			Auger Refusal											
15														
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 11**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 19

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-19

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Gravel				26							
		SS	Hard Light Tan Marl to Limestone -with Caliche				50/5"							
5		AU												
		AU												
10			-with Tan Clay Seams from 8 to 10-ft						30	18				
15		SS					50/4"							
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 20

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-20

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Gravel				21				•			
		SS	Hard Light Tan Marl to Limestone -with Caliche and Tan Calcareous Clay Seams				50/5"		28	16	•	—	—	
5		AU									•			
		SS					50/4"				•			
10														
		SS					50/3"				•			
15														
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 21

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-21

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Gravel				19							
		SS	Hard Light Tan Marl to Limestone -with Caliche and Tan Calcareous Clay Seams				50/6"							
5		AU												
		SS					50/5"							
10														
			Auger Refusal											
15														
20														
25														
30														
35														

Notes: Ground Water Observed: No Completion Depth (ft): 11

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 22

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-22

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Gravel				18							
		AU	Hard Light Tan Marl to Limestone -with Caliche and Tan Calcareous Clay Seams						26	13				
5		SS					50/4"							
10		AU												
15		SS					50/3"							
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 23

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-23

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Gravel				23							
		AU	Hard Light Tan Marl to Limestone -with Caliche and Tan Calcareous Clay Seams						24	11				
5		SS					50/6"							
10		SS					50/3"							
			Auger Refusal											
15														
20														
25														
30														
35														

Notes: Ground Water Observed: No Completion Depth (ft): 12

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample




Plate: 24

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-24

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<div>Plastic Limit — Liquid Limit</div> <div>Moisture Content % - •</div> <div>20406080</div>				
0															
		SS	Very Stiff Brown Clay -with Gravel				24								
		SS	Hard Light Tan Marl to Limestone -with Caliche and Tan Calcareous Clay Seams				50/5"								
5		AU													
		SS					50/4"								
10															
			Auger Refusal												
15															
20															
25															
30															
35															

Notes: **Ground Water Observed: No** **Completion Depth (ft): 12**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 25

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-25

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Gravel				23				•			
		SS	Hard Light Tan Marl to Limestone -with Caliche and Tan Calcareous Clay Seams				50/4"				•			
5		AU									•			
10		SS					50/3"				•			
15		SS					50/3"				•			
			Auger Refusal											
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 26

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-23-2019



BORING NO. B-26

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Moisture Content % -	Liquid Limit Moisture Content % -
0											20	40
		SS	Very Stiff Dark Brown Clay				18					
		SS	Hard Light Tan Marl to Limestone -with Caliche and Tan Gravelly Clay Seams				65					
5		AU										
10		AU										
15		SS					50/4"					
20												
25												
30												
35												

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 27

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-23-2019



BORING NO. B-27

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit — Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Dark Brown Clay				50/4"				
		AU	Hard Light Tan Marl to Limestone -with Caliche and Tan Gravelly Clay Seams								
5		SS					50/5"				
10		AU									
15		SS	Very Stiff Tan Clay -with Some Gravel				21		49	35	
20											
25											
30											
35											

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 28

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-04-2019



BORING NO. B-28

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Hard Brown Clay -with Gravel				39							
		AU	Hard Light Tan Limestone											
		AU	-with Tan Clay Seams from 4 to 6-ft											
5									27	14				
			Auger Refusal											
10														
15														
20														
25														
30														
35														

Notes: Ground Water Observed: No Completion Depth (ft): 8

S.S by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 29

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-23-2019



BORING NO. B-29

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Brown Clay				19				
		SS					21		90	64	
5		SS	Hard Light Tan Marl to Limestone -with Caliche and Tan Gravelly Clay Seams				65				
10		AU									
15		SS					50/3"				
20											
25											
30											
35											

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 30

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-02-2019



BORING NO. B-30

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit — Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Hard Brown Clay -with Gravel and Limestone				38				•
		SS	Hard Light Tan to White Limestone -with Caliche				50/4"				•
5		AU									•
		AU									•
10											
		SS					50/3"				•
15											
20											
25											
30											
35											

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 31

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-23-2019



BORING NO. B-31

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay				21							
		SS	Hard Light Tan Marl to Limestone -with Caliche and Tan Gravelly Clay Seams				76							
5		AU							21	08				
		SS					65							
10														
		AU												
15														
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 32

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-23-2019



BORING NO. B-32

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content %</i> - •			
0											20	40	60	80
		SS	Very Stiff Brown Clay				21							
		SS	Hard Light Tan Marl to Limestone -with Caliche and Tan Gravelly Clay Seams				65							
5		SS					84							
10			Auger Refusal											
15														
20														
25														
30														
35														

Notes: Ground Water Observed: No Completion Depth (ft): 9

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 33

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-23-2019



BORING NO. B-33

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Brown Clay				17				
		AU							71	49	
5		SS	Hard Light Tan Marl to Limestone -with Caliche and Tan Gravelly Clay Seams				50/4"				
		AU									
10											
		SS					50/3"				
15											
20											
25											
30											
35											

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 34

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-04-2019



BORING NO. B-34

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Moisture Content % -	Liquid Limit Moisture Content % -
0												
		SS	Hard Brown Clay -with Gravel				37		92	68		
		AU	Hard Light Tan to White Limestone -with Caliche									
5		SS					50/4"					
10		AU										
15		SS					50/3"					
20												
25												
30												
35												

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 35

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-04-2019



BORING NO. B-35

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0														
		SS	Hard Brown Clay -with Gravel				35		49	34				
		AU												
5		AU	Hard Light Tan to White Limestone -with Caliche				50/4"							
10		SS												
15		SS					50/4"							
20														
25														
30														
35														

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 36

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-23-2019



BORING NO. B-36

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay				17							
		AU	Hard Light Tan Marl to Limestone -with Caliche and Tan Gravelly Clay Seams						31	14				
5		SS					65							
		SS					86							
10														
		SS	Very Stiff Tan Clay -with Caliche				21							
15														
20														
25														
30														
35														

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 37

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-04-2019



BORING NO. B-37

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content %</i> - •			
0											20	40	60	80
		SS	Very Stiff Brown Clay				19							
		SS	Hard Light Tan Marl to Limestone				35							
		SS	-with Tan Clay Seams from 4 to 6-ft				39		36	18				
5		SS												
			-Tan Clay Seams to 8 to 10-ft											
10		AU												
			-with Tan Clay Below 13-ft				29							
15		SS												
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 38

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-04-2019



BORING NO. B-38

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay				19							
		AU	Very Stiff to Hard Light Tan Calcareous Clay to Light Tan Marl -with Caliche and Limestone Seams											
5		SS					65							
10		SS					39							
15		SS					36		36	22				
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 39

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 11-04-2019



BORING NO. B-39

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Dark Brown Clay				19				
		AU							61	45	
5		SS					65				
			Hard Light Tan Marl to Limestone -with Caliche and Tan Calcareous Clay Seams								
10		SS					39				
15		SS					36		36	22	
20											
25											
30											
35											

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 40

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-14-2019



BORING NO. B-40

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Dark Brown Clay				16		97	73	•
		SS	-with Gravel Below 3-ft				19				•
5		SS	Very Stiff to Hard Tan Gravelly Clay -with Caliche, Tan Clay Seams and Limestone Seams and Layers				65				•
10		AU									•
15		SS					86				•
20											
25											
30											
35											

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 41

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-13-2019



BORING NO. B-41

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Dark Brown Clay				17				
		SS					21		96	74	
5		SS	Very Stiff to Hard Tan Gravelly Clay -with Caliche, Tan Clay Seams and Limestone Seams and Layers				58				
10		AU									
15		SS					49				
20											
25											
30											
35											

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 42

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-14-2019



BORING NO. B-42

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Dark Brown Clay				18				
		SS	-with Gravel Below 3-ft				29				
5		SS	Very Stiff to Hard Tan Gravelly Clay -with Caliche, Tan Clay Seams and Limestone Seams and Layers				35		79	33	
10		AU									
15		SS					46				
20											
25											
30											
35											

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 43

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-13-2019



BORING NO. B-43

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Dark Brown Clay				16				
		SS	-with Gravel Below 3-ft				18				
5		SS	Very Stiff to Hard Tan Gravelly Clay -with Caliche, Tan Clay Seams and Limestone Seams and Layers				50/5"				
		AU							41	25	
10											
		SS					69				
15											
20											
25											
30											
35											

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 44

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-22-2019



BORING NO. B-44

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Dark Brown Clay -with a Trace of Gravel				20				
		SS					30		92	70	
5		SS	Very Stiff to Hard Tan Clay to Tan Gravelly Clay -with Caliche				41				
		AU									
10											
		SS					30				
15											
20											
25											
30											
35											

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 45

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-22-2019



BORING NO. B-45

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit — Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Brown Clay				16				
		SS	Hard Light Tan Clay to Tan Calcareous Clay -with Tan Gravelly Clay and Limestone Seams and Caliche				33				
5		AU							61	44	
		AU									
10											
		SS					50/5"				
15											
20											
25											
30											
35											

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 46

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-22-2019



BORING NO. B-46

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Moisture Content % -	Liquid Limit Moisture Content % -
0											20	40
		SS	Very Stiff Brown Clay				18					
		AU	Hard Light Tan Clay to Tan Calcareous Clay -with Tan Gravelly Clay and Limestone Seams and Caliche									
5		SS					35					
10		AU										
15		SS					66					
20												
25												
30												
35												

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 47

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-22-2019



BORING NO. B-47

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay				19							
		AU	Hard Light Tan Clay to Tan Calcareous Clay -with Tan Gravelly Clay and Limestone Seams and Caliche											
5		SS					35							
10		AU							25	12				
15		SS					62							
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 48

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-13-2019



BORING NO. B-48

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Brown Clay				18				
		SS					21		95	71	
5		SS	Hard Light Tan Clay to Tan Calcareous Clay -with Tan Gravelly Clay and Limestone Seams and Caliche				65				
10		AU									
15		SS					39				
20											
25											
30											
35											

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 49

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-13-2019



BORING NO. B-49

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Dark Brown Clay				16				•			
		SS					18				•			
5		SS	Hard Tan Clay -with Gravel and Limestone Seams				65				•			
			Auger Refusal											
10														
15														
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 8**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 50

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-13-2019



BORING NO. B-50

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<div>Plastic Limit Liquid Limit</div> <div>Moisture Content % - •</div> <div>20 40 60 80</div>				
0															
		SS	Very Stiff Dark Brown Clay				15								
		SS					17								
5		SS	Hard Tan Clay -with Gravel and Limestone Seams				66								
			Auger Refusal												
10															
15															
20															
25															
30															
35															

Notes: Ground Water Observed: 8-ft Completion Depth (ft): 8

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 51

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-23-2019



BORING NO. B-51

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Moisture Content % -	Liquid Limit Moisture Content % -
0											20	40
		SS	Very Stiff Brown Clay				16					
		SS					18		76	59		
5		AU	Hard Light Tan Marl to Limestone -with Caliche and limestone Seams									
		AU										
10		AU										
		AU					62					
15												
20												
25												
30												
35												

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 52

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-23-2019



BORING NO. B-52

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> ——— <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay				15		87	67	•			
		SS	Dense Gravel -with Chert				46				•			
5		SS	Hard Light Tan Marl to Limestone -with Caliche and Tan Calcareous Clay Seams				65				•			
10		AU									•			
15		SS					58				•			
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 53

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-22-2019



BORING NO. B-53

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Some Gravel				18							
		SS	Very Stiff To Hard Tan Gravelly Clay -with Caliche, Tan Marl and Limestone Seams				65							
5		AU												
10		SS					92							
15		SS					50/8"							
20														
25														
30														
35														

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 54

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-14-2019



BORING NO. B-54

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Some Gravel				18							
		AU												
5		SS	Very Stiff To Hard Tan Gravelly Clay -with Caliche, Tan Marl and Limestone Seams				21		41	25				
		AU												
10														
15		SS					35							
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 55

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-14-2019



BORING NO. B-55

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay				16							
		SS	Very Stiff Tan Clay				21		68	50				
5		AU												
10		SS					23							
15		AU												
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 56

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-13-2019



BORING NO. B-56

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Brown Clay				17				
		AU									
5		SS					19				
			Very Stiff Tan Clay								
10		SS					21		54	38	
15		SS					23				
20											
25											
30											
35											

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 57

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-14-2019



BORING NO. B-57

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Moisture Content % -	Liquid Limit Moisture Content % -
0											20	40
		SS	Very Stiff Dark Brown Clay				16					
		SS					19					
5		SS	Very Stiff Tan Clay				18		64	46		
		AU										
10												
		SS					21					
15												
20												
25												
30												
35												

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 58

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-22-2019



BORING NO. B-58

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Brown Clay -with Gravel				18							
		AU	Hard Light Tan Calcareous Clay to Light Tan Marl -with Caliche and Limestone Seams						29	14				
5		SS					65							
10		AU												
15		SS					50/5"							
20														
25														
30														
35														

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample



Plate: 59

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-22-2019



BORING NO. B-59

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<div>Plastic Limit Liquid Limit</div> <div>Moisture Content % - •</div> <div>20 40 60 80</div>				
0															
		SS	Very Stiff Brown Clay -with Gravel				19		47	30	<div><div></div><div></div></div>				
		AU	Hard Light Tan Calcareous Clay to Light Tan Marl -with Caliche and Limestone Seams												
5		SS										66			
10		SS										50/4"			
15		SS					50/3"				<div><div></div><div></div></div>				
20															
25															
30															
35															

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 60

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-13-2019



BORING NO. B-60

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Moisture Content % -	Liquid Limit Moisture Content % -
0											20	40
		SS	Very Stiff Dark Brown Clay				21					
		AU							88	67		
5		SS	Very Stiff to Hard Brown Gravelly Clay				39					
			Auger Refusal									
10												
15												
20												
25												
30												
35												

Notes: **Ground Water Observed: No** **Completion Depth (ft): 8**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 61

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-13-2019



BORING NO. B-61

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit ——— Liquid Limit Moisture Content % - •
0											20 40 60 80
		SS	Very Stiff Dark Brown Clay				17				
		AU									
5		SS					19		93	74	
			Very Stiff to Hard Tan Clay								
10		AU									
15		SS					33				
20											
25											
30											
35											

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 62

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-14-2019



BORING NO. B-62

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<div>Plastic Limit — Liquid Limit</div> <div>Moisture Content % - •</div> <div>20406080</div>						
0																	
		SS	Very Stiff Dark Brown Clay				17										
		AU	Very Stiff Tan Clay														
5		SS					21										
10		AU															
15		SS					29										
20																	
25																	
30																	
35																	

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 63

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-14-2019



BORING NO. B-63

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<div>Plastic Limit Liquid Limit</div> <div>Moisture Content % - •</div> <div>20406080</div>					
0																
		SS	Very Stiff Dark Brown Clay				19									
		SS	Very Stiff Tan Clay				23									
5		SS					21									
10		SS					19									
15		SS					23									
20																
25																
30																
35																

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 64

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-13-2019



BORING NO. B-64

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Moisture Content % -	Liquid Limit Moisture Content % -
0											20	40
		SS	Very Stiff Dark Brown Clay				18					
		SS	Hard Light Tan Marl to Limestone -with Caliche and Tan Calcareous Clay Seams				50/4"					
5		SS					50/3"					
			Auger Refusal									
10												
15												
20												
25												
30												
35												

Notes: Ground Water Observed: No Completion Depth (ft): 8

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample





Plate: 65

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-23-2019



BORING NO. B-65

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<div>Plastic Limit —— Liquid Limit</div> <div>Moisture Content % - ●</div> <div>20 40 60 80</div>	
0												
		SS	Very Stiff Dark Brown Clay				18					
		AU	Very Stiff to Hard Light Tan Gravelly Clay to Light Tan Limestone -with Caliche									
5		SS					45					
		SS	Very Stiff Tan Clay -with Caliche				21		72	53		
10												
		SS					29					
15												
20												
25												
30												
35												

Notes: Ground Water Observed: No Completion Depth (ft): 15

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 66

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-23-2019



BORING NO. B-66

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<i>Plastic Limit</i> <i>Liquid Limit</i> <i>Moisture Content % -</i> •			
0											20	40	60	80
		SS	Very Stiff Dark Brown Clay -with Gravel				18				•			
		SS	Very Stiff to Hard Light Tan Gravelly Clay to Light Tan Limestone -with Caliche				46				•			
5		SS	Very Stiff Tan Clay -with Caliche				20		23	09	•			
		SS					23				•			
10														
15														
20														
25														
30														
35														

Notes: **Ground Water Observed: No** **Completion Depth (ft): 12**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 67

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-13-2019



BORING NO. B-67

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	Plastic Limit Moisture Content % -	Liquid Limit Moisture Content % -
0											20	40
		SS	Very Stiff Dark Brown Clay				16					
		SS					18		99	75		
5		AU	Very Stiff Tan Clay									
		SS					19					
10												
		SS					26					
15												
20												
25												
30												
35												

Notes: **Ground Water Observed: No** **Completion Depth (ft): 15**

S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample


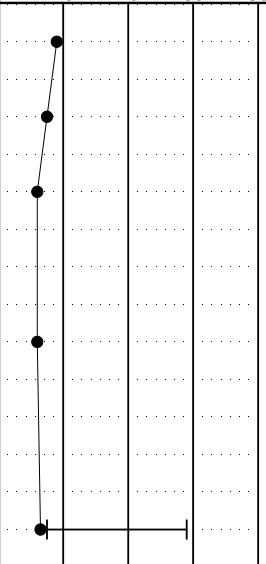
Plate: 68

PROJECT: 1,131.8 Are Riverstone Tract
LOCATION: San Antonio, Texas
CLIENT: DR Horton

PROJECT NO: S191159
DATE: 10-13-2019



BORING NO. B-68

DEPTH (feet)	SYMBOL	SAMPLES	SOIL DESCRIPTION	% MINUS 200 SIEVE	UNIT DRY WT IN PCF	S.S. BY P.P	BLOWS PER FOOT	SHEAR STRENGTH TSF	LIQUID LIMIT	PLASTICITY INDEX	<div>Plastic Limit — Liquid Limit</div> <div>Moisture Content % - •</div> <div>20406080</div>					
0																
		SS	Very Stiff Dark Brown Clay				15									
		SS	Very Stiff Tan Clay				21									
5		AU														
		SS					26									
10																
15		SS					24		58	43						
20																
25																
30																
35																

Notes: Ground Water Observed: No Completion Depth (ft): 15










S.S. by P.P - Shear Strength in TSF
by Hand Penetrometer

S.S. - Split Spoon Sample
S.T. - Shelby Tube Sample

HA - Hand Auger
AU - Auger Sample

Plate: 69

KEY TO CLASSIFICATIONS AND SYMBOLS

<u>Soil Fractions</u>		<u>Soil or Rock Types</u> (Shown in symbols column) (Predominate Soil Types Shown Heavy)		
<u>Component</u>	<u>Size Range</u>			
Boulders	Greater than 12"			
Cobbles	3" - 12"			
Gravel	3" - #4 (4.76mm)			
Coarse	3" - 3/4"			
Fine	3/4" - #4			
Sand	#4 - #200 (0.074mm)			
Coarse	#4 - #10 (2.00mm)			
Medium	#10 - #40 (0.42mm)			
Fine	#40 - #200 (0.074mm)			
Silt and Clay	Less than #200			
		Limestone	Sandy Clay	Gravel

TERMS DESCRIBING SOIL CONSISTENCY

<u>Description</u> (Cohesive <u>Soils</u>)	<u>Unconfined</u> <u>Compression</u> <u>TSF</u>	<u>Blows/Ft.</u> <u>Std. Penetration</u> <u>Test</u>	<u>Description</u> (Cohesionless <u>Soils</u>)	<u>Blows/Ft.</u> <u>Std. Penetration</u> <u>Tests</u>
Very Soft	0.25	<2	Very Loose	0 - 4
Soft	0.25 - 0.50	2 - 4	Loose	4 - 10
Firm	0.50 - 1.00	4 - 8	Medium Dense	10 - 30
Stiff	1.00 - 2.00	8 - 15	Dense	30 - 50
Very Stiff	2.00 - 4.00	15 - 30	Very Dense	50
Hard	>4.00	>30		

SOIL STRUCTURE

Calcareous	Containing deposits of calcium carbonate; generally nodular.
Slickenside	Having inclined planes of weakness that are slick and glossy in appearance.
Laminated	Composed of thin layers of varying color and texture.
Fissured	Containing shrinkage cracks frequently filled with fine sand or silt. Usually more or less vertical.
Interbedded	Composed of alternate layers of different soil types.
Jointed	Consisting of hair cracks that fall apart as soon as the confining pressure is removed.
Varved	Consisting of alternate thin layers of sand, silt or clay formed by variations in sedimentations during the various seasons of the year, of often exhibiting contrasting colors when partially dried. Each layer is generally less than 1/4" in thickness.
Stratified	Composed of, or arranged in layers (usually 1 inch or more)
Well-graded	Having a wide range of grain sizes and substantial amount of all intermediate particle sizes.
Poorly or Gap-graded	Having a range of sizes with some intermediate sizes missing.
Uniformly-graded	Predominantly of one grain size.

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

InTEC Project Number:
S191159-P

Date:
08/19/2019

Calculations

CBR = 4.0

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

InTEC Project Number:
S191159-P

Date:
11/06/2019



SpectraPave4 PRO™ Pavement Optimization Design Analysis



Design Parameters for AASHTO (1993) Equation

Reliability (%)	- 70	Initial Serviceability	- 4.2
Standard Normal Deviate	- -1.524	Terminal Serviceability	- 2.0
Standard Deviation	- 0.45	Change In Serviceability	- 2.2

Aggregate fill shall conform to following requirement:



D50 ≤ 27mm (Base course)

Unstabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.440	N/A
ABC	Aggregate Base Course	20	0.140	1.0

Stabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.440	N/A
MSL	Mechanically Stabilized Base Course	20	0.245	1.0

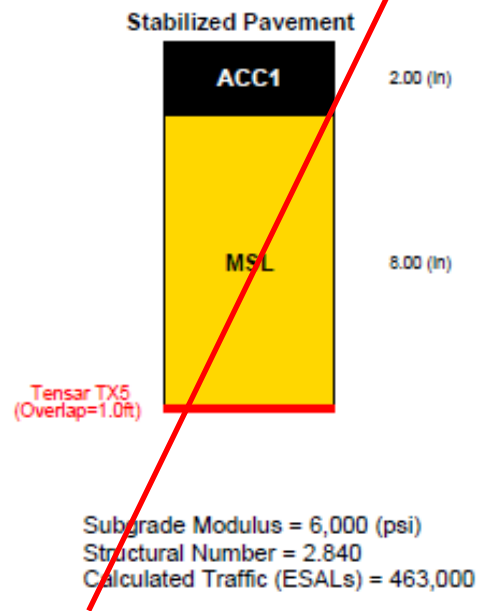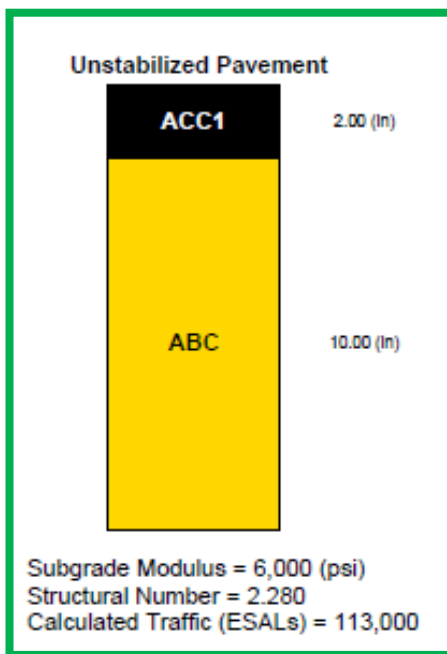

LIMITATIONS OF THE REPORT

The designs, illustrations, information and other content included in this report are necessarily general and conceptual in nature, and do not constitute engineering advice or any design intended for actual construction. Specific design recommendations can be provided as the project develops.

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Local A with NO Bus Traffic

InTEC Project Number:
S191159-P

Date:
11/06/2019



SpectraPave4 PRO™ Pavement Optimization Design Analysis



Design Parameters for AASHTO (1993) Equation

Reliability (%)	= 70	Initial Serviceability	= 4.2
Standard Normal Deviate	= -1.524	Terminal Serviceability	= 2.0
Standard Deviation	= 0.45	Change in Serviceability	= 2.2

Aggregate fill shall conform to following requirement:

D50 ≤ 27mm (Base course)


Unstabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.440	N/A
ABC	Aggregate Base Course	20	0.170	1.0

Stabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.420	N/A
MSL	Mechanically Stabilized Base Course	20	0.265	1.0


Unstabilized Pavement

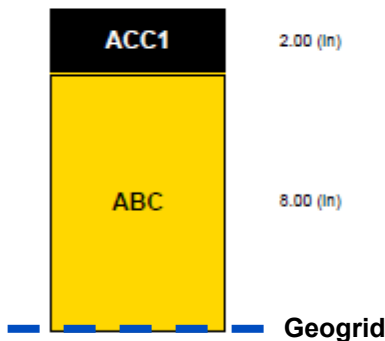

Subgrade Modulus = 6,000 (psi)
Structural Number = 2.240
Calculated Traffic (ESALs) = 102,000

Geogrid option calculated with adjusted structural coefficient value

Stabilized Pavement

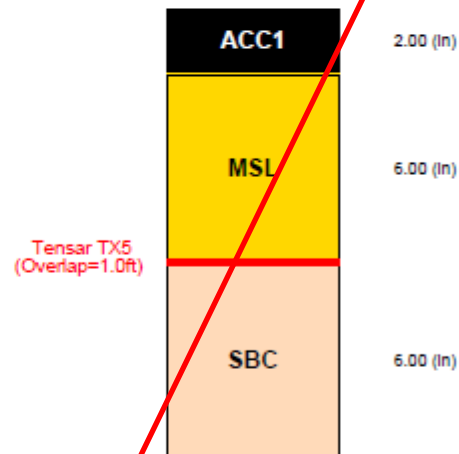

Subgrade Modulus = 6,000 (psi)
Structural Number = 2.910
Calculated Traffic (ESALs) = 543,000

LIMITATIONS OF THE REPORT

The designs, illustrations, information and other content included in this report are necessarily general and conceptual in nature, and do not constitute engineering advice or any design intended for actual construction. Specific design recommendations can be provided as the project develops.

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Local A with NO Bus Traffic

InTEC Project Number:
S191159-P

Date:
11/06/2019



SpectraPave4 PRO™ Pavement Optimization Design Analysis



Design Parameters for AASHTO (1993) Equation

Reliability (%)	- 70	Initial Serviceability	- 4.2
Standard Normal Deviate	- -1.524	Terminal Serviceability	- 2.0
Standard Deviation	- 0.45	Change In Serviceability	- 2.2

Aggregate fill shall conform to following requirement:



D50 ≤ 27mm (Base course)

Unstabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.440	N/A
ABC	Aggregate Base Course	20	0.140	1.0

Stabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.420	N/A
MSL	Mechanically Stabilized Base Cour	20	0.265	1.0

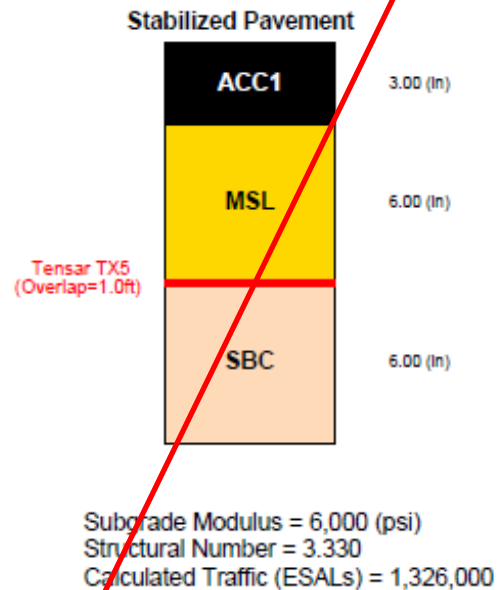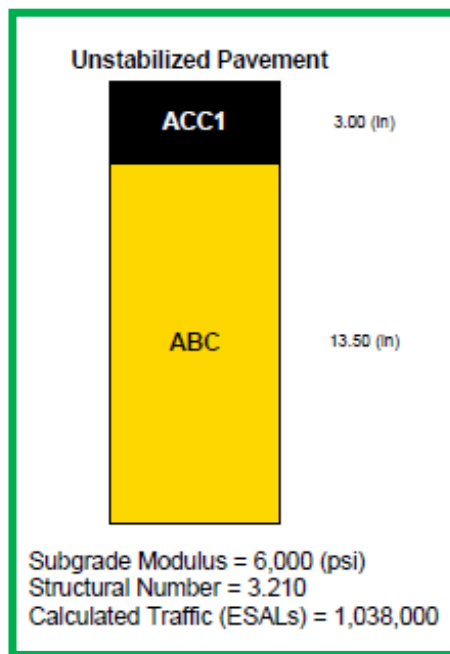

LIMITATIONS OF THE REPORT

The designs, illustrations, information and other content included in this report are necessarily general and conceptual in nature, and do not constitute engineering advice or any design intended for actual construction. Specific design recommendations can be provided as the project develops.

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Local A with Bus Traffic

InTEC Project Number:
S191159-P

Date:
11/06/2019



Design Parameters for AASHTO (1993) Equation

Reliability (%)	= 70	Initial Serviceability	= 4.2
Standard Normal Deviate	= -1.524	Terminal Serviceability	= 2.0
Standard Deviation	= 0.45	Change In Serviceability	= 2.2

Aggregate fill shall conform to following requirement:


D50 ≤ 27mm (Base course)

Unstabilized Section Material Properties


Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.440	N/A
ABC	Aggregate Base Course	20	0.170	1.0

Stabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.420	N/A
MSL	Mechanically Stabilized Base Course	20	0.265	1.0

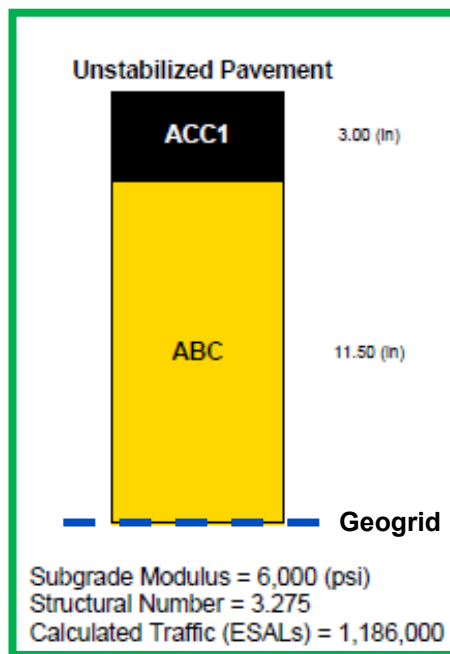

Geogrid option calculated with adjusted structural coefficient value

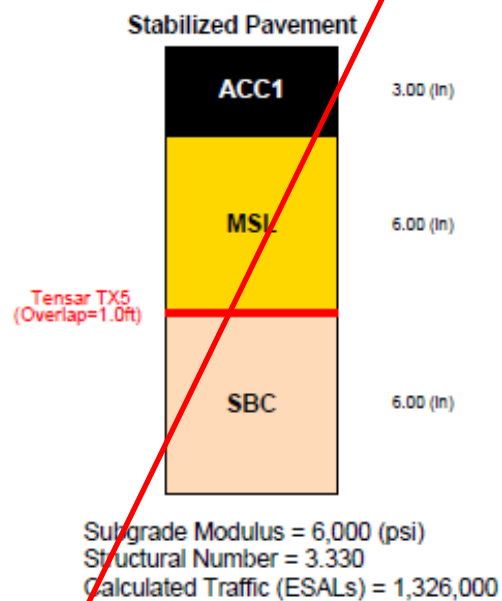

LIMITATIONS OF THE REPORT

The designs, illustrations, information and other content included in this report are necessarily general and conceptual in nature, and do not constitute engineering advice or any design intended for actual construction. Specific design recommendations can be provided as the project develops.

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Local A with Bus Traffic

InTEC Project Number:
S191159-P

Date:
11/06/2019



SpectraPave4 PRO™ Pavement Optimization Design Analysis



Design Parameters for AASHTO (1993) Equation

Reliability (%)	= 90	Initial Serviceability	= 4.2
Standard Normal Deviate	= -1.262	Terminal Serviceability	= 2.0
Standard Deviation	= 0.45	Change In Serviceability	= 2.2

Aggregate fill shall conform to following requirement:

D50 ≤ 27mm (Base course)


Unstabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.440	N/A
ACC2	Dense-graded Asphalt Course	70	0.140	N/A
ABC	Aggregate Base Course	20	0.140	1.0

Stabilized Section Material Properties


Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.420	N/A
MSL	Mechanically Stabilized Base Cour	20	0.265	1.0

Unstabilized Pavement

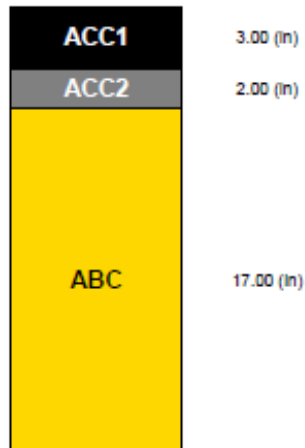

Subgrade Modulus = 6,000 (psi)
Structural Number = 3.980
Calculated Traffic (ESALs) = 2,044,000

Stabilized Pavement

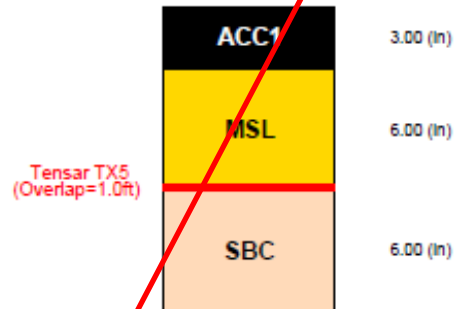

Subgrade Modulus = 6,000 (psi)
Structural Number = 3.330
Calculated Traffic (ESALs) = 605,000

LIMITATIONS OF THE REPORT

The designs, illustrations, information and other content included in this report are necessarily general and conceptual in nature, and do not constitute engineering advice or any design intended for actual construction. Specific design recommendations can be provided as the project develops.

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Local B

InTEC Project Number:
S191159-P

Date:
11/06/2019



SpectraPave4 PRO™ Pavement Optimization Design Analysis



Design Parameters for AASHTO (1993) Equation

Reliability (%)	= 90	Initial Serviceability	= 4.2
Standard Normal Deviate	= -1.282	Terminal Serviceability	= 2.0
Standard Deviation	= 0.45	Change In Serviceability	= 2.2

Aggregate fill shall conform to following requirement:


D50 ≤ 27mm (Base course)

Unstabilized Section Material Properties


Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.440	N/A
ACC2	Dense-graded Asphalt Course	70	0.170	N/A
ABC	Aggregate Base Course	20	0.170	1.0

Stabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.420	N/A
MSL	Mechanically Stabilized Base Course	20	0.265	1.0

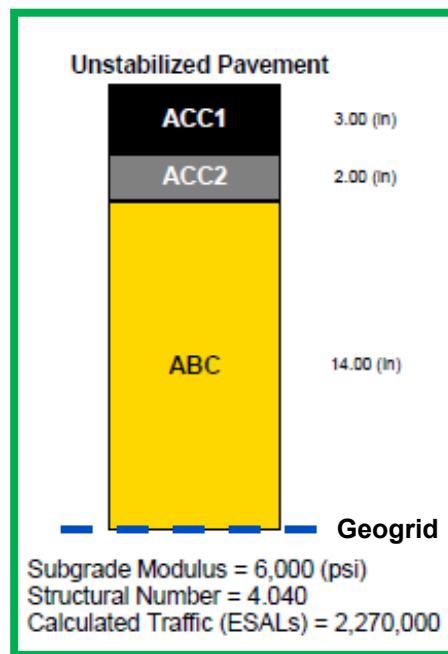

Geogrid option calculated with adjusted structural coefficient value

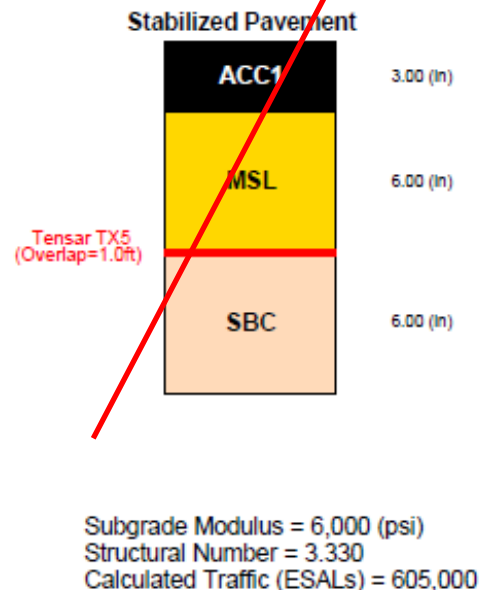

LIMITATIONS OF THE REPORT

The designs, illustrations, information and other content included in this report are necessarily general and conceptual in nature, and do not constitute engineering advice or any design intended for actual construction. Specific design recommendations can be provided as the project develops.

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Local B

InTEC Project Number:
S191159-P

Date:
11/06/2019



Design Parameters for AASHTO (1993) Equation

Reliability (%)	= 90	Initial Serviceability	= 4.2
Standard Normal Deviate	= -1.282	Terminal Serviceability	= 2.0
Standard Deviation	= 0.45	Change In Serviceability	= 2.2

Aggregate fill shall conform to following requirement:



D50 ≤ 27mm (Base course)

Unstabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.440	N/A
ABC	Aggregate Base Course	20	0.340	1.0

Stabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.420	N/A
MSL	Mechanically Stabilized Base Cour	20	0.265	1.0

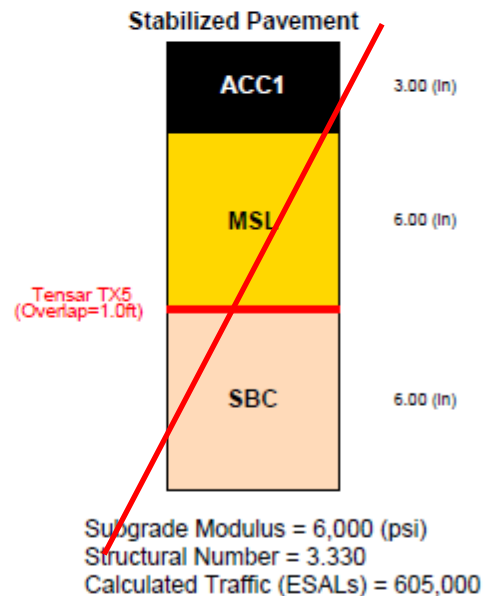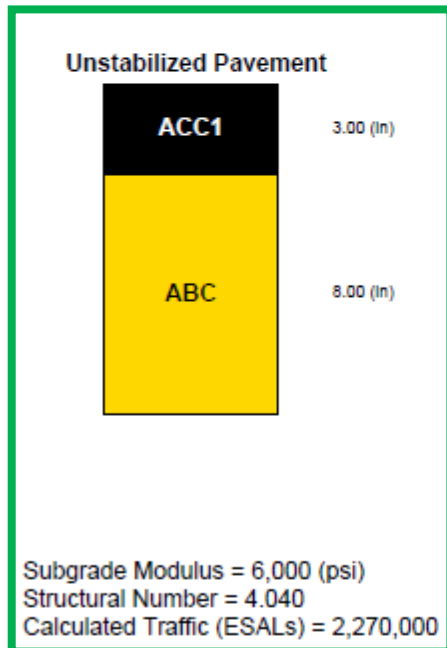

LIMITATIONS OF THE REPORT

The designs, illustrations, information and other content included in this report are necessarily general and conceptual in nature, and do not constitute engineering advice or any design intended for actual construction. Specific design recommendations can be provided as the project develops.

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Local B

InTEC Project Number:
S191159-P

Date:
11/06/2019



Design Parameters for AASHTO (1993) Equation

Reliability (%)	= 90	Initial Serviceability	= 4.2
Standard Normal Deviate	= -1.282	Terminal Serviceability	= 2.5
Standard Deviation	= 0.45	Change In Serviceability	= 1.7

Aggregate fill shall conform to following requirement:

D50 <= 27mm (Base course)


Unstabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.440	N/A
ACC2	Dense-graded Asphalt Course	70	0.140	N/A
ABC	Aggregate Base Course	20	0.140	1.0

Stabilized Section Material Properties


Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.420	N/A
MSL	Mechanically Stabilized Base Cour	20	0.265	1.0

Unstabilized Pavement

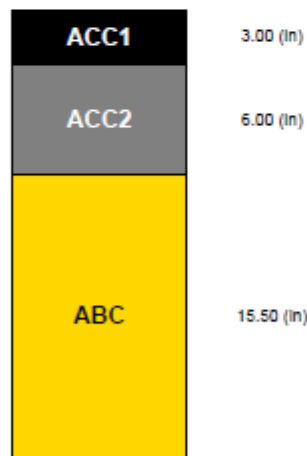

Subgrade Modulus = 6,000 (psi)
Structural Number = 4.330
Calculated Traffic (ESALs) = 2,384,000

Stabilized Pavement

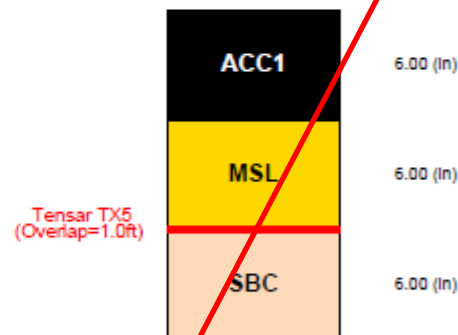

Subgrade Modulus = 6,000 (psi)
Structural Number = 4.590
Calculated Traffic (ESALs) = 3,511,000

LIMITATIONS OF THE REPORT

The designs, illustrations, information and other content included in this report are necessarily general and conceptual in nature, and do not constitute engineering advice or any design intended for actual construction. Specific design recommendations can be provided as the project develops.

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Collector

InTEC Project Number:
S191159-P

Date:
11/06/2019



SpectraPave4 PRO™ Pavement Optimization Design Analysis



Design Parameters for AASHTO (1993) Equation

Reliability (%)	= 90	Initial Serviceability	= 4.2
Standard Normal Deviate	= -1.282	Terminal Serviceability	= 2.5
Standard Deviation	= 0.45	Change In Serviceability	= 1.7

Aggregate fill shall conform to following requirement:


D50 ≤ 27mm (Base course)

Unstabilized Section Material Properties


Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.440	N/A
ACC2	Dense-graded Asphalt Course	70	0.170	N/A
ABC	Aggregate Base Course	20	0.170	1.0

Stabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.420	N/A
MSL	Mechanically Stabilized Base Course	20	0.265	1.0

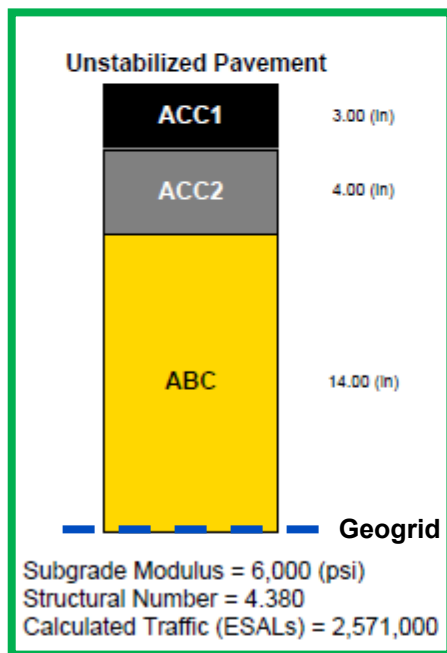

Geogrid option calculated with adjusted structural coefficient value

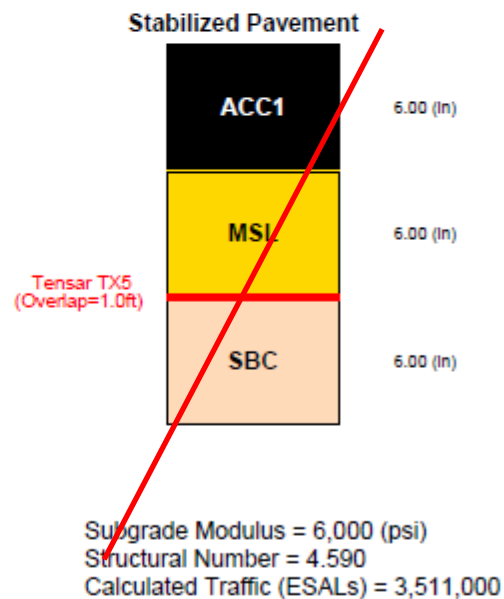

LIMITATIONS OF THE REPORT

The designs, illustrations, information and other content included in this report are necessarily general and conceptual in nature, and do not constitute engineering advice or any design intended for actual construction. Specific design recommendations can be provided as the project develops.

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Collector

InTEC Project Number:
S191159-P

Date:
11/06/2019



SpectraPave4 PRO™ Pavement Optimization Design Analysis



Design Parameters for AASHTO (1993) Equation

Reliability (%)	= 90	Initial Serviceability	= 4.2
Standard Normal Deviate	= -1.282	Terminal Serviceability	= 2.5
Standard Deviation	= 0.45	Change In Serviceability	= 1.7

Aggregate fill shall conform to following requirement:

D50 ≤ 27mm (Base course)


Unstabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.440	N/A
ABC	Aggregate Base Course	20	0.340	1.0

Stabilized Section Material Properties


Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70	0.420	N/A
MSL	Mechanically Stabilized Base Cour	20	0.265	1.0

Unstabilized Pavement

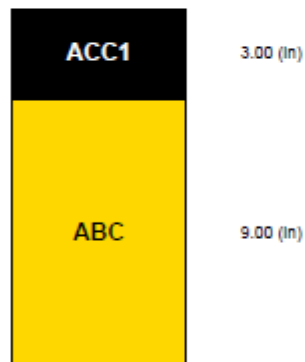

Subgrade Modulus = 6,000 (psi)
Structural Number = 4.380
Calculated Traffic (ESALs) = 2,571,000

Stabilized Pavement

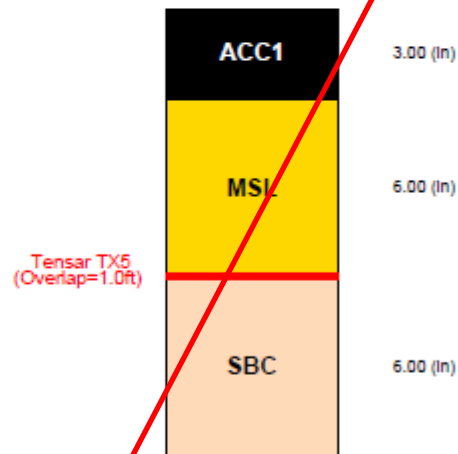

Subgrade Modulus = 6,000 (psi)
Structural Number = 3.330
Calculated Traffic (ESALs) = 461,000

LIMITATIONS OF THE REPORT

The designs, illustrations, information and other content included in this report are necessarily general and conceptual in nature, and do not constitute engineering advice or any design intended for actual construction. Specific design recommendations can be provided as the project develops.

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Collector

InTEC Project Number:
S191159-P

Date:
11/06/2019



SpectraPave™ Pavement Optimization Design Analysis



Design Parameters for AASHTO (1993) Equation

Reliability (%)	= 95	Initial Serviceability	= 4.2
Standard Normal Deviate	= -1.645	Terminal Serviceability	= 2.5
Standard Deviation	= 0.45	Change In Serviceability	= 1.7

Aggregate fill shall conform to following requirement:

D50 ≤ 27mm (Base course)


Unstabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70.00	0.440	N/A
ACC2	Dense-graded Asphalt Course	70.00	0.440	N/A
ACC3	Dense-graded Asphalt Course	70.00	0.140	N/A
ABC	Aggregate Base Course	20.00	0.140	1.0

Stabilized Section Material Properties


Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70.00	0.420	N/A
MSL	Mechanically Stabilized Base Course	20.00	0.238	1.0
SBC	Subbase Course	16.00	0.080	1.0

Unstabilized Pavement

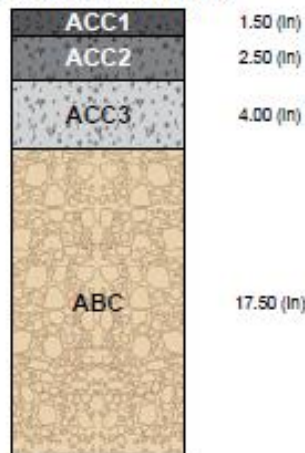

Subgrade Modulus = 6,000 (psi)
Structural Number = 4.770
Calculated Traffic (ESALs) = 3,128,000

Stabilized Pavement

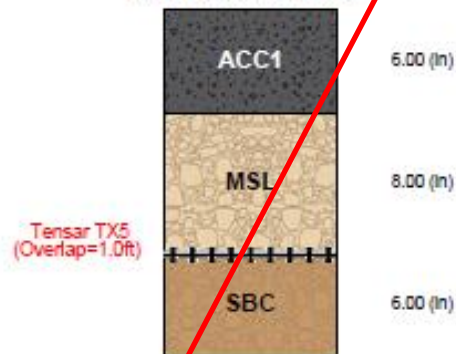

Subgrade Modulus = 6,000 (psi)
Structural Number = 4.904
Calculated Traffic (ESALs) = 3,786,000

LIMITATIONS OF THE REPORT

The designs, illustrations, information and other content included in this report are necessarily general and conceptual in nature, and do not constitute engineering advice or any design intended for actual construction. Specific design recommendations can be provided as the project develops.

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Arterial

InTEC Project Number:
S191159-P

Date:
11/06/2019



Design Parameters for AASHTO (1993) Equation

Reliability (%)	= 95	Initial Serviceability	= 4.2
Standard Normal Deviate	= -1.645	Terminal Serviceability	= 2.5
Standard Deviation	= 0.45	Change In Serviceability	= 1.7

Aggregate fill shall conform to following requirement:


D50 ≤ 27mm (Base course)

Unstabilized Section Material Properties


Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70.00	0.440	N/A
ACC2	Dense-graded Asphalt Course	70.00	0.440	N/A
ACC3	Dense-graded Asphalt Course	70.00	0.170	N/A
ABC	Aggregate Base Course	20.00	0.170	1.0

Stabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70.00	0.420	N/A
MSL	Mechanically Stabilized Base Course	20.00	0.238	1.0
SBC	Subbase Course	16.00	0.080	1.0

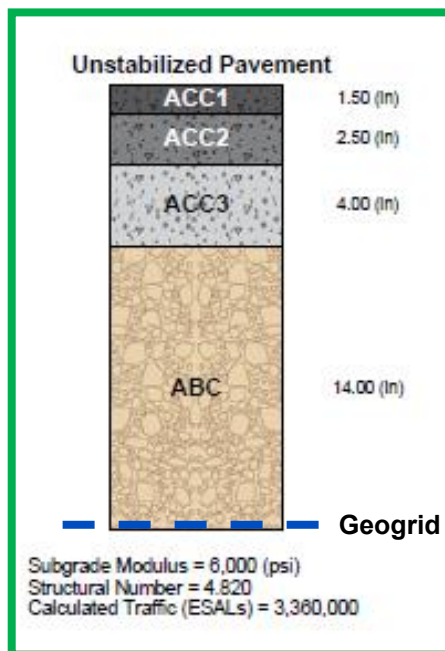

Geogrid option calculated with adjusted structural coefficient value

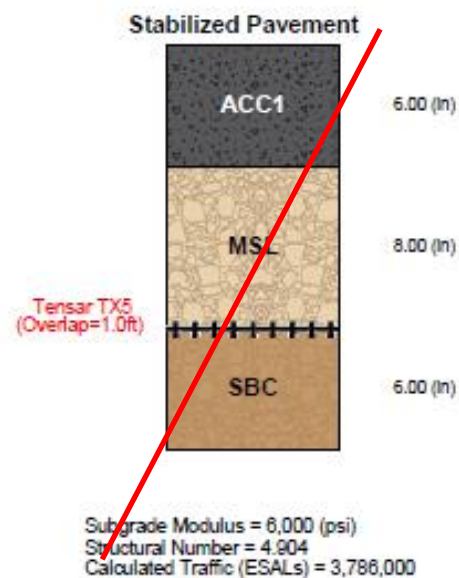

LIMITATIONS OF THE REPORT

The designs, illustrations, information and other content included in this report are necessarily general and conceptual in nature, and do not constitute engineering advice or any design intended for actual construction. Specific design recommendations can be provided as the project develops.

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Arterial

InTEC Project Number:
S191159-P

Date:
11/06/2019



Design Parameters for AASHTO (1993) Equation

Reliability (%)	= 95	Initial Serviceability	= 4.2
Standard Normal Deviate	= -1.645	Terminal Serviceability	= 2.5
Standard Deviation	= 0.45	Change In Serviceability	= 1.7

Aggregate fill shall conform to following requirement:

D50 ≤ 27mm (Base course)


Unstabilized Section Material Properties

Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70.00	0.440	N/A
ACC2	Dense-graded Asphalt Course	70.00	0.440	N/A
ABC	Aggregate Base Course	20.00	0.340	1.0

Stabilized Section Material Properties


Layer	Description	Cost (\$/ton)	Layer coefficient	Drainage factor
ACC1	Asphalt Wearing Course	70.00	0.420	N/A
MSL	Mechanically Stabilized Base Course	20.00	0.238	1.0
SBC	Subbase Course	16.00	0.080	1.0

Unstabilized Pavement

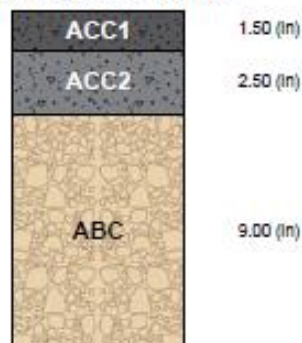

Subgrade Modulus = 6,000 (psi)
Structural Number = 4.820
Calculated Traffic (ESALs) = 3,360,000

Stabilized Pavement

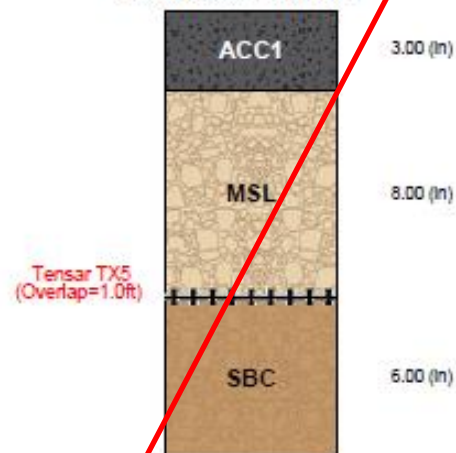

Subgrade Modulus = 6,000 (psi)
Structural Number = 3.644
Calculated Traffic (ESALs) = 548,000

LIMITATIONS OF THE REPORT

The designs, illustrations, information and other content included in this report are necessarily general and conceptual in nature, and do not constitute engineering advice or any design intended for actual construction. Specific design recommendations can be provided as the project develops.

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Arterial

InTEC Project Number:
S191159-P


Date:
11/06/2019

InTEC of San Antonio

ASTM D-1883 California Bearing Ratio Test Report



Load Penetration Curve

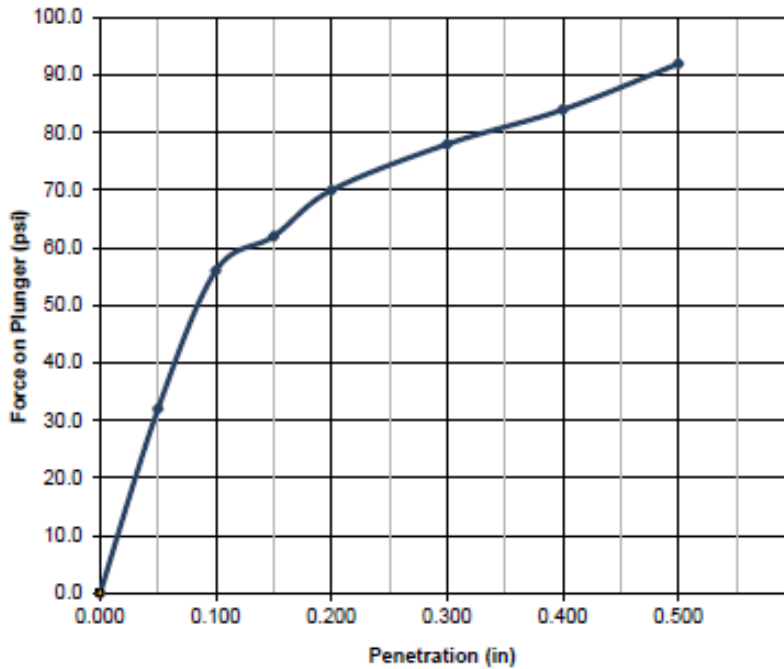

CBR Results

Results	A	B	C	D	Average
0.1 in Pen.	5.6				
0.2 in Pen.	4.6				
Moisture (%)	16.50				
Density (pcf)	108.20				
Final Moisture (%)	24.10				
Final Density (pcf)	94.10				

Project Information


Project Number	S191159-P	Sample Location	
Project Name	Riverstone Tract	Specimen A	near B-1
Date	8/18/2019	Specimen B	
Client	DRHorton Homes	Specimen C	
		Specimen D	
		Test Variables	
Job Ref.		Liquid Limit:	40.0
Sample Num.		Plastic Limit:	21.0
Remarks	Brown Clay, Gravel, Tan Clay		

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

CBR Test Results

InTEC Project Number:
S191159-P

Date:
11/06/2019

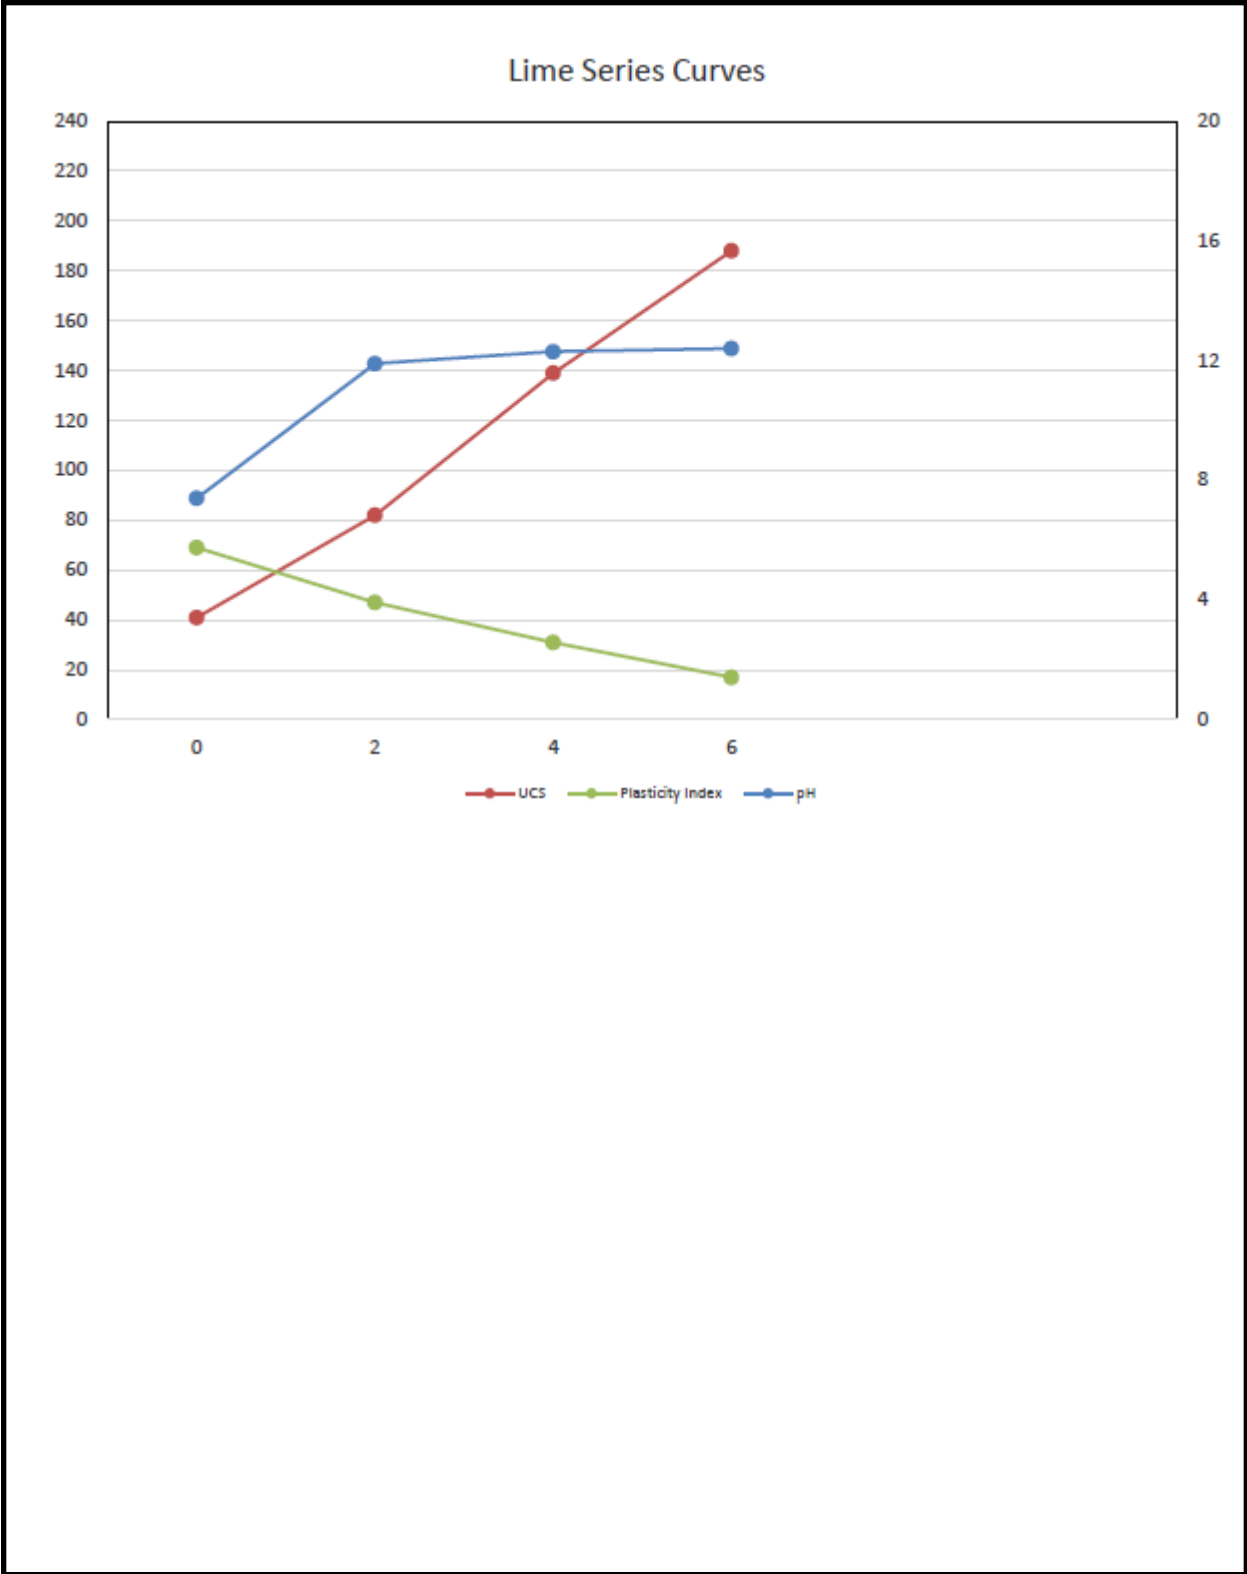

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

Lime Series

InTEC Project Number:
S191159-P

Date:
11/06/2019

Appendix

Subsurface Exploration and Pavement Analysis
Proposed New Streets
1,131.8 Acre Riverstone Tract
San Antonio, Texas

InTEC Project Number:
S191159-P

Date:
11/06/2019

Important Information about This Geotechnical-Engineering Report

Subsurface problems are a principal cause of construction delays, cost overruns, claims, and disputes.

While you cannot eliminate all such risks, you can manage them. The following information is provided to help.

The Geoprofessional Business Association (GBA) has prepared this advisory to help you – assumedly a client representative – interpret and apply this geotechnical-engineering report as effectively as possible. In that way, clients can benefit from a lowered exposure to the subsurface problems that, for decades, have been a principal cause of construction delays, cost overruns, claims, and disputes. If you have questions or want more information about any of the issues discussed below, contact your GBA-member geotechnical engineer. Active involvement in the Geoprofessional Business Association exposes geotechnical engineers to a wide array of risk-confrontation techniques that can be of genuine benefit for everyone involved with a construction project.

Geotechnical-Engineering Services Are Performed for Specific Purposes, Persons, and Projects

Geotechnical engineers structure their services to meet the specific needs of their clients. A geotechnical-engineering study conducted for a given civil engineer will not likely meet the needs of a civil-works constructor or even a different civil engineer. Because each geotechnical-engineering study is unique, each geotechnical-engineering report is unique, prepared *solely* for the client. *Those who rely on a geotechnical-engineering report prepared for a different client can be seriously misled.* No one except authorized client representatives should rely on this geotechnical-engineering report without first conferring with the geotechnical engineer who prepared it. *And no one – not even you – should apply this report for any purpose or project except the one originally contemplated.*

Read this Report in Full

Costly problems have occurred because those relying on a geotechnical-engineering report did not read it *in its entirety*. Do not rely on an executive summary. Do not read selected elements only. *Read this report in full.*

You Need to Inform Your Geotechnical Engineer about Change

Your geotechnical engineer considered unique, project-specific factors when designing the study behind this report and developing the confirmation-dependent recommendations the report conveys. A few typical factors include:

- the client's goals, objectives, budget, schedule, and risk-management preferences;
- the general nature of the structure involved, its size, configuration, and performance criteria;
- the structure's location and orientation on the site; and
- other planned or existing site improvements, such as retaining walls, access roads, parking lots, and underground utilities.

Typical changes that could erode the reliability of this report include those that affect:

- the site's size or shape;
- the function of the proposed structure, as when it's changed from a parking garage to an office building, or from a light-industrial plant to a refrigerated warehouse;
- the elevation, configuration, location, orientation, or weight of the proposed structure;
- the composition of the design team; or
- project ownership.

As a general rule, *always* inform your geotechnical engineer of project changes – even minor ones – and request an assessment of their impact. *The geotechnical engineer who prepared this report cannot accept responsibility or liability for problems that arise because the geotechnical engineer was not informed about developments the engineer otherwise would have considered.*

This Report May Not Be Reliable

Do not rely on this report if your geotechnical engineer prepared it:

- for a different client;
- for a different project;
- for a different site (that may or may not include all or a portion of the original site); or
- before important events occurred at the site or adjacent to it; e.g., man-made events like construction or environmental remediation, or natural events like floods, droughts, earthquakes, or groundwater fluctuations.

Note, too, that it could be unwise to rely on a geotechnical-engineering report whose reliability may have been affected by the passage of time, because of factors like changed subsurface conditions; new or modified codes, standards, or regulations; or new techniques or tools. *If your geotechnical engineer has not indicated an "apply-by" date on the report, ask what it should be, and, in general, if you are the least bit uncertain about the continued reliability of this report, contact your geotechnical engineer before applying it.* A minor amount of additional testing or analysis – if any is required at all – could prevent major problems.

Most of the "Findings" Related in This Report Are Professional Opinions

Before construction begins, geotechnical engineers explore a site's subsurface through various sampling and testing procedures. *Geotechnical engineers can observe actual subsurface conditions only at those specific locations where sampling and testing were performed.* The data derived from that sampling and testing were reviewed by your geotechnical engineer, who then applied professional judgment to form opinions about subsurface conditions throughout the site. Actual sitewide-subsurface conditions may differ – maybe significantly – from those indicated in this report. Confront that risk by retaining your geotechnical engineer to serve on the design team from project start to project finish, so the individual can provide informed guidance quickly, whenever needed.

This Report's Recommendations Are Confirmation-Dependent

The recommendations included in this report – including any options or alternatives – are confirmation-dependent. In other words, *they are not final*, because the geotechnical engineer who developed them relied heavily on judgment and opinion to do so. Your geotechnical engineer can finalize the recommendations *only after observing actual subsurface conditions* revealed during construction. If through observation your geotechnical engineer confirms that the conditions assumed to exist actually do exist, the recommendations can be relied upon, assuming no other changes have occurred. *The geotechnical engineer who prepared this report cannot assume responsibility or liability for confirmation-dependent recommendations if you fail to retain that engineer to perform construction observation.*

This Report Could Be Misinterpreted

Other design professionals' misinterpretation of geotechnical-engineering reports has resulted in costly problems. Confront that risk by having your geotechnical engineer serve as a full-time member of the design team, to:

- confer with other design-team members,
- help develop specifications,
- review pertinent elements of other design professionals' plans and specifications, and
- be on hand quickly whenever geotechnical-engineering guidance is needed.

You should also confront the risk of constructors misinterpreting this report. Do so by retaining your geotechnical engineer to participate in prebid and preconstruction conferences and to perform construction observation.

Give Constructors a Complete Report and Guidance

Some owners and design professionals mistakenly believe they can shift unanticipated-subsurface-conditions liability to constructors by limiting the information they provide for bid preparation. To help prevent the costly, contentious problems this practice has caused, include the complete geotechnical-engineering report, along with any attachments or appendices, with your contract documents, *but be certain to note conspicuously that you've included the material for informational purposes only*. To avoid misunderstanding, you may also want to note that "informational purposes" means constructors have no right to rely on the interpretations, opinions, conclusions, or recommendations in the report, but they may rely on the factual data relative to the specific times, locations, and depths/elevations referenced. Be certain that constructors know they may learn about specific project requirements, including options selected from the report, *only* from the design drawings and specifications. Remind constructors that they may

perform their own studies if they want to, and *be sure to allow enough time* to permit them to do so. Only then might you be in a position to give constructors the information available to you, while requiring them to at least share some of the financial responsibilities stemming from unanticipated conditions. Conducting prebid and preconstruction conferences can also be valuable in this respect.

Read Responsibility Provisions Closely

Some client representatives, design professionals, and constructors do not realize that geotechnical engineering is far less exact than other engineering disciplines. That lack of understanding has nurtured unrealistic expectations that have resulted in disappointments, delays, cost overruns, claims, and disputes. To confront that risk, geotechnical engineers commonly include explanatory provisions in their reports. Sometimes labeled "limitations," many of these provisions indicate where geotechnical engineers' responsibilities begin and end, to help others recognize their own responsibilities and risks. *Read these provisions closely*. Ask questions. Your geotechnical engineer should respond fully and frankly.

Geoenvironmental Concerns Are Not Covered

The personnel, equipment, and techniques used to perform an environmental study – e.g., a "phase-one" or "phase-two" environmental site assessment – differ significantly from those used to perform a geotechnical-engineering study. For that reason, a geotechnical-engineering report does not usually relate any environmental findings, conclusions, or recommendations; e.g., about the likelihood of encountering underground storage tanks or regulated contaminants. *Unanticipated subsurface environmental problems have led to project failures*. If you have not yet obtained your own environmental information, ask your geotechnical consultant for risk-management guidance. As a general rule, *do not rely on an environmental report prepared for a different client, site, or project, or that is more than six months old*.

Obtain Professional Assistance to Deal with Moisture Infiltration and Mold

While your geotechnical engineer may have addressed groundwater, water infiltration, or similar issues in this report, none of the engineer's services were designed, conducted, or intended to prevent uncontrolled migration of moisture – including water vapor – from the soil through building slabs and walls and into the building interior, where it can cause mold growth and material-performance deficiencies. Accordingly, *proper implementation of the geotechnical engineer's recommendations will not of itself be sufficient to prevent moisture infiltration*. Confront the risk of moisture infiltration by including building-envelope or mold specialists on the design team. *Geotechnical engineers are not building-envelope or mold specialists*.



**GEOPROFESSIONAL
BUSINESS
ASSOCIATION**

Telephone: 301/565-2733

e-mail: info@geoprofessional.org www.geoprofessional.org