

GEOTECHNICAL ENGINEERING REPORT

**The Estates at Martinez - Streets
Abbott Rd.
St. Hedwig, Texas**

PSI Project No. 0312-3441



PREPARED FOR:

**Lennar
100 Northeast Loop 410, Suite 1155
San Antonio, Texas 78216**

January 30, 2025

BY:

**PROFESSIONAL SERVICE INDUSTRIES, INC.
3 Burwood Lane
San Antonio, Texas 78216
Phone: (210) 342-9377**

January 30, 2025

Lennar
100 Northeast Loop 410, Suite 1155
San Antonio, Texas 78216

Attn: Mr. Clifton Karam

**RE: GEOTECHNICAL ENGINEERING REPORT
THE ESTATES AT MARTINEZ - STREETS
ABBOTT RD.
ST. HEDWIG, TEXAS
PSI PROJECT: NO. 0312-3441**

Dear Mr. Karam:

Professional Service Industries, Inc. (PSI), an Intertek company, is pleased to submit this Geotechnical Engineering Report for the above-referenced project. This report includes the results from the field and laboratory investigation along with recommendations for use in preparation of the appropriate design and construction documents for this project.

PSI appreciates the opportunity to provide this Geotechnical Engineering Report and looks forward to continuing participation during the design and construction phases of this project. PSI also has great interest in providing materials testing and inspection services during the construction of this project and will be glad to meet with you to further discuss how we can be of assistance as the project advances.

If there are questions pertaining to this report, or if PSI may be of further service, please contact us at your convenience.

Respectfully submitted,

PROFESSIONAL SERVICE INDUSTRIES, INC.

Texas Board of Professional Engineers Certificate of Registration # F003307



Axell Figueroa
Graduate Engineer



S. Peter Gonzales, P.E.
Geotechnical Department Manager

TABLE OF CONTENTS

Electronic Navigation: The TOC below and [Keywords](#) are hyperlinked to sections of relevance. The  Symbol will return the reader to the TOC.

	Page No.
TABLE OF CONTENTS.....	1
1.0 PROJECT INFORMATION	1
1.1 PROJECT AUTHORIZATION.....	1
1.2 PROJECT DESCRIPTION	1
1.3 PURPOSE AND SCOPE OF SERVICES	1
2.0 SITE AND SUBSURFACE CONDITIONS.....	3
2.1 SITE DESCRIPTION.....	3
2.2 FIELD EXPLORATION	3
2.3 LABORATORY TESTING PROGRAM.....	4
2.4 SITE GEOLOGY	4
2.5 SUBSURFACE CONDITIONS	5
3.0 GEOTECHNICAL EVALUATION AND RECOMMENDATIONS	6
3.1 POTENTIAL VERTICAL MOVEMENT OF EXPANSIVE SOILS (PVM).....	6
4.0 PAVEMENT DESIGN RECOMMENDATIONS	7
4.1 PAVEMENT DESIGN PARAMETERS.....	7
4.2 PAVEMENT SECTION RECOMMENDATIONS.....	9
5.0 CONSTRUCTION CONSIDERATIONS	12
5.1 INITIAL SITE PREPARATION CONSIDERATIONS	13
5.2 MOISTURE SENSITIVE SOILS/WEATHER RELATED CONCERN.....	14
5.3 EXCAVATION OBSERVATIONS.....	14
5.4 DRAINAGE CONSIDERATIONS.....	14
5.5 EXCAVATIONS AND TRENCHES.....	15
6.0 REPORT LIMITATIONS	16
APPENDIX.....	17

[Site Vicinity Map](#)

[Boring Location Plan](#)

[CBR Results](#)

[Boring Logs](#)

[Key to Terms and Symbols Used on Logs](#)

INDEX OF FIGURES

	Page No.
Figure 4.1: Flexible Pavement Typical Section	9

INDEX OF TABLES

	Page No.
Table 1.1: Project Description	1
Table 2.1: Site Description	3
Table 2.2: Field Exploration Summary.....	3
Table 2.3: Field Exploration Description.....	4
Table 2.4: Laboratory Testing Program	4
Table 2.5: Generalized Subsurface Profile Table	5
Table 4.1: Native Soil Test Summary.....	7
Table 4.2: Lime Series Results	7
Table 4.3: Pavement Design Parameters and Assumptions (Flexible).....	8
Table 4.4: Flexible Pavement Section Options	9
Table 4.5: Flexible Pavement Section Options (Geogrid)	10
Table 4.6: Pavement Design and Construction Recommendations.....	10
Table 4.7: Compaction and Testing Recommendations for Pavement Areas	11
Table 5.1: Subgrade Preparation for Non-Structural - General Fill	13
Table 5.2: Fill Compaction Recommendations Outside of Building and Pavement Areas	13
Table 5.3: Considerations for Demolition, Abandoning Utilities and Tree Removal	14

1.0 PROJECT INFORMATION

1.1 PROJECT AUTHORIZATION

Professional Service Industries, Inc. (PSI), an Intertek company, has completed a field exploration and geotechnical evaluation for the proposed The Estates at Martinez - Streets project. Mr. Cliffton Karam, representing Lennar, authorized PSI's services on November 21, 2024, by signing PSI Proposal No. 439609. PSI's proposal contained a proposed scope of work, lump sum fee, and PSI's General Conditions.

1.2 PROJECT DESCRIPTION

Based on information provided by the Client and PSI's review of a site plan entitled "The Estates at Martinez – Preliminary Design", and the results of this geotechnical investigation, a summary of our understanding of the proposed project is provided below in the following Project Description table.

TABLE 1.1: PROJECT DESCRIPTION

Project Items	Approximately 51 Acres of residential lots and approximately 11,300 lineal feet of subdivision streets
Pavement for Parking and Drives	Flexible Asphalt (HMAC)
Design Traffic Load per Bexar County	Local Streets Type A: 100,000 ESALs without bus traffic and 1,000,000 with bus traffic. Collector and Local Type B Streets: 2,000,000 ESALs Arterial Streets: 3,000,000 ESALs

The geotechnical recommendations presented in this report are based on the available project information, structure locations, and the subsurface materials encountered during the field investigation. If the information presented above is incorrect, please inform PSI so that the recommendations presented in this report can be amended, as necessary. PSI will not be responsible for the implementation of provided recommendations if not notified of changes in the project.

1.3 PURPOSE AND SCOPE OF SERVICES

The purpose of this study is to evaluate the subsurface conditions at the site and develop geotechnical engineering recommendations and guidelines for use in preparing the design and other related construction documents for the proposed project. The scope of services included drilling soil borings, performing laboratory testing, and preparing this geotechnical engineering report.

This report briefly outlines the available project information, describes the site and subsurface conditions, and presents the following:

- General site development and subgrade preparation recommendations.
- Estimated potential soil movements associated with collapsing, shrinking and swelling soils and methods to reduce these movements.
- Recommendations for site excavation, fill compaction, and the use of on-site and imported fill material under pavements.
- Recommendations for the design of flexible asphaltic pavement systems for the proposed residential streets per the Bexar County Pavement Design Standards.



The scope of services for this geotechnical exploration did not include an environmental, mold nor detailed seismic/fault assessment for determining the presence or absence of wetlands, or hazardous or toxic materials in the soil, bedrock, surface water, groundwater, or air on or below, or around this site. Statements in this report or on the boring logs regarding odors, colors, and unusual or suspicious items or conditions are strictly for informational purposes. The report also does not include a detailed settlement analysis or slope stability analysis.



2.0 SITE AND SUBSURFACE CONDITIONS

2.1 SITE DESCRIPTION

The following table provides a generalized description of the existing site conditions based on visual observations during the field activities, as well as other available information.

TABLE 2.1: SITE DESCRIPTION

Site Location	Latitude: 29.4379° Longitude: -98.2468°
Site History	Undeveloped
Existing Site Ground Cover	Grass, bushes, trees
Existing Grade/Elevation Changes	±30 feet Estimated
Site Geology (Geologic Atlas of Texas)	Fluviatile Terrace Deposits (Qt) and Midway Group (Emi)
Site Boundaries/Neighboring Development	North: Undeveloped Land West: Undeveloped Land East: Abbott Rd. South: Residential development
Ground Surface Soil Support Capability for Operational Stability and Site Access	Firm Enough for Field Equipment when Dry

2.2 FIELD EXPLORATION

Field exploration for the project consisted of drilling a total of **twelve (12) borings**. The boring design element, approximate depths and drilling footage are provided in the following table.

TABLE 2.2: FIELD EXPLORATION SUMMARY

Design Element	Number of Borings	Boring Depth (ft)	Drilling Footage (feet)
Streets (B-01 to B-12)	12	15	180
TOTAL:	12	---	180

The boring locations were selected by PSI personnel and located in the field using a recreational-grade GPS system. Elevations of the ground surface at the boring locations were not provided and should be surveyed by others prior to construction, if required. We have estimated ground surface elevations at the boring locations from the topographic survey provided (or from Google Earth) and estimate an approximate 1-foot accuracy. The references to elevations of various subsurface strata are based on depths below existing grade at the time of drilling. The approximate boring locations are depicted on the Boring Location Plan provided in the Appendix.



TABLE 2.3: FIELD EXPLORATION DESCRIPTION

Drilling Equipment	Truck-Mounted Drilling Equipment
Drilling Method	Continuous Flight-Auger
Field Testing	Standard Penetration Test (ASTM D1586)
Sampling Procedure	ASTM D1586
Sampling Frequency	Continuously to a Depth of 10 Feet and at 5-foot Intervals Thereafter
Frequency of Groundwater Level Measurements	During and After Drilling
Boring Backfill Procedures	Soil Cuttings
Sample Preservation and Transportation Procedure	General Accordance with ASTM D4220

During field activities, the encountered subsurface conditions were observed, logged, and visually classified (in general accordance with ASTM D2487). Field notes were maintained to summarize soil types and descriptions, water levels, changes in subsurface conditions, and drilling conditions.

2.3 LABORATORY TESTING PROGRAM

PSI supplemented the field exploration with a laboratory testing program to determine additional engineering characteristics of the subsurface soils encountered. The laboratory testing program included:

TABLE 2.4: LABORATORY TESTING PROGRAM

Laboratory Test	Procedure Specification
Visual Classification	ASTM D2488
Moisture Content	ASTM D2216
Atterberg Limits	ASTM D4318
Material Finer than No. 200 Sieve	ASTM D1140
California Bearing Ratio (CBR)	ASTM D1883
Soil-Lime Testing	TEX-121-E, Part III

The laboratory testing program was conducted in general accordance with applicable ASTM Test Methods. The results of the laboratory tests are provided on the Boring Logs in the Appendix. Portions of samples not altered or consumed by laboratory testing will be discarded 60 days from the date shown on this report.

2.4 SITE GEOLOGY

We reviewed the **San Antonio Sheet of the Geologic Atlas of Texas** in an effort to determine the geologic setting of the project site and surrounding areas. The Geologic Atlas of Texas was developed by the Bureau of Economic Geology at The University of Texas using aerial photography, data from various oil and gas exploration companies, and very limited ground reconnaissance. Our review indicates that the project is located in the **Fluviatile Terrace Deposits (Q_f)** of Quaternary Geologic Age and the **Midway Group (E_{mi})** of **Tertiary Geologic Age**. The San Antonio Sheet generally describes the Fluviatile Terrace Deposits as consisting of gravel, sand, silt and clay adjacent to the Edwards Plateau and predominantly gravel, limestone, dolomite and chert southeast of the plateau. The Midway Group (E_{mi}) consists of clay and sand in the upper portions that transition into mudstone. The soils are colored light gray to dark gray weathering to yellow and yellowish-brown.



2.5 SUBSURFACE CONDITIONS

The results of the field and laboratory investigation have been used to develop a generalized subsurface profile at the project site. The following subsurface descriptions highlight the major subsurface stratification features and material characteristics.

TABLE 2.5: GENERALIZED SUBSURFACE PROFILE TABLE

Top (ft)	Bot. (ft)	Soil Type	ω (%)	LL (%)	PI	-200 Sieve (%)	N	Sulfate Contents (PPM)
0	15	Fat Clay Fat Clay with Sand	9 – 30	53 – 91	32 – 65	79 – 99	2 – 30	< 100 ⁷

Note:

1. ω = Moisture Content (%)
2. LL = Liquid limit (%)
3. PI = Plasticity Index
4. -#200 Sieve = % Passing the #200 Sieve
5. N = Standard Penetration Test blow count (blows/foot)
6. Sulfate content in Parts per Million
7. Sulfate content Test performed in Boring B-01 at 0-1.5 feet.

The boring logs included in the Appendix should be reviewed for specific information at the boring locations. The boring logs include soil descriptions, stratifications, locations of the samples, and field and laboratory test data. The descriptions provided on the logs only represent the conditions at the specific boring location. The stratifications represent the approximate boundaries between subsurface materials. The actual transitions between strata may be more gradual and less distinct. Variations will occur and should be expected across the site.

2.5.1 GROUNDWATER INFORMATION

Water level measurements were performed during drilling and after completion of drilling. Specific information concerning groundwater is noted on each boring log presented in the Appendix of this report. Groundwater **was not** encountered during the field investigation of this site.

Groundwater levels fluctuate seasonally as a function of rainfall, proximity to creeks, rivers and lakes, the infiltration rate of the soil, seasonal and climatic variations and land usage. In relatively pervious soils, such as sandy soils, the indicated depths are a relatively reliable indicator of groundwater levels. In relatively impervious soils, water levels observed in the borings may not provide a reliable indication of groundwater elevations, even after several days. If a detailed water level evaluation is required, observation wells or piezometers can be installed at the site to monitor water levels.

The groundwater levels presented in this report were measured at the time of PSI field activities. The contractor should be prepared to control groundwater, if encountered during construction activities.



3.0 GEOTECHNICAL EVALUATION AND RECOMMENDATIONS

3.1 POTENTIAL VERTICAL MOVEMENT OF EXPANSIVE SOILS (PVM)

The soils encountered at the soil boring locations exhibit a **high to very high** potential for volumetric changes, due to fluctuations in soil moisture content. PSI has conducted laboratory testing on the soils to estimate the expansive soil potential with soil moisture variations. These soil moisture variations are based on historical climate change data for a particular site. Determining the soil potential for shrinking and swelling, combined with historical climate variation, aids the engineer in quantifying the soil movement potential of the soils supporting the floor slab and shallow foundations based on climate variations. Shrink/swell movement procedures using two soil modeling systems, the Post Tensioning Institute's (PTI) "Design of Post-Tensioned Slabs-on-Ground, 3rd Edition" and Texas Department of Transportation (TxDOT) method TEX-124-E, were utilized to approximate the Potential Vertical Movement (PVM) for this location.

The anticipated shrink/swell movement (PVM) is a soil movement estimated in consideration of soil properties and climatic moisture changes at a particular geographic location. Foundations on expansive soils are designed with sufficient stiffness to resist these soil movements to an acceptable magnitude.

3.1.1 SHRINK/SWELL MOVEMENT (PVM) ESTIMATE

Based on laboratory testing results and the TEX-124-E and the PTI methods, the potential vertical movement within the proposed project area was estimated to be **3 to 7 inches**.

It is not possible to accurately quantify actual soil moisture changes and resulting shrink/swell movements. The PVM and referenced structural movement values provided should be considered approximate values based on industry standard practice and experience. Extreme soil moisture variations could occur due to unusual drought severity, leaking water or sewer lines, perched groundwater infiltration, or seasonal springs. Also, soil transpiration from trees located adjacent to or previously underneath the building, downspouts directing roof discharge under the foundation, poor drainage or irrigation line breaks could lead to excessive movements.

Therefore, because of these unknown factors, the shrink/swell potential of soils can often be significantly underestimated using the previously mentioned methods of evaluating PVM.

The unknown factors previously mentioned cannot be determined at the time of the geotechnical study. Therefore, estimated shrink/swell movements are calculated only in consideration of historical climate data related to soil moisture variations from climate changes. Movements in excess of those estimated should be anticipated and regular maintenance should be provided to address these issues throughout the life of the structure.



4.0 PAVEMENT DESIGN RECOMMENDATIONS

4.1 PAVEMENT DESIGN PARAMETERS

PSI understands that flexible pavements will be considered for this project. Therefore, pavement design recommendations based on the criteria presented in the *Flexible Pavement Design Criteria* (adopted January 2011) a traffic loading of 100,000 and 1,000,000 18-kip Equivalent Single Axle Loads (ESALs) for flexible pavement was evaluated for a street classification of Local Streets Type A without bus traffic and with bus traffic, respectively. A traffic load of 2,000,000 18-kip ESALs for flexible pavement was evaluated for a street classification of Collector and Local Type B streets. A traffic load of 3,000,000 18-kip ESALs for flexible pavement was evaluated for a street classification of Arterial streets. PSI utilized the "AASHTO Guide for Design of Pavement Structures" published by the American Association of State Highway and Transportation Officials to evaluate the pavement thickness recommendations in this report. This method of design considers pavement performance, traffic, roadbed soil, pavement materials, environment, drainage, and reliability. Each of these items is incorporated into the design methodology. PSI is available to provide laboratory testing and engineering evaluation to refine the site-specific design parameters and sections, upon request.

PSI collected bulk soil samples of the native soils encountered at the site to conduct Atterberg Limits, Percent Finer than the No. 200 Sieve, California Bearing Ratio (CBR) test, and Lime Series Testing. The results for the Moisture Density Relationship and the CBR Tests are presented in the Appendix. The following table presents a summary of the results from our laboratory testing performed on the native soil.

TABLE 4.1: NATIVE SOIL TEST SUMMARY

Material	Liquid Limit (ASTM D4318)	Plasticity Index (ASTM D4318)	Percent Passing No. 200 Sieve	Laboratory CBR Value (ASTM D1883)	Lime Series (TxDOT TEX-121-E)
Fat Clay (CH) (bulk sample)	54	36	94	2.0	4%

TABLE 4.2: LIME SERIES RESULTS

% Lime By Weight	pH	PI
0	10.28	36
2	12.17	22
4	12.34	13
6	12.34	11
8	12.41	9
10	12.41	11

Based on the results of the laboratory testing, PSI has provided recommended pavement sections for pavements constructed on an improved subgrade. Details regarding the basis for this design are presented in the table below.



TABLE 4.3: PAVEMENT DESIGN PARAMETERS AND ASSUMPTIONS (FLEXIBLE)

City of St Hedwig Local Type A Streets	
Reliability, percent	70
Initial Serviceability Index, Flexible Pavement	4.2
Terminal Serviceability Index	2.0
Design Traffic Loading, Flexible Pavement	100,000 ESALs without bus traffic and 1,000,000 ESAL with bus traffic
Standard Deviation, Flexible Pavement	0.45
Subgrade California Bearing Ratio (CBR)	2.1
Subgrade Modulus of Subgrade Reaction, k in pci	100
City of St Hedwig Collector and Local Type B Streets	
Reliability, percent	90
Initial Serviceability Index, Flexible Pavement	4.2
Terminal Serviceability Index	2.0
Design Traffic Loading, Flexible Pavement	2,000,000 ESALs
Standard Deviation, Flexible Pavement	0.45
Subgrade California Bearing Ratio (CBR)	2.1
Subgrade Modulus of Subgrade Reaction, k in pci	100
City of St Hedwig Arterial Streets	
Reliability, percent	95
Initial Serviceability Index, Flexible Pavement	4.2
Terminal Serviceability Index	2.5
Design Traffic Loading, Flexible Pavement	3,000,000 ESALs
Standard Deviation, Flexible Pavement	0.45
Subgrade California Bearing Ratio (CBR)	2.1
Subgrade Modulus of Subgrade Reaction, k in pci	100

Asphaltic concrete pavements founded on top of expansive soils will be subjected to PVM soil movements estimated and presented in this report. These potential soil movements are typically activated to some degree during the life of the pavement. Consequently, pavements can be expected to crack and require periodic maintenance to reduce damage to the pavement structure.

During the paving life, maintenance to seal surface cracks within asphalt paving should be undertaken to achieve the desired paving life. Perimeter drainage should be controlled to prevent or retard influx of surface water from areas surrounding the paving. Water penetration leads to paving degradation. Water penetration into base or subgrade materials, sometimes due to irrigation or surface water infiltration leads to pre-mature paving degradation. Curbs should be used in conjunction with asphalt paving to reduce potential for infiltration of moisture into the base course. Curbs should extend the full depth of the base course and should extend at least 3 inches into the underlying clayey subgrade. The base layer should be tied into the area inlets to drain water that may collect in the base.

Material specifications, construction considerations, and section requirements are presented in following sections.



The presented recommended pavement sections are based on the field and laboratory test results for the project, local pavement design practice, design assumptions presented herein and previous experience with similar projects. The project Civil Engineer should verify that the ESAL and other design values are appropriate for the expected traffic and design life of the project. PSI should be notified in writing if the assumptions or design parameters are incorrect or require modification.

4.2 PAVEMENT SECTION RECOMMENDATIONS

PSI anticipated that the roadways and parking areas will be used primarily by passenger vehicles and delivery vehicles. PSI is providing parking and drive area sections based on experience with similar facilities constructed on similar soil conditions for the design traffic loading anticipated.

4.2.1 FLEXIBLE PAVEMENT

Recommendations for flexible asphaltic concrete pavement for roadways and parking areas are provided below.

FIGURE 4.1: FLEXIBLE PAVEMENT TYPICAL SECTION



TABLE 4.4: FLEXIBLE PAVEMENT SECTION OPTIONS

Material	Thicknesses			
Traffic Type	Local Type A without bus traffic	Local Type A with bus traffic	Collector and Local Type B	Arterial
Hot Mix Asphaltic Concrete	3"	4"	6"	7.5"
Import Flexible Base	12"	17"	18"	18"
Geogrid	No			
Compacted Subgrade ¹	8"			

1. Lime treatment of subgrade to a depth of 8-inches will be required for subgrade with a PI greater than 20. Treatment will require application rate of about 22.8 pounds per square yard for 8-inches of treatment.

TABLE 4.5: FLEXIBLE PAVEMENT SECTION OPTIONS (GEOGRID)

Material	Thicknesses			
Traffic Type	Local Type A without bus traffic	Local Type A with bus traffic	Collector and Local Type B	Arterial
Hot Mix Asphaltic Concrete Type D	2"	3"	4"	5"
Import Flexible Base	8"	12"	16"	16"
Geogrid	Yes			
Compacted Subgrade ¹	8"			

1. Lime treatment of subgrade to a depth of 8-inches will be required for subgrade with a PI greater than 20. Treatment will require application rate of about 22.8 pounds per square yard for 8-inches of treatment.
2. Tensar+ NX750 or equivalent.

4.2.2 GENERAL PAVEMENT DESIGN AND CONSTRUCTION RECOMMENDATIONS

TABLE 4.6: PAVEMENT DESIGN AND CONSTRUCTION RECOMMENDATIONS

Minimum Undercut Depth	6 inches or as needed to remove roots
Reuse Excavated Soils	Must be free of roots and debris and meet material requirements of intended use
Exposed Subgrade Treatment	Proof-roll with rubber-tired vehicle weighing at least 20 tons. A representative of the Geotechnical Engineer should be present during proof-roll.
Proof-Rolled Pumping and Rutting Areas	Excavate to firmer materials and replace with compacted general or select fill under direction of a representative of the Geotechnical Engineer
General Fill	Materials free of roots, debris, and other deleterious materials with a maximum rock size of 4 inches with a CBR greater than 3
Minimum General Fill Thickness	As required to achieve grade
Maximum General Fill Loose Lift Thickness	9 Inches
Flexible Base	TxDOT Item 247, Type A, Grade 1-2
Maximum Flexible Base Loose Lift Thickness	9 Inches
Lime Treated Subgrade	In accordance with "Cement Stabilization" item per Bexar County flexible pavement design criteria or COSA Standard Specifications for Construction Item 108 Lime Treated Subgrade. Estimate 4% by dry weight or 22.8 lbs per square yard.
Geogrid	Geogrid specification in accordance with "Mechanically Stabilized Layers" item per Bear County flexible pavement design criteria.
Hot Mix Asphaltic Concrete	TxDOT Item 340, Type D
Minimum and Maximum lift thickness (HMAC Type D)	Table 6-3: TxDOT Lift Thickness Requirements Minimum lift thickness: 1.5 inches Maximum lift thick thickness: 3.0 inches Placement Requirement: HMAC must be placed in equal lifts, not exceeding the maximum lift thickness.



TABLE 4.7: COMPACTION AND TESTING RECOMMENDATIONS FOR PAVEMENT AREAS

Location	Material	Density Test Method	Soil Type	Percent Compaction	Optimum Moisture Content	Testing Frequency
Pavement Areas	Subgrade, General Fill Soil, Low PI Material	Tex-114-E	PI \geq 25	94% to 98%	0 to +4%	1 per 10,000 SF; min. 3 tests
			PI $<$ 25	\geq 95%	0 to +4%	
	Flexible Base Material	TEX-113-E	COSA Item 200	\geq 95%	\pm 3%	1 per 5,000 SF; min. 3 per lift



5.0 CONSTRUCTION CONSIDERATIONS

Geotechnical Engineer Involvement at the Time of Construction – Foundation pad preparation recommendations on expansive clay sites in this area depend on the soil moisture conditions that exist due to the prevailing climate at the time of construction as well as the expansive properties of the clay.

It is recommended that the foundation pad recommendations presented in this report be confirmed immediately prior to construction by the Geotechnical-Engineer-of Record (GER). Wetter climate conditions near the time of construction can lead to a significant reduction in pad preparation requirements which can often be a substantial percentage of site development cost.

Having a Geotechnical Engineer retained to review the earthwork recommendations in the Construction Documents and be an active participant in team meetings near the time of construction can often result in project cost savings. Therefore, PSI recommends that an AASHTO accredited 3rd party laboratory with qualified professional engineers who specialize in geotechnical engineering be retained to provide observation and testing of construction activities involved in the foundations, earthwork, pavements and related activities of this project. As the GER, PSI's services can be retained as the 3rd party laboratory. PSI's participation would be advantageous to the project flow and value engineering during construction since we are most familiar with the existing soil conditions at the site.

The geotechnical engineer often does not have available all design information at the time of writing the original report since the report is done very early in the design process. The GER can be of great benefit immediately prior to construction since definitive information regarding the location of the building, surrounding flatwork, pavements, planned landscaping, and drainage features is available at that time. The GER can then write Supplement letters to the original geotechnical report often resulting in less risk and significant project cost savings.

PSI cannot accept responsibility for conditions which deviate from those described in this report, nor for the performance of the foundations or pavements if not engaged to also provide construction observation and materials testing for this project. The PSI geotechnical engineer of record should also be engaged by the Design Team during construction, even if periodic on-call testing is contracted with PSI Construction Services.



5.1 INITIAL SITE PREPARATION CONSIDERATIONS

5.1.1 SUBGRADE PREPARATION FOR SITE WORK OUTSIDE BUILDING PAD AND PAVEMENT AREAS

Grade adjustments outside of the foundation pad and pavement areas can be made using select or general fill materials. The clean excavated onsite soils may also be reused in areas not sensitive to movement.

TABLE 5.1: SUBGRADE PREPARATION FOR NON-STRUCTURAL - GENERAL FILL

Minimum Undercut Depth	6 inches or as needed to remove roots, organic and/or deleterious materials
Exposed Subgrade Treatment	Proof-roll subgrade with rubber-tired 20-ton (loaded) construction equipment Alternate Equipment can be used with Geotechnical Engineer Approval
Proof-Rolled Pumping and Rutting Areas	Excavate to firmer materials and replace with compacted general or select fill under direction of a representative of the Geotechnical Engineer
General Fill Type	Any clean material free of roots, debris and other deleterious material with a maximum particle size of 4 inches
Maximum General Fill Loose Lift Thickness	8 inches

TABLE 5.2: FILL COMPACTION RECOMMENDATIONS OUTSIDE OF BUILDING AND PAVEMENT AREAS

Location	Material	Test Method for Density Determination	Plasticity Index	Percent Compaction	Optimum Moisture Content	Testing Frequency
Outside of Structure / Pavement Areas	General Fill	ASTM D698	PI \geq 25	94% to 98%	0 to +4%	1 per 10,000 SF; min. 3 per lift
			PI $<$ 25	\geq 95%	0 to +4%	

5.1.2 EXISTING SITE CONDITIONS

The following table outlines construction considerations in consideration of demolition of existing paving, procedures for abandoning old utility lines and removing trees.



TABLE 5.3: CONSIDERATIONS FOR DEMOLITION, ABANDONING UTILITIES AND TREE REMOVAL

Abandoned Utilities	
Utilities of former structures located within new footprint of proposed structure	Remove pipe, bedding and backfill and then replace with select fill placed using controlled compaction
Utilities of former structures located outside of footprint of proposed structure	Abandon in place using a grout plug
Tree Removal	
Trees located within proposed building footprint; roadways, parking, and sidewalk areas; and within 15 feet of building area	Remove root system for full vertical and lateral extent and extend removal for at least 3 feet beyond presence of root fragments and replace void with compacted general fill or flowable fill

5.2 MOISTURE SENSITIVE SOILS/WEATHER RELATED CONCERN

Soils are sensitive to disturbances caused by construction traffic and changes in moisture content. During wet weather periods, increases in the moisture content of the soil can cause significant reduction in the soil strength and support capabilities. In addition, soils which become wet may be slow to dry and thus significantly retard the progress of grading and compaction activities. It will, therefore, be advantageous to perform earthwork, foundation, and construction activities during dry weather. A relatively all-weather compacted crushed limestone cap having a thickness of at least 6 inches should be provided as a working surface.

5.3 EXCAVATION OBSERVATIONS

Excavations should be observed by a representative of PSI prior to continuing construction activities in those areas. PSI needs to assess the encountered materials and confirm that site conditions are consistent with those discussed in this report. This is especially important to identify the condition and acceptability of the exposed subgrades under foundations and other structures that are sensitive to movement. Soft or loose soil zones encountered at the bottom of the excavations should be removed to the level of competent soils as directed by the Geotechnical Engineer or their representative. Cavities formed as a result of excavation of soft or loose soil zones should be backfilled with compacted select fill or lean concrete.

After opening, excavations should be observed, and concrete should be placed as quickly as possible to avoid exposure to wetting and drying. Surface run-off water should be drained away from the excavations and not be allowed to pond. Excavations left open for more than 48 hours should be protected to reduce evaporation or entry of moisture.

5.4 DRAINAGE CONSIDERATIONS

Water should not be allowed to collect in or adjacent to foundation excavations, on foundation surfaces, or on prepared subgrades within the construction area during or after construction. Proper drainage around grade-supported sidewalks and flatwork is important to reduce potential movements. Excavated areas should be sloped toward one corner to facilitate removal of collected rainwater, groundwater, or surface runoff. Providing rapid, positive drainage away from the building reduces moisture variations within the underlying soils and will aid in reducing the magnitude of potential movements.



5.5 EXCAVATIONS AND TRENCHES

Excavation equipment capabilities and field conditions may vary. Geologic processes are erratic and large variations can occur in small vertical and/or lateral distances. Details regarding "means and methods" to accomplish the work (such as excavation equipment and technique selection) are the sole responsibility of the project contractor. The comments contained in this report are based on small diameter borehole observations. The performance of large excavations may differ as a result of the differences in excavation sizes.

The Occupational Safety and Health Administration (OSHA) Safety and Health Standards (29 CFR Part 1926, Revised October 1989), require that excavations be constructed in accordance with the current OSHA guidelines. Furthermore, the State of Texas requires that detailed plans and specifications meeting OSHA standards be prepared for trench and excavation retention systems used during construction. PSI understands that these regulations are being strictly enforced, and if they are not closely followed, the owner and the contractor could be liable for substantial penalties.

The contractor is solely responsible for designing and constructing stable, temporary excavations and should shore, slope, or bench the sides of the excavations as required to maintain stability of both the excavation sides and bottom. The contractor's "responsible person", as defined in 29 CFR Part 1926, should evaluate the soil exposed in the excavations as part of the contractor's safety procedures. In no case should slope height, slope inclination, or excavation depth, including utility trench excavation depth, exceed those specified in local, State, and Federal safety regulations.

PSI is providing this information as a service to the client. PSI does not assume responsibility for construction site safety or the contractor's or other parties' compliance with local, State, and Federal safety or other regulations. A trench safety plan was beyond the scope of our services for this project.



6.0 REPORT LIMITATIONS

The recommendations submitted in this report are based on the available subsurface information obtained by PSI and design details furnished by the client for the proposed project. If there are revisions to the plans for this project, or if deviations from the subsurface conditions noted in this report are encountered during construction, PSI should be notified immediately to determine if changes in the foundation recommendations are required. If PSI is not notified of such changes, PSI will not be responsible for the impact of those changes on the project.

The Geotechnical Engineer warrants that the findings, recommendations, specifications, or professional advice contained herein have been made in accordance with generally accepted professional Geotechnical Engineering practices in the local area. No other warranties are implied or expressed. This report may not be copied without the expressed written permission of PSI.

After the plans and specifications are more complete, the Geotechnical Engineer should be retained and provided the opportunity to review the final design plans and specifications to check that the engineering recommendations have been properly incorporated in the design documents. At this time, it may be necessary to submit supplementary recommendations. If PSI is not retained to perform these functions, PSI will not be responsible for the impact of those conditions on the project.

This report has been prepared for the exclusive use of Lennar for specific application to the proposed The Estates at Martinez- Streets to be constructed at Abbott Rd. in St Hedwig, Texas.



APPENDIX






3 Burwood Lane, San Antonio, Texas
(210) 342-9377 FAX (210) 342-9401

Site Vicinity Map

The Estates at Martinez
Abbott Rd.
St Hedwig, Texas
PSI Project No.: 0312-3441

NOT TO SCALE



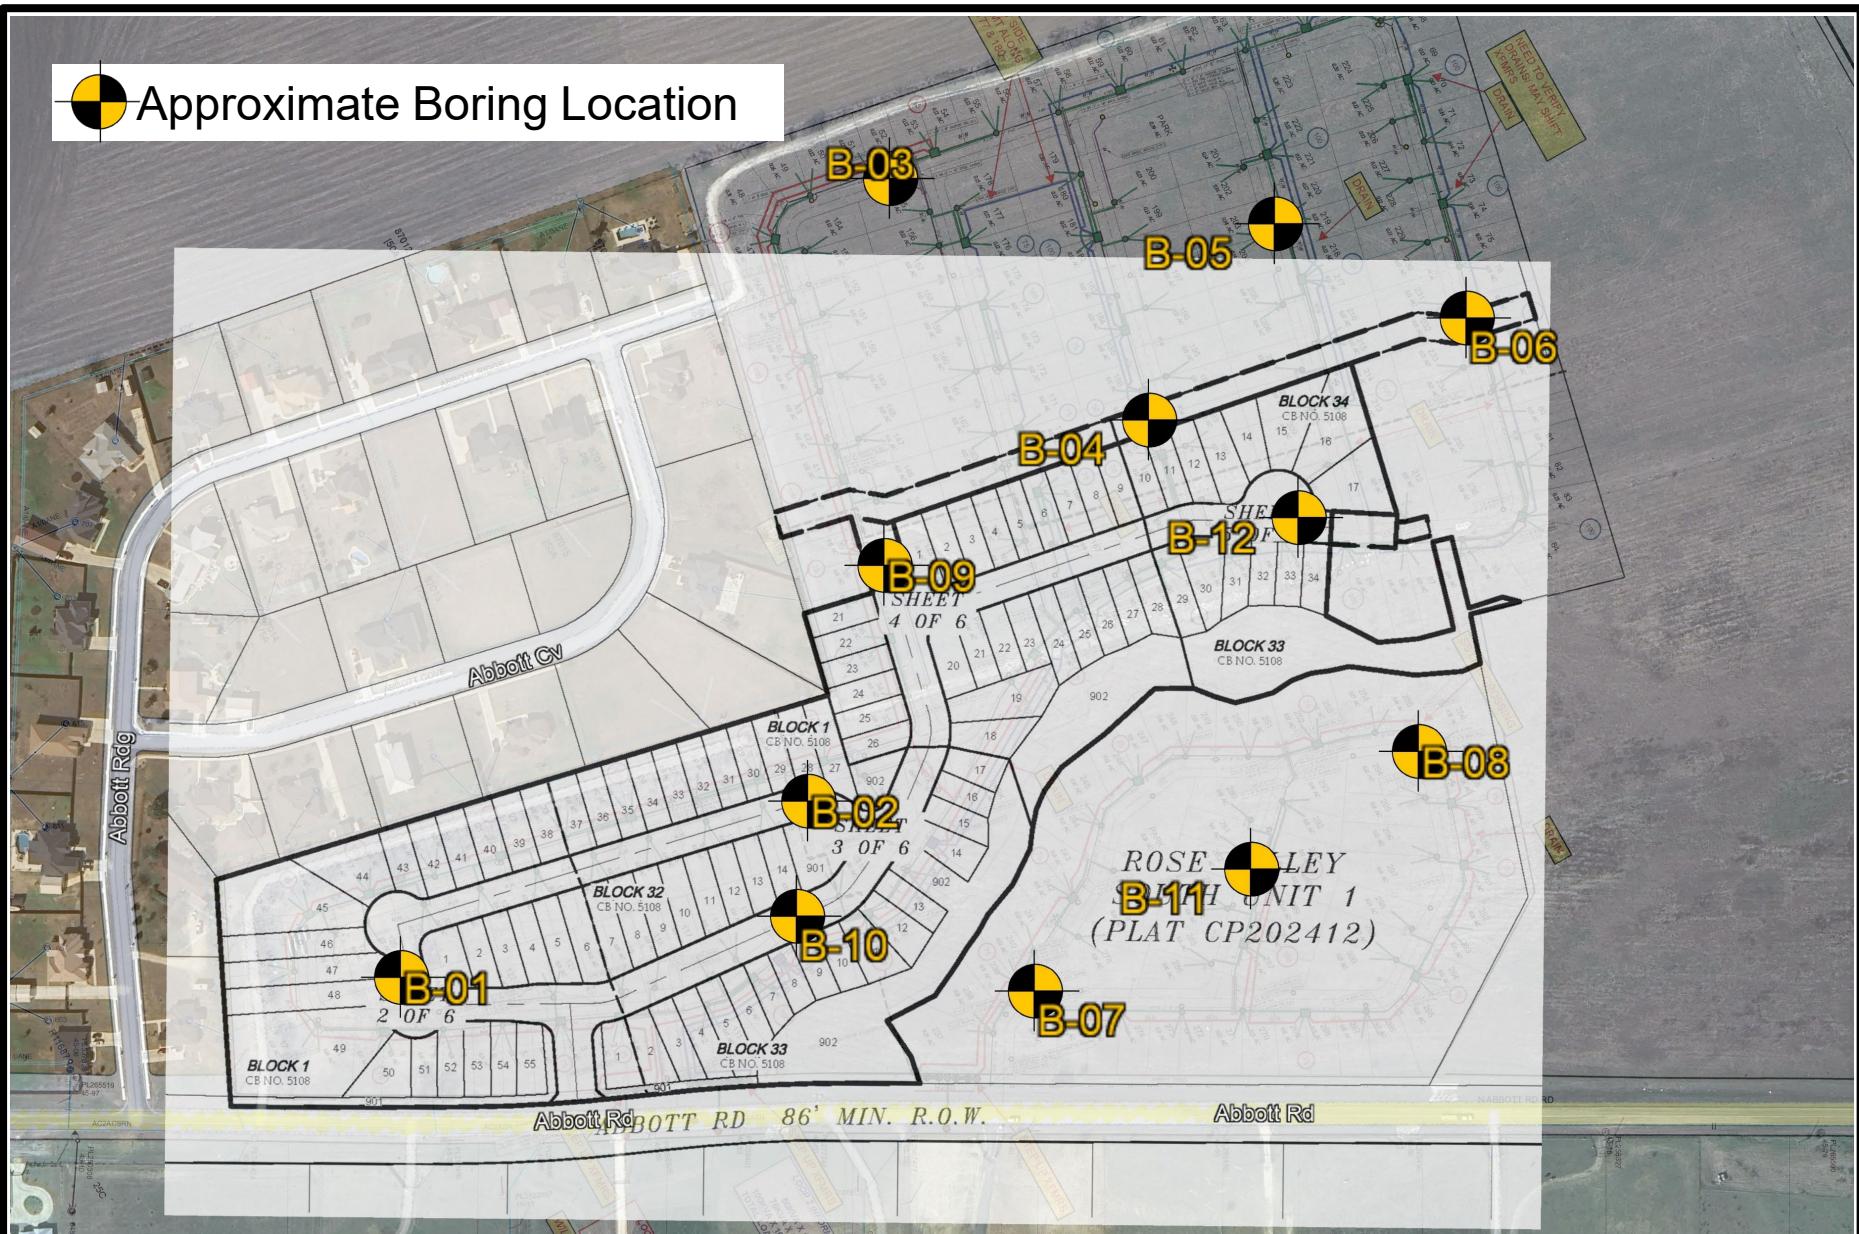

3 Burwood Lane, San Antonio, Texas
(210) 342-9377 FAX (210) 342-9401

Boring Location Plan

The Estates at Martinez
Abbott Rd.
St Hedwig, Texas
PSI Project No.: 0312-3441

NOT TO SCALE






CBR Results



Test No.	Blows/lift	Dry Unit Weight	% Compact.	Water Content %	CBR at 0.1 in	CBR at 0.2 in
1	80	86.33	88%	25.8	1.5	1.4
2	110	89.85	91%	26.9	1.8	1.7
3	130	93.08	95%	23.7	2.1	1.8

intertek
psi

95% Max Dry Density (pcf) 93.3 Selected CBR Value 2.1 FAT CLAY (CH)

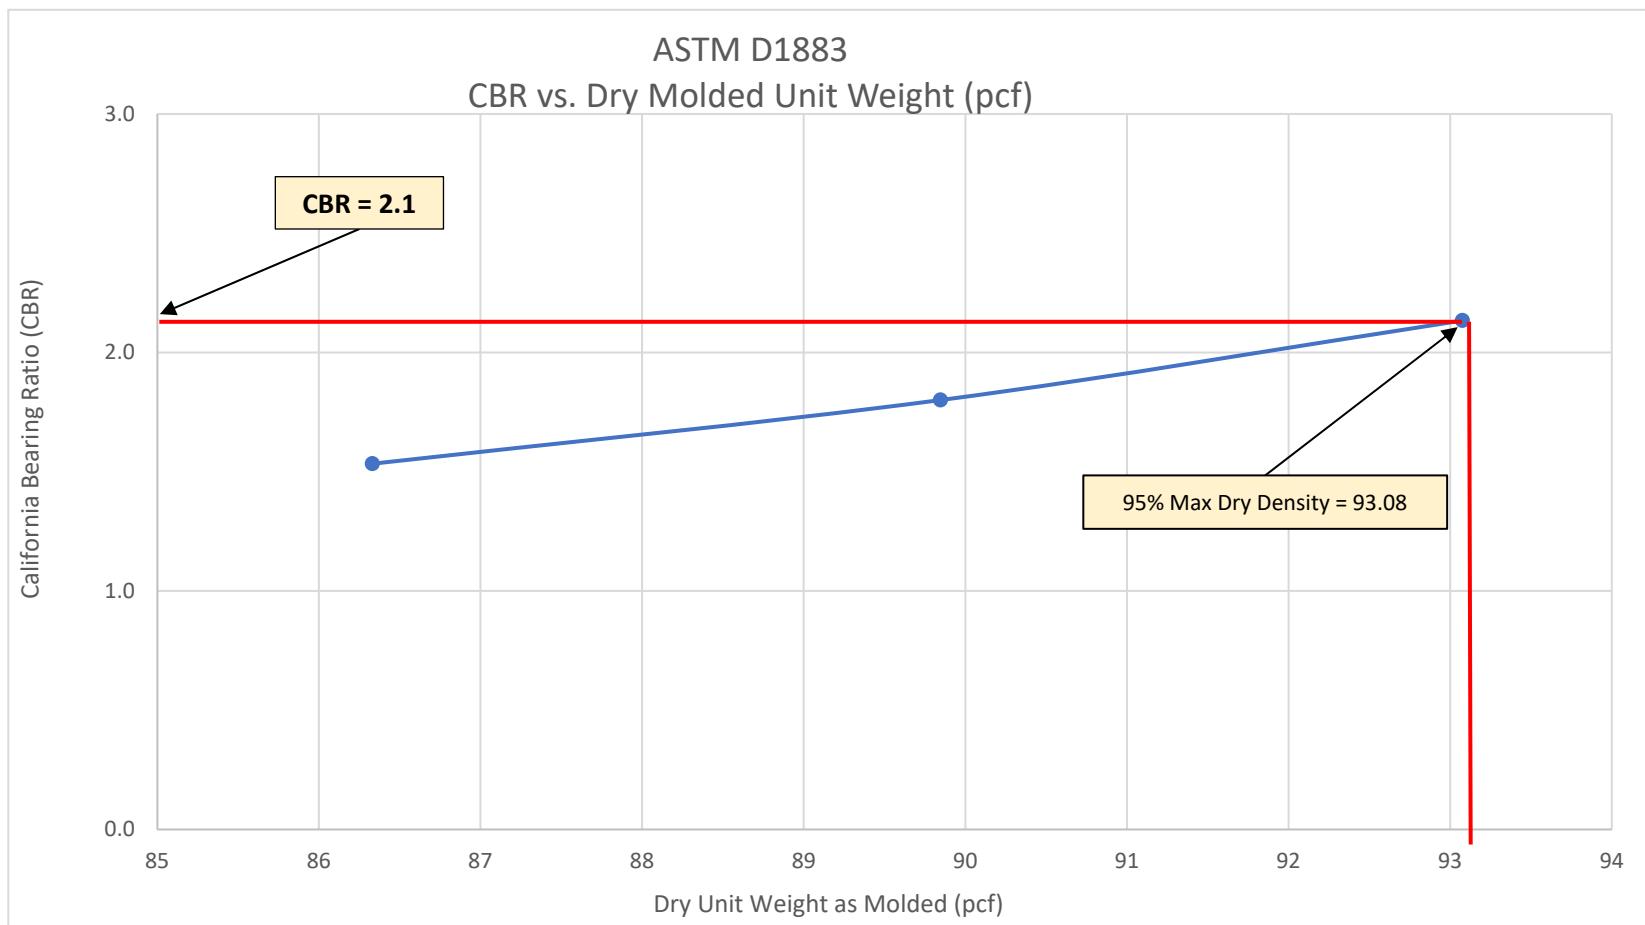



BORING LOGS



The Estates at Martinez - Streets

Abbott Rd., St. Hedwig, Texas

Project No. 0312-3441

BORING B-01

LOCATION: See Boring Location Plan

DEPTH, FT.	DEPTH, FT.	SOIL DESCRIPTION	MOISTURE CONTENT	% RETAINED #4	% PASSING #200	SPT (N) & TCP (T) VALUES	% REC	% RQD	LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	UNCONF. COMP. (TSF)	UNIT DRY WT. (LBCU FT)
		Elevation:											
		FAT CLAY (CH), brown, stiff to very stiff Sulfate Content: <100 PPM	18			12							
5		-transitions to mottled tan and gray at 4.5 feet	17			14							
10			20			12							
15			26			15							
20			30	97	27	91	30	61					
		Boring terminated at approximately 15 feet.	25			22							

COMPLETION DEPTH: 15.0 Feet

DATE: 12/16/24-12/16/24

intertek
psi

DEPTH TO GROUND WATER

SEEPAGE (ft.): NONE ENCOUNTERED

END OF DRILLING (ft.): NONE ENCOUNTERED

DELAYED WATER LEVEL (FT): N/A

The Estates at Martinez - Streets

Abbott Rd., St. Hedwig, Texas

Project No. 0312-3441

BORING B-02

LOCATION: See Boring Location Plan

DEPTH, FT.	SYMBOL	SAMPLES	WATER	SOIL DESCRIPTION		MOISTURE CONTENT	% RETAINED #4	% PASSING #200	SPT (N) & TCP (T) VALUES	% REC	% RQD	LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	○ HANPEN (TSF) 2.0 4.0 6.0	● UNC CMP (TSF)	UNCONF. COMP. (TSF)	UNIT DRY WT. (LBCU/FT)	
				Elevation:															
				FAT CLAY (CH) with SAND, brown, stiff		14	2	79	13			58	26	32		X			
						11			12										
5				FAT CLAY (CH), mottled tan and gray, stiff to very stiff		9			15							X			
						16	1	97	12			57	23	34		X			
						17			11							X			
						22			18							X			
15				Boring terminated at approximately 15 feet.															
20																			

COMPLETION DEPTH: 15.0 Feet

DATE: 12/16/24-12/16/24

intertek
psi

DEPTH TO GROUND WATER

SEEPAGE (ft.): NONE ENCOUNTERED

END OF DRILLING (ft.): NONE ENCOUNTERED

DELAYED WATER LEVEL (FT): N/A

The Estates at Martinez - Streets

Abbott Rd., St. Hedwig, Texas

Project No. 0312-3441

BORING B-03

LOCATION: See Boring Location Plan

DEPTH, FT.	DEPTH, FT.	SOIL DESCRIPTION	MOISTURE CONTENT	% RETAINED #4	% PASSING #200	SPT (N) & TCP (T) VALUES	% REC	% RQD	LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	UNCONF. COMP. (TSF)	UNIT DRY WT. (LBCU FT)
		Elevation:											
		FAT CLAY (CH), mottled tan and gray, stiff to very stiff	13			16							
5			22		98	18			80	24	56		
			20			14							
		-transitions to gray at 6.5 feet	23			15							
10			29		99	15			90	25	65		
			26			15							
15		Boring terminated at approximately 15 feet.											
20													

COMPLETION DEPTH: 15.0 Feet

DATE: 12/16/24-12/16/24

intertek
psi

DEPTH TO GROUND WATER

SEEPAGE (ft.): NONE ENCOUNTERED

END OF DRILLING (ft.): NONE ENCOUNTERED

DELAYED WATER LEVEL (FT): N/A

The Estates at Martinez - Streets

Abbott Rd., St. Hedwig, Texas

Project No. 0312-3441

BORING B-04

LOCATION: See Boring Location Plan

DEPTH, FT.	SYMBOL	SAMPLES	WATER	SOIL DESCRIPTION		MOISTURE CONTENT	% RETAINED #4	% PASSING #200	SPT (N) & TCP (T) VALUES	% REC	% RQD	LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	UNCONF. COMP. (TSF)			UNCONF. COMP. (TSF)	UNIT DRY WT. (LBCU FT)
				Elevation:	FAT CLAY (CH), mottled tan and gray, stiff to very stiff										2.0	4.0	6.0		
5						13			12										
10						19			14										
15						22			13										
20						26	99	26	18	79	23	56							
						26			14										
						25			18										
					Boring terminated at approximately 15 feet.														

COMPLETION DEPTH: 15.0 Feet

DATE: 12/16/24-12/16/24



DEPTH TO GROUND WATER

SEEPAGE (ft.): NONE ENCOUNTERED

END OF DRILLING (ft.): NONE ENCOUNTERED

DELAYED WATER LEVEL (FT): N/A

The Estates at Martinez - Streets

Abbott Rd., St. Hedwig, Texas

Project No. 0312-3441

BORING B-05

LOCATION: See Boring Location Plan

DEPTH, FT.	DEPTH, FT.	SOIL DESCRIPTION	MOISTURE CONTENT	% RETAINED #4	% PASSING #200	SPT (N) & TCP (T) VALUES	% REC	% RQD	LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	UNCONF. COMP. (TSF)	UNIT DRY WT. (LBCU/FT)
		Elevation:											
		FAT CLAY (CH) with SAND, brown, stiff	15			11							
		FAT CLAY (CH), brown, stiff to very stiff	19			14							
5			21	96	11				68	24	44		
			22			15							
			23			14							
10													
15													
		-transitions to gray at 13.5 feet	26			17							
15		Boring terminated at approximately 15 feet.											
20													

COMPLETION DEPTH: 15.0 Feet

DATE: 12/16/24-12/16/24

intertek
psi

DEPTH TO GROUND WATER

SEEPAGE (ft.): NONE ENCOUNTERED

END OF DRILLING (ft.): NONE ENCOUNTERED

DELAYED WATER LEVEL (FT): N/A

The Estates at Martinez - Streets

Abbott Rd., St. Hedwig, Texas

Project No. 0312-3441

BORING B-06

LOCATION: See Boring Location Plan

DEPTH, FT.	DEPTH, FT.	SOIL DESCRIPTION	MOISTURE CONTENT	% RETAINED #4	% PASSING #200	SPT (N) & TCP (T) VALUES	% REC	% RQD	LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	UNCONF. COMP. (TSF)	UNIT DRY WT. (LBCU/FT)
		Elevation:											
		FAT CLAY (CH) with SAND, brown, stiff	13			10							
		FAT CLAY (CH), brown, stiff to very stiff	19			11							
5		-transitions to mottled tan and gray at 4.5 feet	19			18							
			19			15							
10			17	86	18				53	20	33		
			20			14							
15		Boring terminated at approximately 15 feet.											
20													

COMPLETION DEPTH: 15.0 Feet

DATE: 12/16/24-12/16/24

intertek
psi

DEPTH TO GROUND WATER

SEEPAGE (ft.): NONE ENCOUNTERED

END OF DRILLING (ft.): NONE ENCOUNTERED

DELAYED WATER LEVEL (FT): N/A

The Estates at Martinez - Streets

Abbott Rd., St. Hedwig, Texas

Project No. 0312-3441

BORING B-07

LOCATION: See Boring Location Plan

DEPTH, FT.	SYMBOL	SAMPLES	WATER	SOIL DESCRIPTION	MOISTURE CONTENT	% RETAINED #4	% PASSING #200	SPT (N) & TCP (T) VALUES	% REC	% RQD	LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	HARD PEN (TSF) UNC CMB (TSF)			UNCONF. COMP. (TSF)	UNIT DRY WT. (LBCU/FT)	
														2.0	4.0	6.0			
PL	WC	LL																	
5				FAT CLAY (CH) with SAND, brown, very soft	17			2											
10				FAT CLAY (CH), mottled brown and gray, very stiff	25	94	24				86	30	56						
15				-transitions to mottled tan and gray at 8.5 feet	28		22												
					29		16												
					27		18												
					28		24												
				Boring terminated at approximately 15 feet.															

COMPLETION DEPTH: 15.0 Feet

DATE: 12/16/24-12/16/24

intertek
psi

DEPTH TO GROUND WATER

SEEPAGE (ft.): NONE ENCOUNTERED

END OF DRILLING (ft.): NONE ENCOUNTERED

DELAYED WATER LEVEL (FT): N/A

The Estates at Martinez - Streets

Abbott Rd., St. Hedwig, Texas

Project No. 0312-3441

BORING B-08

LOCATION: See Boring Location Plan

DEPTH, FT.	SYMBOL	SAMPLES	WATER	SOIL DESCRIPTION		MOISTURE CONTENT	% RETAINED #4	% PASSING #200	SPT (N) & TCP (T) VALUES	% REC	% RQD	LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	UNCONF. COMP. (TSF)			UNCONF. COMP. (TSF)	UNIT DRY WT. (LBCU/FT)
				Elevation:	Material Description										2.0	4.0	6.0		
5					FAT CLAY (CH), brown, stiff to very stiff	15			14										
10						19			20										
15						20			20										
20						21	95	14	17			67	22	45					
					Boring terminated at approximately 15 feet.	21			20										
						26													

COMPLETION DEPTH: 15.0 Feet

DATE: 12/16/24-12/16/24



DEPTH TO GROUND WATER

SEEPAGE (ft.): NONE ENCOUNTERED

END OF DRILLING (ft.): NONE ENCOUNTERED

DELAYED WATER LEVEL (FT): N/A

The Estates at Martinez - Streets

Abbott Rd., St. Hedwig, Texas

Project No. 0312-3441

BORING B-09

LOCATION: See Boring Location Plan

DEPTH, FT.	DEPTH, FT.	SOIL DESCRIPTION	MOISTURE CONTENT	% RETAINED #4	% PASSING #200	SPT (N) & TCP (T) VALUES	% REC	% RQD	LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	UNCONF. COMP. (TSF)	UNIT DRY WT. (LBCU FT)
		Elevation:											
		FAT CLAY (CH), brown, stiff to very stiff	19			18							
			21		96	12			78	24	54		
5		-transitions to mottled tan and gray at 4.5 feet	29			10							
			27		99	15			92	36	56		
			27			16							
			27			15							
15		Boring terminated at approximately 15 feet.											
20													

COMPLETION DEPTH: 15.0 Feet

DATE: 12/16/24-12/16/24

intertek
psi

DEPTH TO GROUND WATER

SEEPAGE (ft.): NONE ENCOUNTERED

END OF DRILLING (ft.): NONE ENCOUNTERED

DELAYED WATER LEVEL (FT): N/A

The Estates at Martinez - Streets

Abbott Rd., St. Hedwig, Texas

Project No. 0312-3441

BORING B-10

LOCATION: See Boring Location Plan

DEPTH, FT.	DEPTH, FT.	SOIL DESCRIPTION	MOISTURE CONTENT	% RETAINED #4	% PASSING #200	SPT (N) & TCP (T) VALUES	% REC	% RQD	LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	UNCONF. COMP. (TSF)	UNIT DRY WT. (LBCU/FT)
		Elevation:											
		FAT CLAY (CH), brown, stiff to very stiff											
	18												
5	19												
10	20	-transitions to mottled tan and brown at 4.5 feet		94	23	26			76	24	52		
15	25					25							
20	29					19							
	29	Boring terminated at approximately 15 feet.				18							

COMPLETION DEPTH: 15.0 Feet

DATE: 12/16/24-12/16/24

intertek
psi

DEPTH TO GROUND WATER

SEEPAGE (ft.): NONE ENCOUNTERED

END OF DRILLING (ft.): NONE ENCOUNTERED

DELAYED WATER LEVEL (FT): N/A

The Estates at Martinez - Streets

Abbott Rd., St. Hedwig, Texas

Project No. 0312-3441

BORING B-11

LOCATION: See Boring Location Plan

DEPTH, FT.	DEPTH, FT.	SOIL DESCRIPTION	MOISTURE CONTENT	% RETAINED #4	% PASSING #200	SPT (N) & TCP (T) VALUES	% REC	% RQD	LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	UNCONF. COMP. (TSF)	UNIT DRY WT. (LBCU/FT)
		Elevation:											
		FAT CLAY (CH), brown, stiff to very stiff											
	21												
5	17												
10	27	-transitions to mottled tan and gray at 4.5 feet											
15	29												
20	27												
	26	Boring terminated at approximately 15 feet.											

COMPLETION DEPTH: 15.0 Feet

DATE: 12/16/24-12/16/24

intertek
psi

DEPTH TO GROUND WATER

SEEPAGE (ft.): NONE ENCOUNTERED

END OF DRILLING (ft.): NONE ENCOUNTERED

DELAYED WATER LEVEL (FT): N/A

The Estates at Martinez - Streets

Abbott Rd., St. Hedwig, Texas

Project No. 0312-3441

BORING B-12

LOCATION: See Boring Location Plan

DEPTH, FT.	DEPTH, FT.	SOIL DESCRIPTION	MOISTURE CONTENT	% RETAINED #4	% PASSING #200	SPT (N) & TCP (T) VALUES	% REC	% RQD	LIQUID LIMIT	PLASTIC LIMIT	PLASTICITY INDEX	UNCONF. COMP. (TSF)	UNIT DRY WT. (LBCU FT)
		Elevation:											
		FAT CLAY (CH), brown, firm to very stiff	14			7							
5			19			10							
			17			7							
			17	85	19				70	21	49		
10		-transitions to mottled tan and brown at 8.5 feet	22			25							
			25			30							
15		Boring terminated at approximately 15 feet.											
20													

COMPLETION DEPTH: 15.0 Feet

DATE: 12/16/24-12/16/24

intertek
psi

DEPTH TO GROUND WATER

SEEPAGE (ft.): NONE ENCOUNTERED

END OF DRILLING (ft.): NONE ENCOUNTERED

DELAYED WATER LEVEL (FT): N/A

KEY TO TERMS AND SYMBOLS USED ON LOGS

ROCK CLASSIFICATION

RECOVERY

DESCRIPTION OF RECOVERY	% CORE RECOVERY
Incompetent	< 40
Competent	40 TO 70
Fairly Continuous	70 TO 90
Continuous	90 TO 100

ROCK QUALITY DESIGNATION (RQD)

DESCRIPTION OF ROCK QUALITY	RQD
Very Poor (Vpo)	0 TO 25
Poor (Po)	25 TO 50
Fair (F)	50 TO 75
Good (Gd)	75 TO 90
Excellent (ExInt)	90 TO 100

CONSISTENCY OF COHESIVE SOILS

CONSISTENCY	N-VALUE (Blows/Foot)	SHEAR STRENGTH (tsf)	HAND PEN VALUE (tsf)
Very Soft	0 TO 2	0 TO 0.125	0 TO 0.25
Soft	2 TO 4	0.125 TO 0.25	0.25 TO 0.5
Firm	4 TO 8	0.25 TO 0.5	0.5 TO 1.0
Stiff	8 TO 15	0.5 TO 1.0	1.0 TO 2.0
Very Stiff	15 TO 30	1.0 TO 2.0	2.0 TO 4.0
Hard	>30	>2.0 OR 2.0+	>4.0 OR 4.0+

SOIL DENSITY OR CONSISTENCY

DENSITY (GRANULAR)	CONSISTENCY (COHESIVE)	THD (BLOWS/FT)	FIELD IDENTIFICATION
Very Loose (VLo)	Very Soft (VSo)	0 TO 8	Core (height twice diameter) sags under own weight
Loose (Lo)	Soft (So)	8 TO 20	Core can be pinched or imprinted easily with finger
Slightly Compact (SICmpct)	Stiff (St)	20 TO 40	Core can be imprinted with considerable pressure
Compact (Cmpct)	Very Stiff (VSt)	40 TO 80	Core can only be imprinted slightly with fingers
Dense (De)	Hard (H)	80 TO 5'/100	Core cannot be imprinted with fingers but can be penetrated with pencil
Very Dense (VDe)	Very Hard (VH)	5'/100 to 0'/100	Core cannot be penetrated with pencil

BEDROCK HARDNESS

MORHS' SCALE	CHARACTERISTICS	EXAMPLES	APPROXIMATE THD PEN TEST
5.5 to 10	Rock will scratch knife	Sandstone, Chert, Schist, Granite, Gneiss, some Limestone	Very Hard (VH) 0" to 2'/100
3 to 5.5	Rock can be scratched with knife blade	Siltstone, Shale, Iron Deposits, most Limestone	Hard (H) 1" to 5'/100
1 to 3	Rock can be scratched with fingernail	Gypsum, Calcite, Evaporites, Chalk, some Shale	Soft (So) 4" to 6'/100

RELATIVE DENSITY FOR GRANULAR SOILS

APPARENT DENSITY	SPT (BLOWS/FT)	CALIFORNIA SAMPLER (BLOWS/FT)	MODIFIED CA. SAMPLER (BLOWS/FT)	RELATIVE DENSITY (%)
Very Loose	0 to 4	0 to 5	0 to 4	0 to 15
Loose	4 to 10	5 to 15	5 to 12	15 to 35
Medium Dense	10 to 30	15 to 40	12 to 35	35 to 65
Dense	30 to 50	40 to 70	35 to 60	65 to 85
Very Dense	>50	>70	>60	85 to 100

ABBREVIATIONS

PL – Plastic Limit

Q_P – Hand Penetrometer

LL – Liquid Limit

Q_U – Unconfined Compression Test

WC – Percent Moisture

UU – Unconsolidated Undrained Triaxial

WATER SEEPAGE


Note: Plot Indicates Shear Strength as Obtained By Above Tests

WATER LEVEL AT END OF DRILLING

U.S. STANDARD SIEVE SIZE(S)

CLASSIFICATION OF GRANULAR SOILS

6"	3"	3/4"	4	10	40	200	
GRAVEL				SAND			
BOULDERS	COBBLES	COARSE	FINE	COARSE	MEDIUM	FINE	SILT OR CLAY
							CLAY

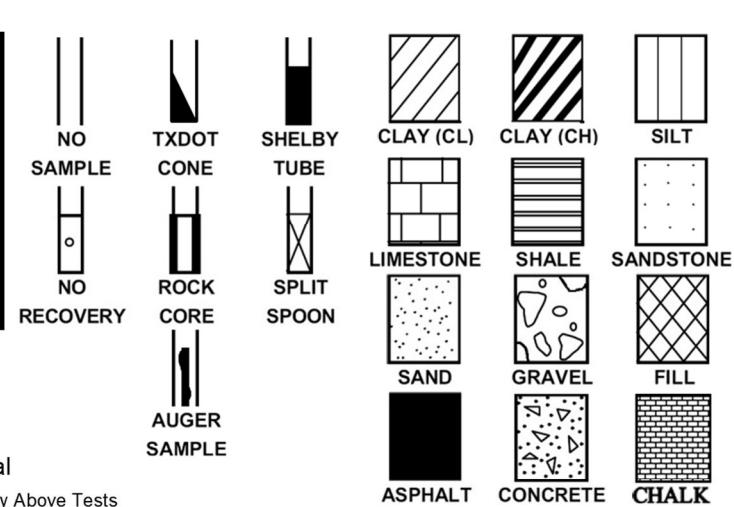

A COMPLETE BUILDING SOLUTION

Everything you need from start to finish - Assurance, Testing, Inspection, and Certification





The ever increasing challenges of designing, constructing, and maintaining a building can be difficult for any organization to navigate. From compliance to local and national codes, to ensuring an efficient design, to property management, Intertek-PSI's team of architects, engineers, scientists, and technicians understand firsthand the complexities of successfully constructing a commercial building. Our full suite of services give us unique insight into all phases of a project. Regardless of the project size or complexity, Intertek-PSI delivers engineering, consulting, and testing services to support site selection, design, construction, and property management.

As a leader in providing comprehensive solutions to industries around the globe, Intertek-PSI prides itself on bringing the expertise and services necessary for our clients to meet all of their needs across their entire operation. **Our Assurance, Testing, Inspection, and Certification (A.T.I.C.)** suite of services ensures that whatever your needs may be – assurance, testing, inspection, certification, or all of the above, that those needs will be met by Intertek-PSI.



Site Selection

A diverse range of services from geotechnical investigations, due diligence, industrial hygiene, and site surveys, for your building environment.



Design Phase

Our expertise offers engineering, consulting, evaluation, and peer review to ensure a well designed project.



Building Product & Construction Materials

The most comprehensive suite of testing and certification services for construction materials and building products.



Construction Project

Vital services throughout the construction process including inspection, testing, monitoring, mock-ups, and consulting.



Building Maintenance

Evaluation of a building's condition through inspection and testing, investigation, and remediation plan development.



Decommissioning & Transfer

Services that expedite and ensure compliance of the transfer or decommissioning of property or building.